




(East Face)

PIER 1 ELEVATION (West Face)

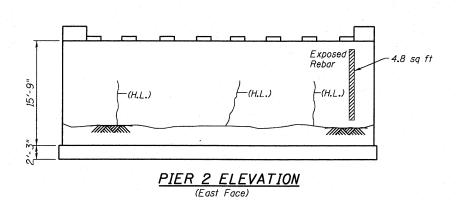


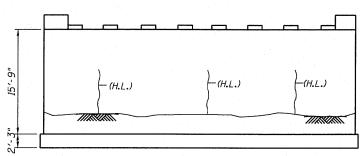


PIER 2 ELEVATION (West Face)

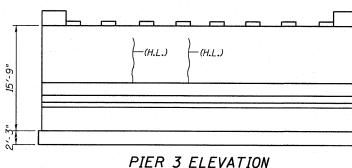


PIER 3 ELEVATION (West Face)

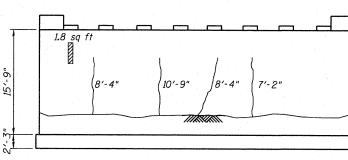

PIER 3 ELEVATION (East Face)

 

EAST ABUTMENT ELEVATION

 

WEST ABUTMENT ELEVATION

LEGEND



Structural Repair of Concrete (depth equal to or less than 5 inches)

Epoxy Crack Injection

(H.L.)-

Hairline crack (not to be sealed)

BILL OF MATERIALS

Item	Unit	Total
poxy Crack Injection	Foot	61
Structural Repair of Concrete 'depth equal to or less than 5 inches)	Sq Ft	101

The cracks and spall areas of the existing substructure shown on this plan are for general reference only. They have been taken from the bridge condition report and they are not guaranteed. The contractor shall take all field measurements of the cracks and spall areas necessary to assure proper repair for the substructure and shall assure full responsibility for the repair work.

FILE NAME =	DESIGNED	EV	REVISED -
\0162121-026-ExistingSubstructureCondtions.	dg∂RAWN	JCP	REVISED -
PLOT TIME = 10:36:18 AM	CHECKED	PC	REVISED -
PLOT DATE = 6/30/2011	DATE	07 01 2011	REVISED -

SEP8	TEIN
600 WEST FULTON STREET	TEL 312 454 9100
CHICAGO, ILLINOIS	FAX 312 559 121
COCC4 40F0	March

STATE OF ILLINOIS **DEPARTMENT OF TRANSPORTATION**

EXISTING SUBSTRUCTURE REPAIRS	F.A.P. RTE.	SECTION	COUNTY	TOTAL	SHEET NO.	
STRUCTURE NO. 016-2121	332	0101.1 BR-3	СООК	60	41	
				CONTRACT NO. 62421		
SHEET NO. S26 OF S29 SHEETS	ILLINOIS FED. AID PROJECT					