
STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION

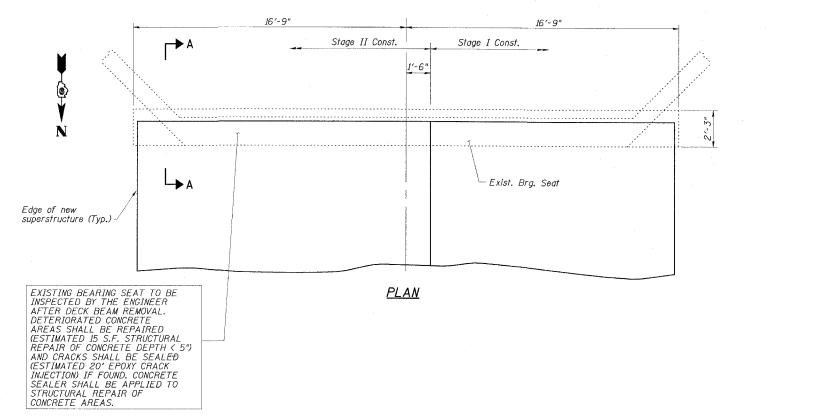



	2'-0"			
=	9"	1'-3"		
w ₄		•		
				-
'				
			- Exist. Cap	ies
				Vari
				∾ত
,				2'-9" & Varies
				2
				<u>j</u> _
Bk. Abut.				
		1'-6"±		
	-		-	

<u>SOUTH ABUTMENT</u> BILL OF MATERIAL

<i>Item</i>	Unit	Quantity
Concrete Sedier	Sq. Ft.	15
Epoxy Crack Injection	Foot :	20
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	. 15


SECTION A-A

REPAIR LEGEND

Inspection Date: 02/01/07

C.-6' Crack to be epoxy injected

Delaminated or Spalled Area -Use Structural Repair of Concrete

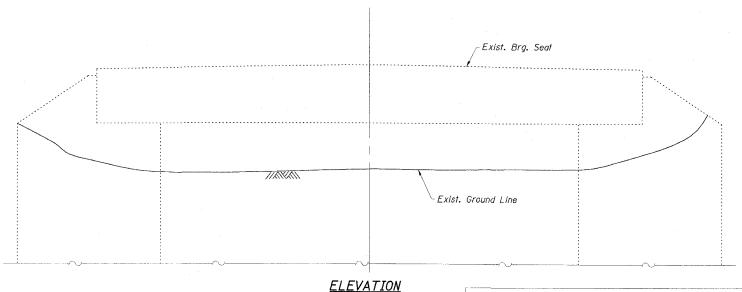

ESCA
CONSULTANTS, INC.

DESIGNED BY: JMS 05/07
DRAWN BY: HAG 05/07
CHECKED BY: MTD 06/07
APPROVED BY: RDP 06/07

NOTE: ABUTMENT CRACK REPAIR LENGTHS AND STRUCTURAL
REPAIR OF CONCRETE REPAIR AREAS ARE ESTIMATED
FROM 02-01-07 SURVEY WORK. ACTUAL LOCATIONS AND
QUANTITIES OF REPAIRS SHALL BE SHOWN BY THE
ENGINEER ON THE AS-BUILT PLANS FOR THIS SECTION.

SOUTH ABUTMENT
IL 34/145 OVER BRIER CREEK
FAP ROUTE 132 - SECTION 1BR-1
SALINE COUNTY
STATION 102+28.00
STRUCTURE NO. 083-0018