
STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION

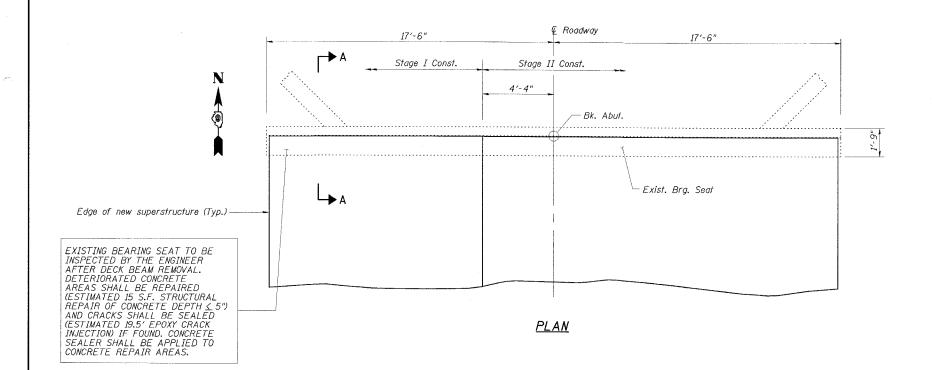

ROUTE NO.	SECTION	co	UNTY	FOTAL SHEETS	SHEET NG.	SHEET NO. 10
FAP 328	*		ITE	42	21	17 SHEETS
FED. PDAD D		ILLIM019	FEG. All) PRO	авст-		
98997	-				*(IO5X)BR	

1'-2"

6'2" 1'-0" 2'2"

SECTION A-A

Bk. Abut.

— Exist. Cap ∞

NORTH ABUTMENT BILL OF MATERIAL


Concrete Sealer	Sq. Ft.	<i>1</i> 5
Epoxy Crack Injection	Foot	25
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	28

REPAIR LEGEND

Inspection Date: 12/14/06

C.-6' Crack to be epoxy injected

S.F. Opelaminated or Spalled Area -Use Structural Repair of Concrete

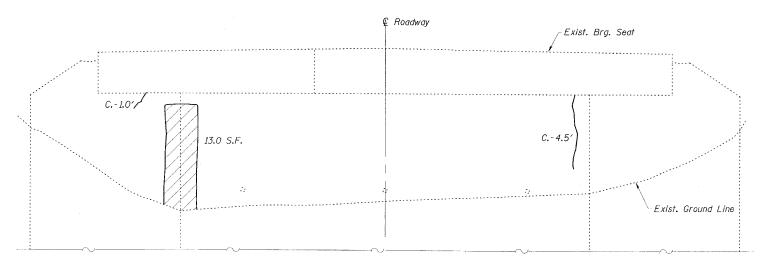

ELEVATION

NOTE: ABUTMENT CRACK REPAIR LENGTHS AND STRUCTURAL REPAIR OF CONCRETE AREAS ARE ESTIMATED FROM 12-14-06 SURVEY WORK. ACTUAL LOCATIONS AND QUANTITIES OF REPAIRS SHALL BE SHOWN BY THE ENGINEER ON THE AS-BUILT PLANS FOR THIS SECTION.

ESCA CONSULTANTS, INC.

NORTH ABUTMENT US 45 OVER SKILLET FORK OVERFLOW FAP ROUTE 328 - SECTION (105X)BR WHITE COUNTY STATION 598+76.00 STRUCTURE NO. 097-0019