BILL OF MATERIAL

ITEM	UNIT	TOTAL
Epoxy Crack Injection	Foot	78
Structural Repair of Concrete (Depth Greater Than 5 Inches)	Sq. Ft.	5
Structural Repair of Concrete (Depth Equal to or Less Than 5 Inches)	Sq. Ft.	5


indicates Epoxy Crack Injection

3'-0" 3'-0" 26'-0'' 3'-3" 3'-3" 6'-6" 6'-3" (1) 2 (4) (5)

TOP PLAN

NOTES:

- The quantities shown are provided as a contingency for estimating purposes only. The area to be repaired shall be determined by the Engineer at the time of construction. Actual repair locations shall be shown on the as-built plans.
- 2. Crack widths are $\frac{1}{8}$ " $\pm \frac{1}{16}$ " unless otherwise noted.

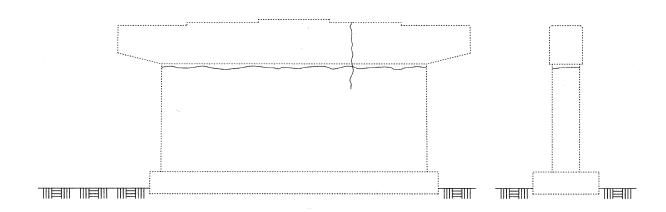

<u>ELEVATION</u> (Looking South)

END VIEW (Looking East)

ELEVATION (Looking North)

END VIEW (Looking West)

DESIGNED JLS

benesch & company Engineers - Surveyors - Planners Schorth Michigan Avenue, Suite 2400 Chicago, Illinois 60601 Job No. 3908.02

SHEET NO. S31 F.A.U. RTE. TOTAL SHEET NO. SECTION COUNTY 341 04-00090-07-BR WILL 57 39 S47 SHEETS CONTRACT NO. 63442 FED. ROAD DIST. NO. ILLINOIS FED. AID PROJECT

PIER 3 REPAIR 1 OF 2 STRUCTURE NO. 099-3298