

STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION

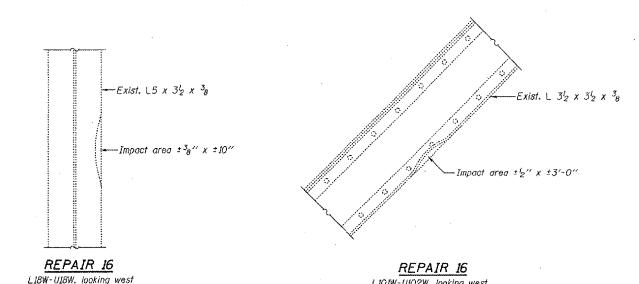


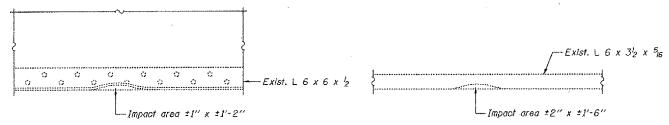


REPAIR 16 FB34, looking north

REPAIR 16 Horiz. sway brace @ PP 39, looking north


L101W-U102W, looking west

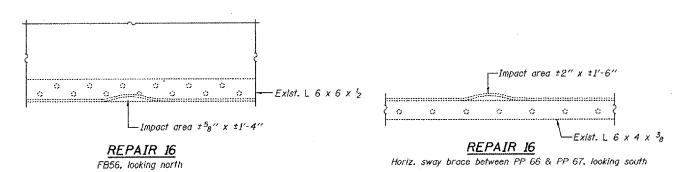

Impacted areas shall be straightened. See special provision Straighten Bent Members. Cost included with Straighten Bent Members. Typical for repair 16.



CONTRACT 98939 U.S. RTE. 60 & U.E. RTE. 62 (138D-BR) P-1 ALEXANDER COUNTY SHEET &S OF &S

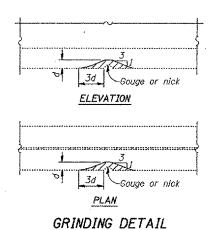

REPAIR 15 & 16

Grind existing nicks, gouges and shallow cracks in the damaged areas as detailed. Ground surfaces shall be inspected for cracks using magnetic particle testing prior to initiating any straightening operations. Cost included with Structural Steel Repair. Any cracks that cannot be removed by grinding approximately 4" deep shall be identified and reported to the Bureau of Bridges and Structures for further disposition.

| | | STRUCTURAL STE | EL REPAIR | |
|------------|-------------------|--------------------|---------------------|--------------------|
| Repair # | Member | Location | Description | Action |
| <i>1</i> 5 | L50W-U50W | 8' above deck | Nicks | Grind |
| 15 | L59E-U59E | 7' above deck | Minor impact damage | GrInd |
| 15 | L60E-U60E | 8' above deck | Gouge | Grind |
| 15 | L60E-U61E | 10' above deck | Gouge | Grind |
| <i>1</i> 5 | L80E~U80E | 6' above deck | Minor Impact damage | Grind |
| <i>1</i> 5 | L92E-U93E | 6' above deck | Gouge | Grind |
| 15 | L98E-U99E | 10' above deck | Gouge | Grind |
| <i>1</i> 5 | L100E-U101E | 10' above deck | Gouge | Grind |
| <i>1</i> 6 | FB 34 | B'twn. Str. B & C | Bent bottom flange | Straighten & grind |
| 16 | L 18W- U18W | 8' above deck | Damaged angle | Straighten & grind |
| 16 | Horiz. sway brace | PP 39 | Damaged angle | Straighten & grind |
| <i>1</i> 6 | FB <u>5</u> 6 | 12' from E. truss | Damaged angle | Straighten & grind |
| 16 . | Horizsway brace | B'twn. PP 66 & 67. | Damaged angle | Straighten & grind |
| 16 | L102W-U101W | 6' above deck | Damaged angle | Straighten & grind |

Repair 15 paid for as Structural Steel Repair. Repair 16 paid for as Straighten Bent Members.

BRIDGE NO. 1 STRUCTURE 002-0005 FOR INFORMATION ONLY

BRIDGE REPAIRS OLD CAIRO BRIDGE OVER MISSISSIPPI RIVER FAS RTE. 944 (US 60 & 62) SEC. (138D-BR)1-5 ALEXANDER COUNTY SN 002-0005