


* Additional Concrete removal at Beam 2 required for Repair B as shown on Sheets 9 thru 11. Replace to match top of scarified deck.

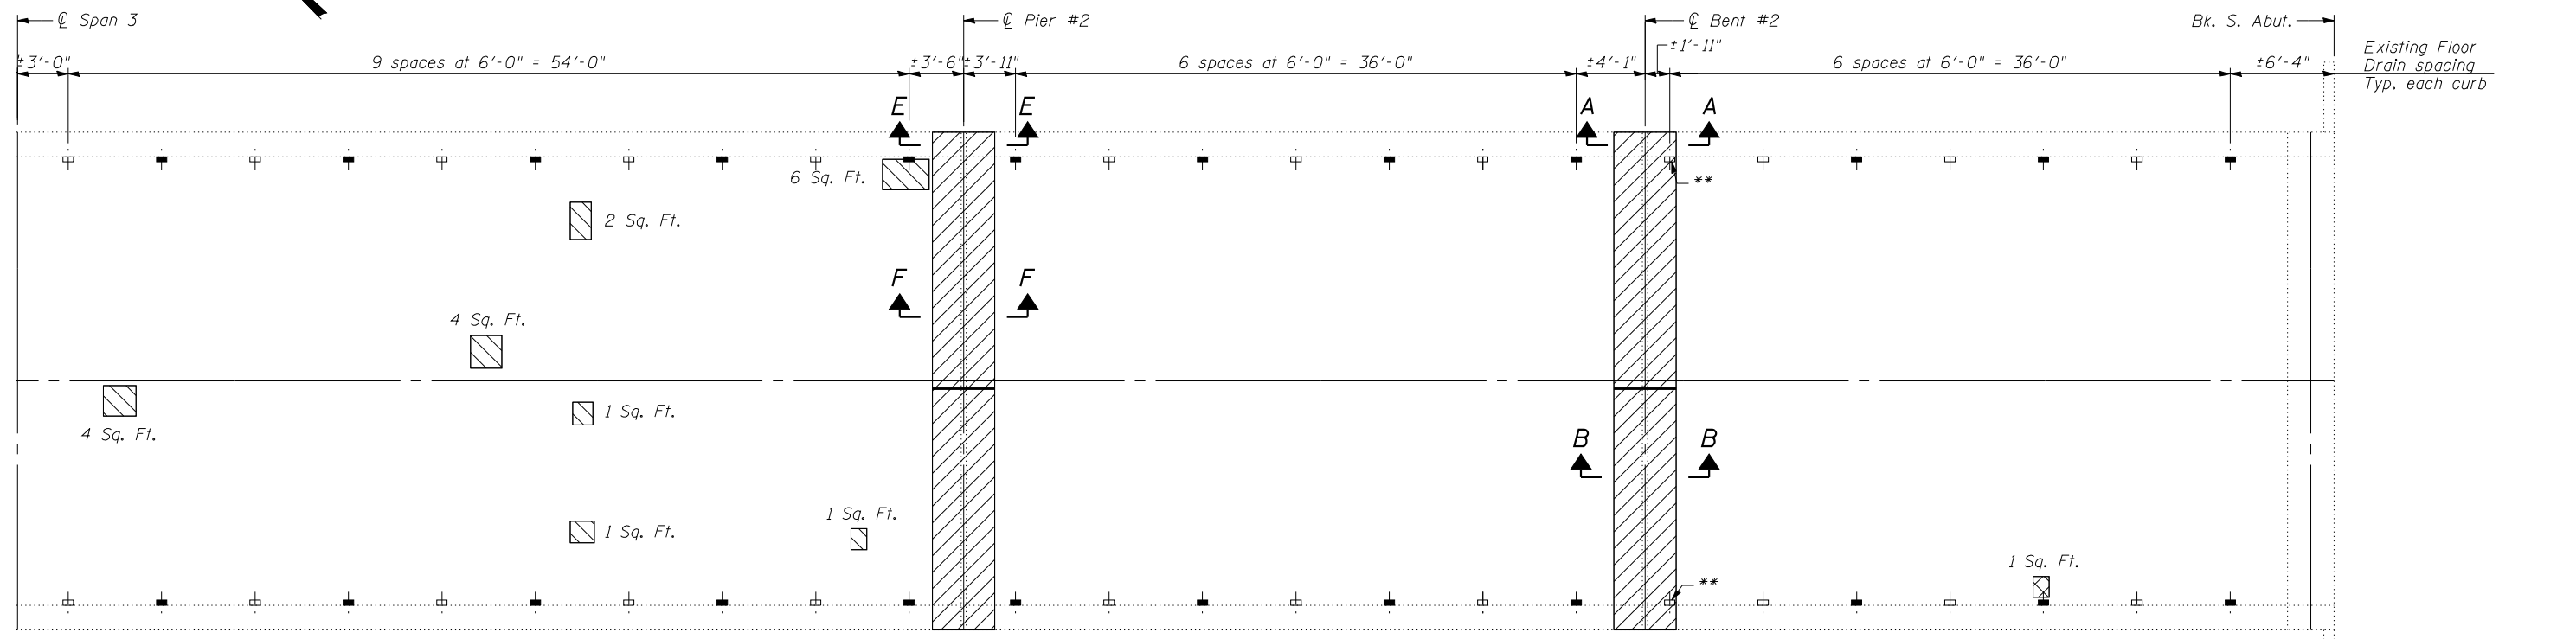

Notes:
 The areas of Deck Slab Repair are based on visual inspection completed in 2009 and 2011. Actual repair areas and locations shall be determined by the Engineer and shown on As-Built Plans.
 See Sheet 5 of 13 for Sections A-A thru F-F.
 See Sheet 2 of 13 for Floor Drain Details.

LEGEND

- Deck Slab Repair (Partial) (For information only)
- Deck Slab Repair (Full Depth, Type I)
- Concrete Removal

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Deck Slab Repair (Partial)	Sq. Yd.	5
Deck Slab Repair (Full Depth, Type I)	Sq. Yd.	1
Concrete Removal	Cu. Yd.	20.2
Plug Existing Floor Drains	Each	48

FILE NAME = 72B82-004-deck-slab-repairs.dgn
 USER = CFC
 PROJECT NO. 07884-3

Coombe-Bloxdorf P.C.
 CIVIL ENGINEERS-
 STRUCTURAL ENGINEERS-
 LAND SURVEYORS
 Design Firm License No. 184-002703

USER NAME = CFC	DESIGNED - GJB	REVISED -
PLOT SCALE = 1000.000000 "/>	CHECKED - MCB	REVISED -
PLOT DATE = 1/8/2014	DRAWN - CFC	REVISED -
	CHECKED - MCB/CME	REVISED -

**STATE OF ILLINOIS
 DEPARTMENT OF TRANSPORTATION**

**DECK SLAB REPAIRS AND CONCRETE REMOVAL
 STRUCTURE NO. 054-0009**

SHEET NO. 4 OF 13 SHEETS

F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
717	(102B-1, 102CR, 102BR-2RS-5)	LOGAN	218	81
CONTRACT NO. 72B82				
ILLINOIS FED. AID PROJECT				