

ELEVATION - SOUTH ABUTMENT S.N. 101-0031

STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION

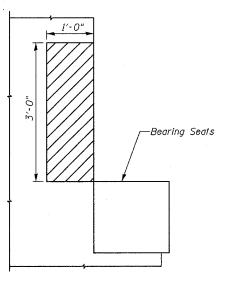

EAST WALL SOUTH ABUTMENT S.N. 101-0032

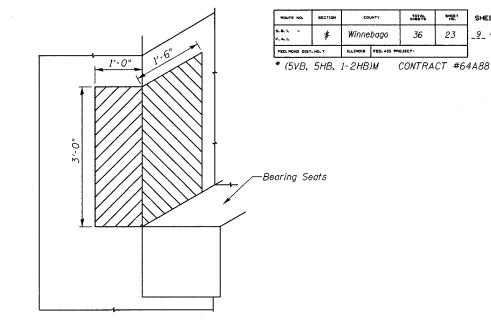


WEST WALL NORTH ABUTMENT S.N. 101-0032



Formed Concrete Repair (Depth equal to or less than 5")

Epoxy Crack Sealing

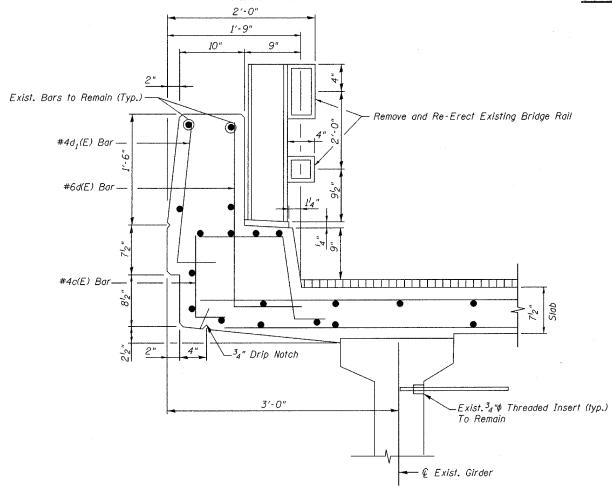

BILL OF MATERIAL

DESIGNED	SB, DP	Form
CHECKED	SB	Epoxy
DRAWN	BH, BS	
CHECKED	SB	

ITEM	UNIT	TOTAL
Formed Concrete Repair (Depth Equal to or Less Than 5")	Sq. Ft.	15
Epoxy Crack Sealing	Foot	<i>1</i> 5

TYP. SECTION THRU EXIST. PARAPET

SHOWING STEEL RETROFIT RAIL (For Information Only)

Note: Contractor must ensure that rails are properly marked before removal to ensure proper placement during re-erection.

ABUTMENT REPAIRS F.A.P. Route 303 & F.A.P. Route 738 (IL 251) OVER Rockton Road SECTION (5VB, 5HB, 1-2HB)M WINNEBAGO COUNTY SN 101-0031 & 101-0032

SHEET NO. 6

23

36