
1279 1(D,E,F,P)I-3 LASALLE 19 14

STA, 23+51 TO STA, 35+09

FED. ROAD DIST, NO. _ JILLINOIS | NON-FED. AID PROJECT

Z

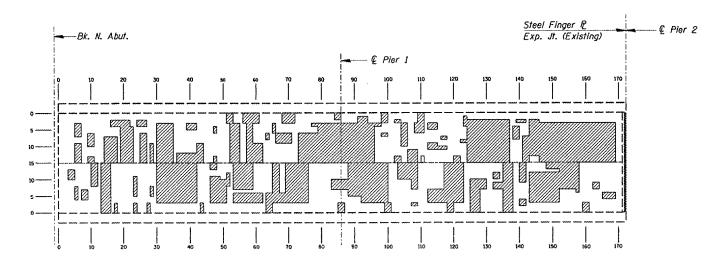

NORTH APPROACH PLAN

NOTES:

Hatched areas represent delaminated areas.

The Engineer shall sound the entire deck surface to determine exact locations and quantities of "Deck Slab Repair".


Deck Slab Repair (Partial) has been estimated at 19% of total deck area = 635 square yards.

Deck Slab Repair (Full Depth) has been estimated at 2% of total deck area = 70 square yards.

The Engineer shall record the actual locations of the deck slab repair on the "As-Built" plans.

Date of Deck Survey: 12/28/04



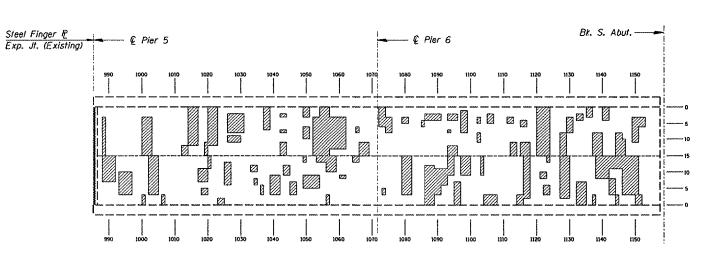

SOUTH APPROACH PLAN

REVISIONS		ILLINOIS DEPARTMENT (OF TOANCOODTATION
NAME	DATE		
·····		DECK PATCHIN	
		APPROACH SPANS	
		EXISTING S.N.	
		IL 178 OVER ILLII	NOIS RIVER
		STATION 29+30	
······································		SCALE: HORIZ.	DRAWN BY RLW
		DATE 12/08/04	CHECKED BY

D = (10+00/308/00/2001)