



SECTION THRU JOINT

PLAN

Hatched areas indicate Deck Slab Repair (Partial).
Areas of deck repair are estimated. Actual locations shall be shown by the engineer for As Built Plans.



TYPICAL END OF SEAL TREATMENT

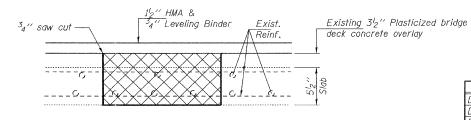

TYPICAL DECK REPAIR DETAIL

Cross hatched areas indicate Deck Slab Repair (Full Depth, Type I).

BILL OF MATERIAL

Item	Unit	Quantity
Deck Slab Repair (Partial)	Sq. Yd.	100
Deck Slab Repair (Full Depth, Type I)	Sq. Yd.	225
Protective Shield	Sq. Yd.	260
Polymerized Leveling Binder (Machine Method), N50	Ton	28
Polymerized Hot-Mix Asphalt Surface Course, Mix "D", N90	Ton	56
Silicone Joint Sealer, 2 ³ 4"	Foot	35
Silicone Joint Sealer, 1^3_4 "	Foot	35

DESIGNED VHV	EXAMINED	Jayne F. Jeff	DATE JUNE 29, 2011	ATATE OF 11111010	REPAIR DETAILS	F.A.I. SECTION	COUNTY TOTAL SHEET SHEETS NO.
CHECKED DAB DRAWN baliva	PASSED	ENGINEER OF STRUCTURAL HERVICES	REVISED	STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION	SN 081-0014	80 (37-1BY-1, 81-1VB, 81-1HB-1)M-1	ROCK ISLAND 15 8
CHECKED VHV DAB		INGINEER OF BRIDGES AND STRUCTURES	REVISED		SHEET NO. 3 OF 3 SHEETS	ILLINOIS FED.	AID PROJECT