


PIER 1 - WEST FACE

(Looking East)

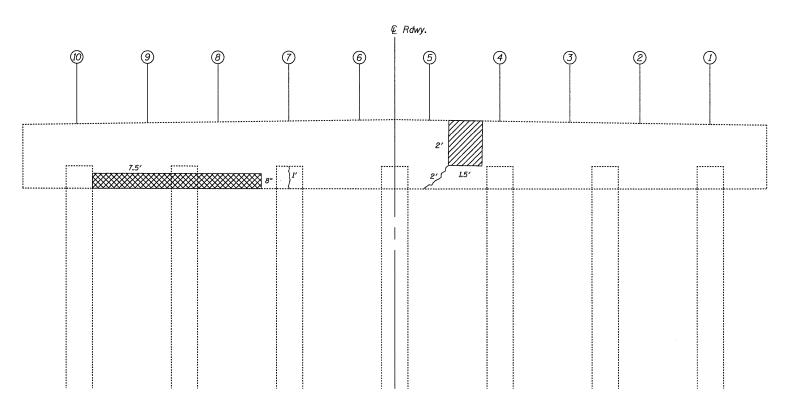

PIER 1 - EAST FACE

(Looking West)

<u>LEGEND</u>

- Epoxy Crack Injection

- Structural Repair of Concrete (Depth greater than 5")

- Structural Repair of Concrete (Depth equal to or less than 5")

BILL OF MATERIAL

Item	Unit	Quantity
Epoxy Crack Injection	Foot	7.0
Structural Repair of Concrete (Depth greater than 5")	Sq. Ft.	5.0
Structural Repair of Concrete (Depth equal to or less than 5")	Sq. Ft.	5. 5

USER NAME = dheberling DESIGNED - FLL REVISED DRAWN - DLH REVISED PLOT SCALE = Ø11 1/16 '1" / 1

PLOT DATE = 8/18/2009 PLOT SCALE = Ø:1 1/16 ':" / IN. CHECKED - CWC REVISED DATE

WHKS & co. ENGINEERING

7018 KINGSMILL CT., SPRINGFIELD, IL (217) 483-9457 DESIGN FIRM #184001036

STATE OF ILLINOIS **DEPARTMENT OF TRANSPORTATION**

PIER 1 REPAIRS CH 10 OVER NORTH FORK SALT CREEK SCALE SHEET NO. 10 OF 11 SHEETS ¢ STA.

COUNTY TOTAL SHEETS NO.
DEWITT 17 16 F.A.S. RTE. 543 SECTION 09-00025-01-BR S.N. 020-3900 CONTRACT NO. 91423 FED. ROAD DIST. NO. | ILLINOIS FED. AID PROJECT