
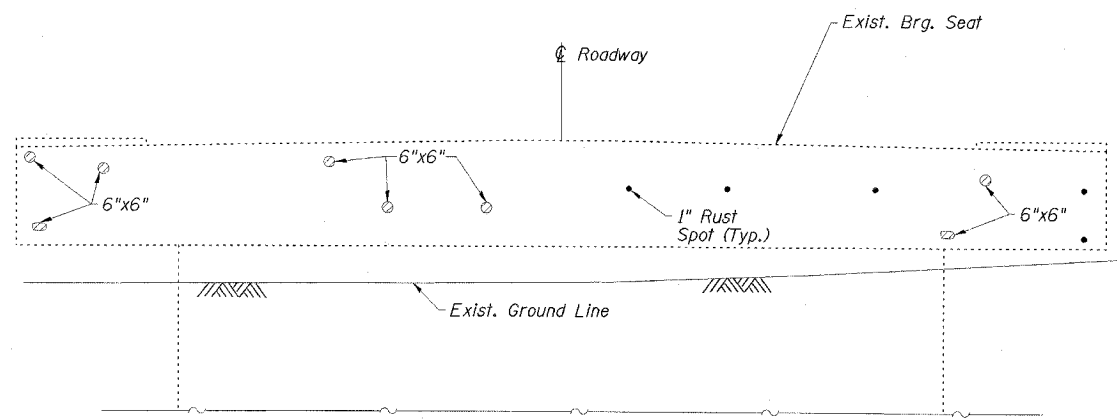




STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	SHEET	SHEET NO.
FAS 899	8BR-2	SALINE	75	49
SHEET NO. 14 18 SHEETS				
78028				

EXISTING BEARING SEAT TO BE INSPECTED BY THE ENGINEER AFTER DECK BEAM REMOVAL. DETERIORATED CONCRETE AREAS SHALL BE REPAIRED (ESTIMATED 15 S.F. STRUCTURAL REPAIR OF CONCRETE DEPTH < 5") AND CRACKS SHALL BE SEALED (ESTIMATED 20' EPOXY CRACK INJECTION) IF FOUND. CONCRETE SEALER SHALL BE APPLIED TO STRUCTURAL REPAIR OF CONCRETE AREAS.

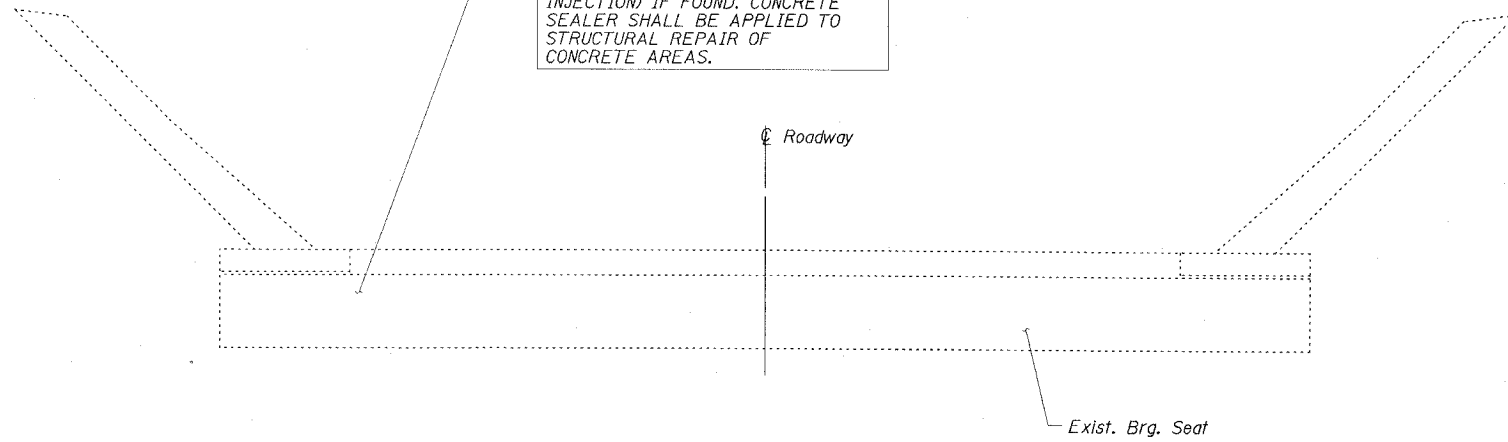

ABUTMENT CRACK REPAIR LENGTHS AND STRUCTURAL REPAIR OF CONCRETE AREAS ARE ESTIMATED FROM 12-11-07 SURVEY WORK. ACTUAL LOCATIONS AND QUANTITIES OF REPAIRS SHALL BE SHOWN BY THE ENGINEER ON THE AS-BUILT PLANS FOR THIS SECTION.

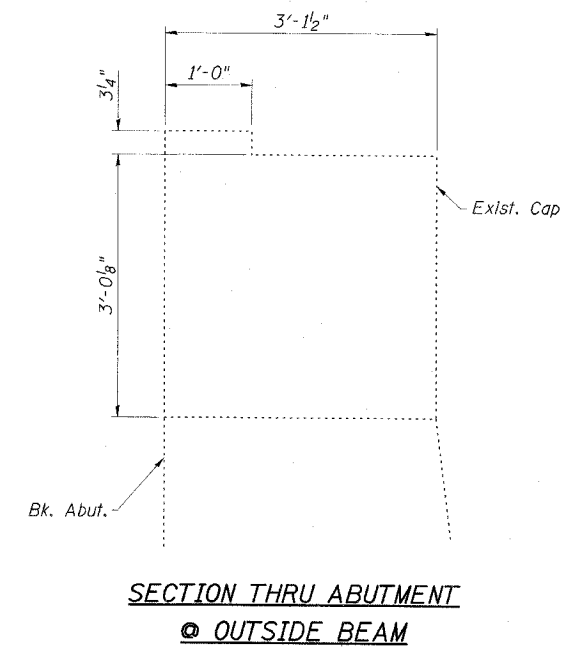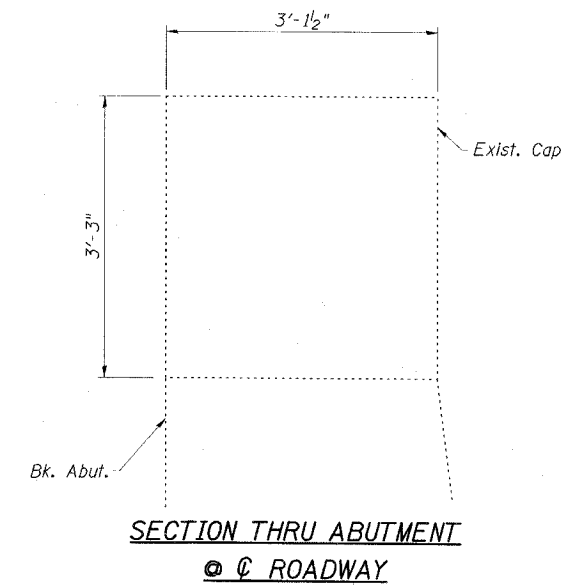

WEST ABUTMENT
BILL OF MATERIAL

Item	Unit	Quantity
Concrete Sealer	Sq. Ft.	15
Epoxy Crack Injection	Foot	20
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	17

REPAIR LEGEND

Inspection Date: 12/11/07

- C-6' Crack to be epoxy injected
- Delaminated or Spalled Area - Use Structural Repair of Concrete
- Efflorescent Crack
- Rust Spot

ESCA
CONSULTANTS, INC.

DESIGNED BY:	JMS	10/07
DRAWN BY:	CJ/HAS	10/07
CHECKED BY:	DAJ/ELH	01/08
APPROVED BY:	RDP	01/08

WEST ABUTMENT
OLD IL 13 OVER BANKSTON FORK
FAS ROUTE 899 - SECTION 8BR-2
SALINE COUNTY
STATION R02+60.00
STRUCTURE NO. 083-0036