



62694

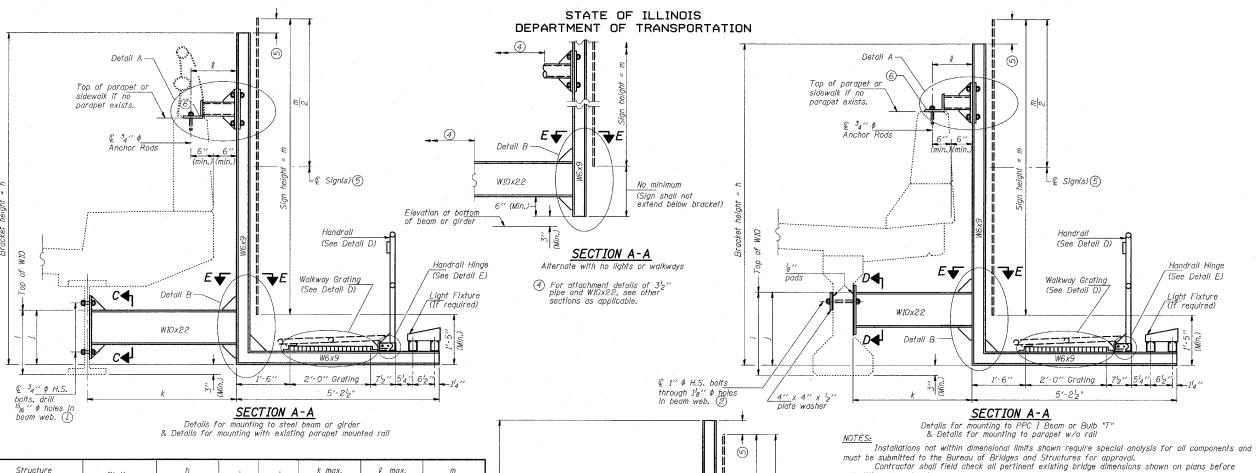


Structure k max. ℓ max. Station Number (10'-0" max.) (8'-0" max.) 1B016I094R059.8 12.5' 1B016I094R060.8

For Details A & B, Sections C-C, D-D and E-E, see Base Sheet BM-3. For Details D & E. see Base Sheet BM-4.

- (1) Holes in new steel members may be drilled in the fabrication shop or in the field. Field drill existing members.
- (2) For new PPC I beams, holes shall be formed during casting. For existing PPC I beams, prestressing strand locations shall be determined and spaced to miss strands by 6" min. Minimize spalling during field drilling of
- 3 For new construction, form holes. For existing RC beams, locate primary reinforcement and space holes to miss by 6" min. Minimize spalling and concrete fracturing/damage during field drilling of existing concrete. Spalls over 4" deep or beyond the coverage of the 4x4 plate washer shall be repaired with epoxy mortar

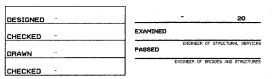

BM-2 11/1/2002

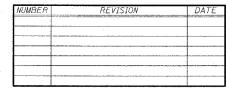

submitting shop drawings. and Structures. Top of parapet or sidewalk if no parapet exists. $\mathbb{L}_{\mathbb{Q}}$ Sign(s)(5) (6) For bridge mounted sign structures installed on new bridges with railing, during (See Detail D) WIO Handrail <u>Hinge</u> (See Detail E) O. Detail F Walkway Grating (See Detail D)/ Εͺͺ \mathbf{T}^{E} W10x22 ---2′-0′′ Grating | 7½′′ 5¼′′ 6½′′ 14" x 4" x 2 5'-26" plate washer SECTION A-A ₽ 1" ¢ H.S. bolts through $1_8'' \not \phi$ holes in girder. 3Details for mounting to integral reinforced concrete girder

& Details for mounting on safety curb with surface-mount bridge rall

All holes in bridge beams or girders should be located in the middle half of the member. There shall be no holes drilled in the lower quarter of the member's depth. (For R.C. girder, depth = bottom of deck to bottom of the girder.) Proposed exceptions must be approved by the Bureau of Bridges The Engineer may adjust dimension "i" to meet the above condition and to keep the sign level.

- (5) Sign shall not extend more than 6" above top of bracket, and this dimension may vary to keep sign level if bridge is on grade or vertical curve. Multiple signs of various heights shall share a common horizontal centerline and use equal bracket heights. If no sign is attached to a W6x9 vertical (bracket only supporting walkway), dimension h shall be the same as an adjacent bracket with a sign attached, unless Engineer specifically directs shorter brackets due to locational restraints on future uses. (See Detail A for minimum bracket height.)
- design, bracket spacing must be coordinated with railing post spacing and the Contractor must install upper brackets prior to railing installation. For bridge mounted sign structrues installed on existing bridges with railing, during design, brackets spacing must be coordinated with railing post spacing and the Contractor must temporarily remove sections of railing to facilitate upper bracket installation. If it is determined during design that existing railings can't be removed, alternate upper connection details must be developed for the contract plans and approved by the Bureau of Bridges and Structures.

FOR BRIDGE-MOUNTED SIGN STRUCTURE AT STA. 2365+00, USE W6x12 INSTEAD OF W6x9.

REVISIONS

ILLINOIS DEPARTMENT OF TRANSPORTATION F.A.I. 94 (DAN RYAN EXPRESSWAY)

BRIDGE MOUNT SIGN STRUCTURES WALKWAY AND CONNECTION DETAILS

SCALE: AS NOTED

DRAWN BY: AMB DATE: MARCH 18, 2005 CHECKED BY: TB

TYLININTERNATIONAL