


PIER 22 - NORTH ELEVATION (Looking South)

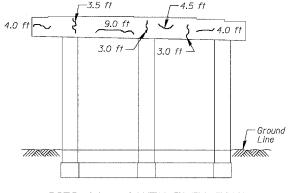

PIER 22 - SOUTH ELEVATION (Looking North)


14.7 ft2 7.6 ft2 2.2 ft2

15.0 ft²

221 0.6 ft<sup>2</sup>0

1.0 ft<sup>2</sup>

— Ground

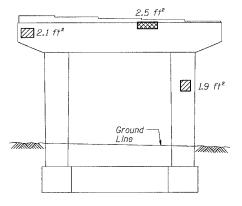

STA.


62580

F.A.I. SECTION COUNTY TOTAL SHEE SHEETS NO. 94/90 2003-028F COOK 419 271


FED. ROAD DIST. NO. ILLINOIS FED. AID PROJECT

TO STA.


PIER 26 - SOUTH ELEVATION (Looking North)

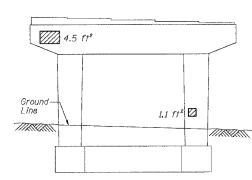


PIER 27 - SOUTH ELEVATION (Looking North)

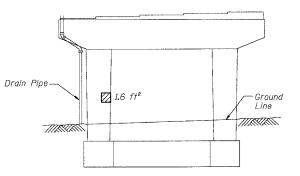

PIER 27 - NORTH ELEVATION (Looking South)

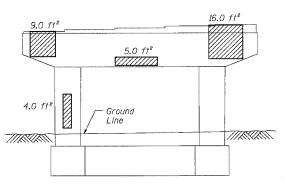


PIER 28 - NORTH ELEVATION (Looking South)

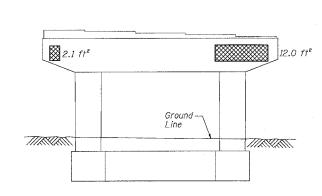

PIER 28 - SOUTH ELEVATION (Looking North)


REVISIONS NAME D	DATE	ILLINOIS DEPARTMENT O	F TRANSPORTATION	
NAME. D	AIL	F.A.I. 94/90 (DAN RY	(AN EXPRESSWAY)	₹
		NB DAN RYAN ELE	VATED BRIDGE	9.38.18
		REPAIR FROM 15TH TO 28TH STREETS CONCRETE PIER REPAIRS		
		SN 016-1047, PIERS SCALE: NTS DATE: 8/12/2005	22,23,25,26,27,28	2
		SCALE: NTS	DRAWN BY: BDC	ZZ
		DATE: 8/12/2005	CHECKED BY: BLU	11/8

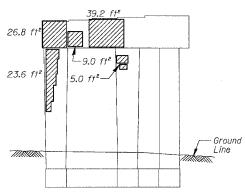

PIER 23 - NORTH ELEVATION (Looking South)

1.5 ft²

7//8/08/1

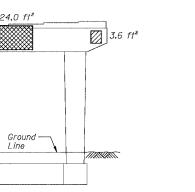

PIER 25 - NORTH ELEVATION (Looking South)



PIER 22 - VIEW A

Looking up at bottom of cap



For Notes and Legend See Sheet 253

## BILL OF MATERIAL

ITEM	UNIT	QUANTITY
High Performance	SQ. FT.	222.6
Enhanced Shotcrete		
Formed Concrete Repair	SQ. FT.	68.2
(Depth greater than 5")		
Epoxy Crack Sealing	FOOT	113.9

BOWMAN, BARRETT & ASSOCIATES INC.
CONSULTING ENGINEERS
Chicago, Illinois
312 228.0100
www.bbandainc.com

PIER 23 - SOUTH ELEVATION (Looking North) 3.0 ft² ¬

1.0 ft² 🖸 1.5 ft² 🔼

1.6 ft² 🔼

7778

-2.4 ft2 1.0 ft² ⊠  $\dot{\Box}$ Line 7//8//8/ 777807855

PIER 25 - SOUTH ELEVATION (Looking North)