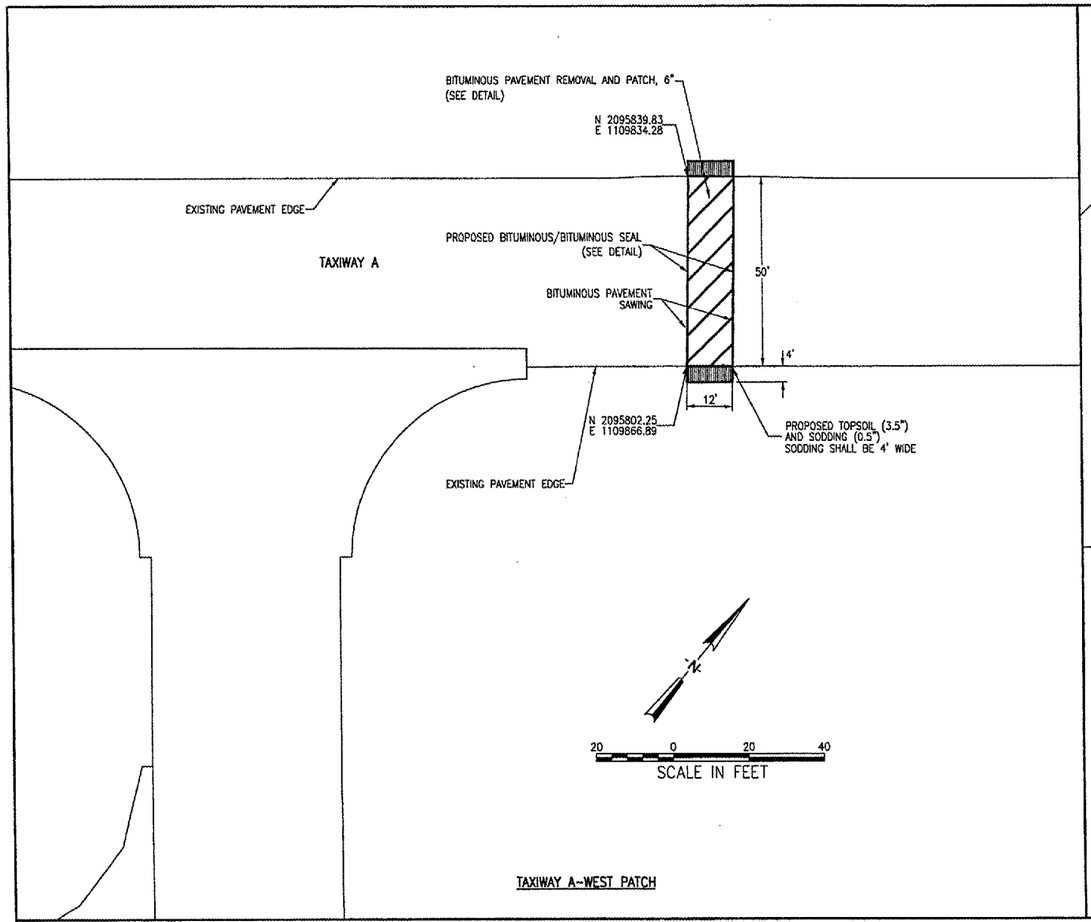

TAXIWAY A-WEST PATCH

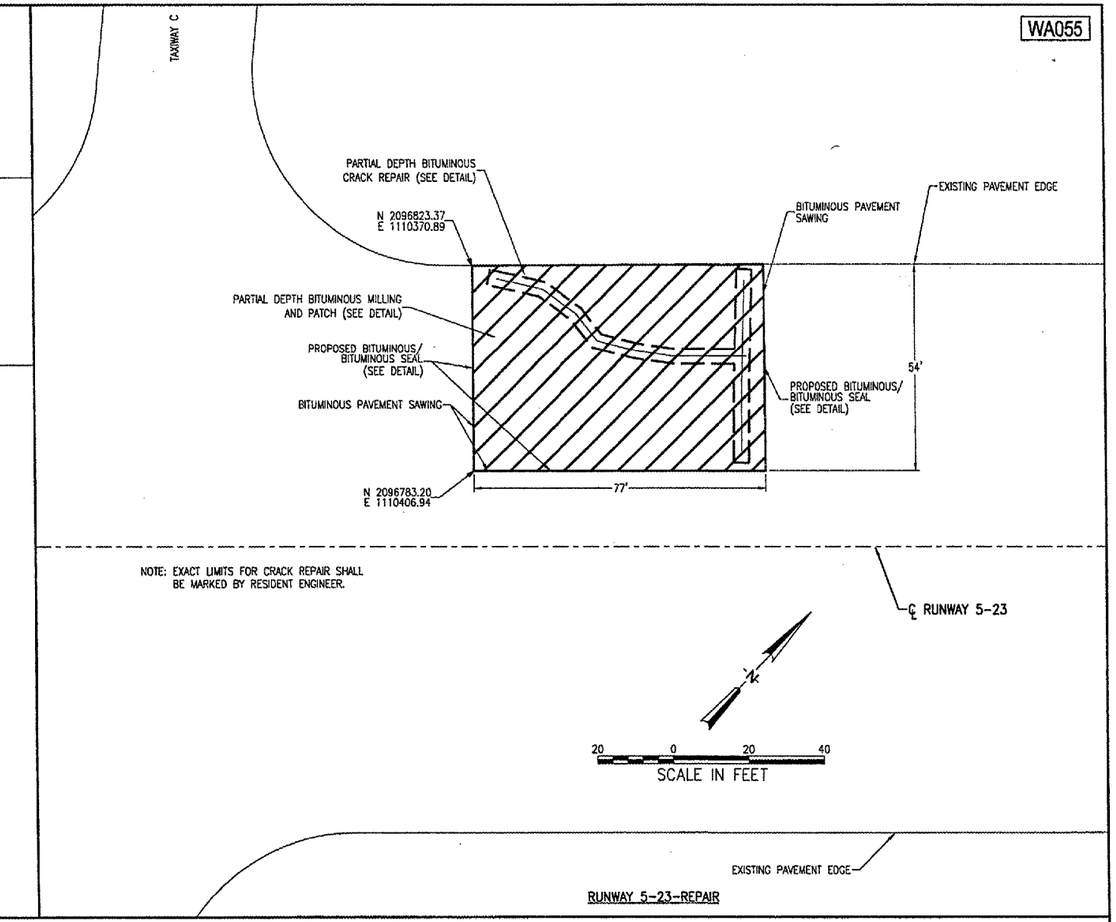

RUNWAY 5-23-REPAIR

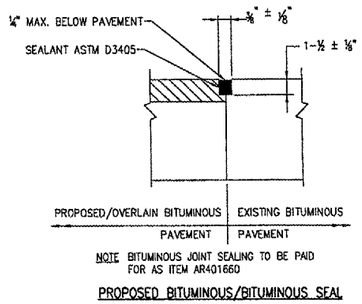

NOTE BITUMINOUS JOINT SEALING TO BE PAID FOR AS ITEM AR401660

PROPOSED BITUMINOUS/BITUMINOUS SEAL

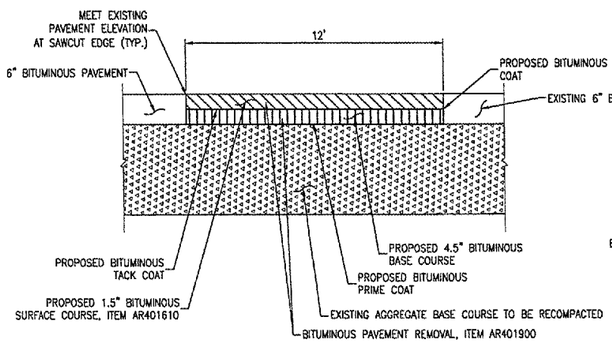

NOTE

1. BITUMINOUS TO BE DISPOSED OF AT AN OFFSITE LOCATION, COST INCIDENTAL TO ITEM AR401910.
2. ALL ITEMS ASSOCIATED WITH THE BITUMINOUS PAVEMENT REMOVAL AND REPLACEMENT TO BE INCLUDED IN ITEM AR401910 EXCEPT FOR BITUMINOUS PAVEMENT SAWING, PAID AS ITEM AR401665 AND PAVEMENT MARKING, PAID AS ITEM AR620530.
3. TACK COAT SHALL BE APPLIED BETWEEN EACH BITUMINOUS LIFT INCLUDING VERTICAL FACES.
4. EXISTING MARKING WITHIN THE PATCH AREA SHALL BE REPLACED AND PAID UNDER ITEM AR620530. DESTROYED MARKING OUTSIDE THE PATCH SHALL BE REPLACED BUT THE COST IS INCIDENTAL. SEE PAVEMENT MARKING PLAN FOR DETAILS.

BITUMINOUS PAVEMENT REMOVAL AND PATCH
TAXIWAY A

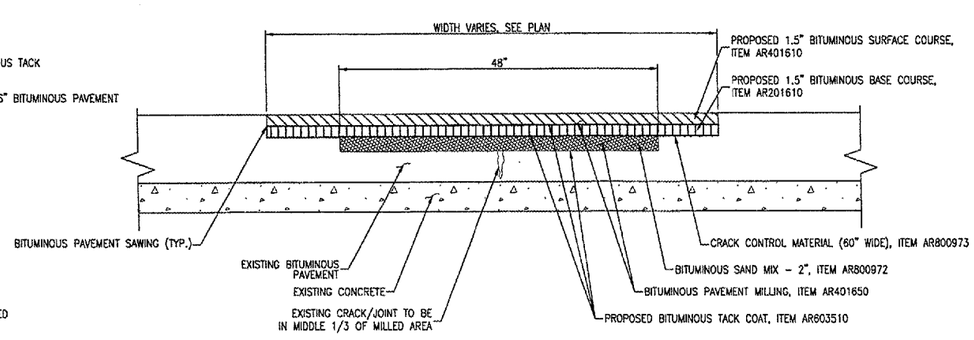

NOTE

1. TACK COAT SHALL BE APPLIED TO MILLED SURFACE OUTSIDE OF CRACK CONTROL MATERIAL AND BETWEEN EACH ASPHALT LIFT INCLUDING VERTICAL FACES.
2. MILLING AND BITUMINOUS SAND MIX QUANTITIES BASED ON 48" WIDTH.
3. CRACK CONTROL MATERIAL SHALL OVERLAP BITUMINOUS SAND MIX 6" EACH SIDE.
4. BITUMINOUS PAVEMENT SAWING TO BE PAID AS ITEM AR401665.
5. BITUMINOUS JOINT SEALING TO BE PAID FOR AS ITEM AR401660.
6. EXISTING EDGE MARKING WITHIN THE PATCH AREA SHALL BE REPLACED AND PAID UNDER ITEM AR620530. DESTROYED MARKING OUTSIDE THE PATCH SHALL BE REPLACED BUT THE COST IS INCIDENTAL. SEE PAVEMENT MARKING PLAN FOR DETAILS.

TYPICAL SECTION-PARTIAL DEPTH BITUMINOUS CRACK
REPAIR AND PATCH
RUNWAY 5-23

HANSON

HANSON PROFESSIONAL SERVICES INC.

815 Commerce Drive, Suite 200
Oak Brook, Illinois 60523
Telephone: 630.990.3800
Fax: 630.990.3801

Waukegan Regional Airport
Waukegan Regional Port District

3580 North McAree Road
Waukegan, Illinois 60087
Phone: 847.244.0055
Fax: 847.244.3813

REPAIR SELECTED PAVEMENT AREAS, REHABILITATE HANGAR TAXILANES AND SERVICE ROAD, AND CONSTRUCT NEW HANGAR PAVEMENTS

A.I.P. PROJ.: 3-17-0105-B30
IL. PROJ.: UGN-3449

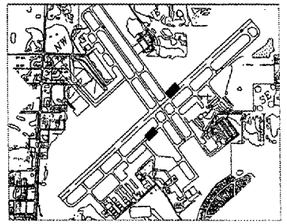

KEY MAP

No.	Drawing Issue Description	Date	By

Date

MAY 06, 2005

Sheet Title

RUNWAY 5-23 AND TAXIWAY A PATCHING PLAN

831-04TXYD	Project Number
AAP	02/28/05
Layout By	Date
RPH	02/28/05
Designed By	Date
TMM/RMH	04/07/05
Reviewed By	Date
AAP | DSY | RPH	
Drawn By	

Sheet No. 10

LDH
05/06/2005, 03:08 PM
I:\04Jobs\08331\831104TXYD\Civil\SHEET\10 Runway Patching Plan.dgn