WA055

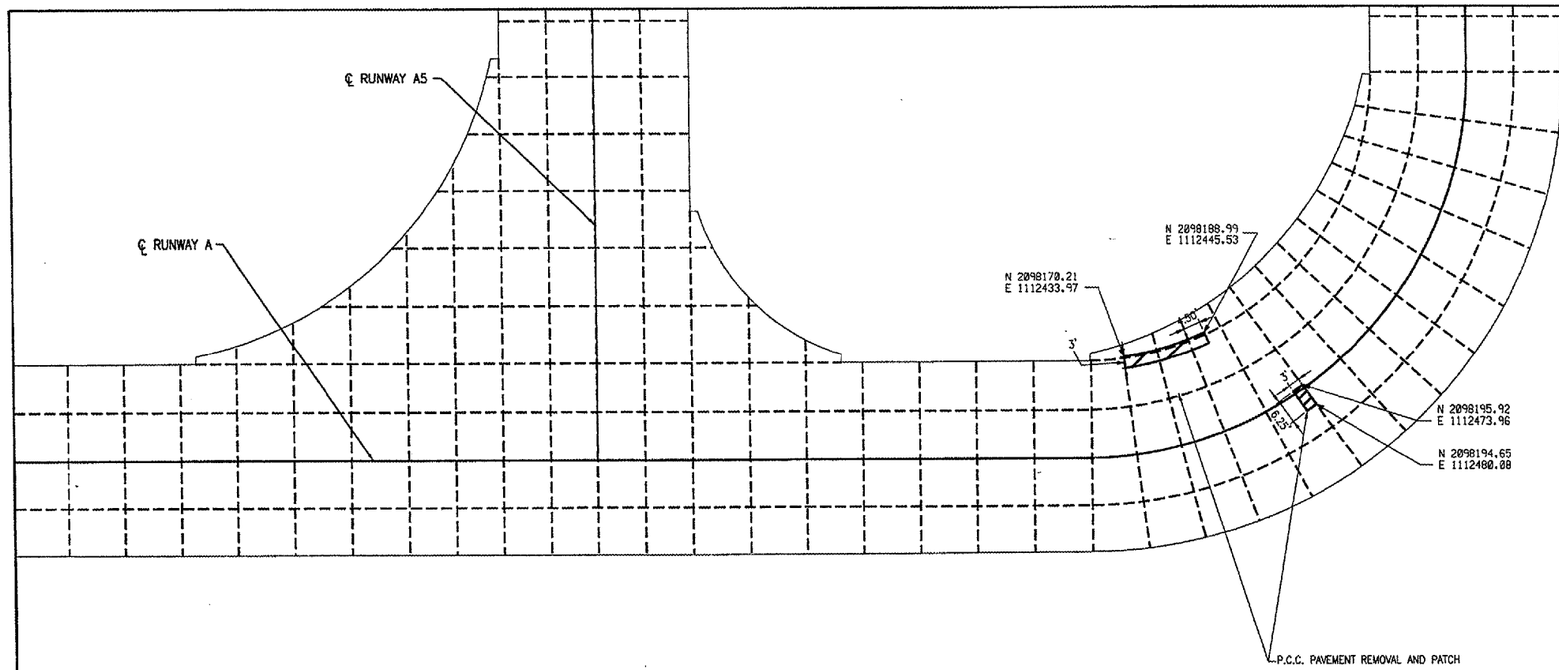

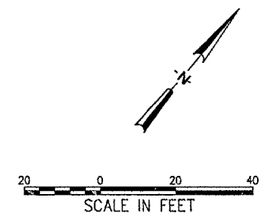

GENERAL NOTES

1. FIELD VERIFY PATCH LOCATIONS WITH RESIDENT ENGINEER PRIOR TO PAVEMENT REMOVAL
2. REINFORCEMENT, EXPANSION MATERIAL, SAW CUTTING AND SEALING OF JOINTS IS INCIDENTAL TO P.C.C. PAVEMENT.
3. PAVEMENT THICKNESS "T" TO BE 8 INCHES, EXCEPT WHERE NOTED OTHERWISE.
4. CURING AND FINAL FINISH SHALL BE COMPLETED IN ACCORDANCE WITH THE SPECIFICATIONS.
5. ALL DOWEL BARS TO HAVE ONE END OILED PRIOR TO CONCRETE PLACEMENT.

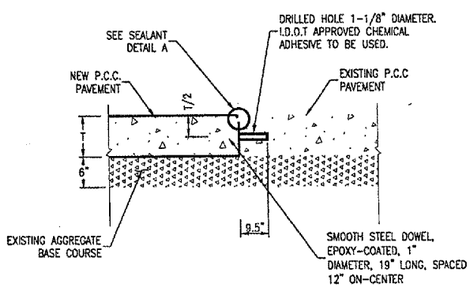

DOWELED JOINT WITH EXISTING P.C.C. PAVEMENT

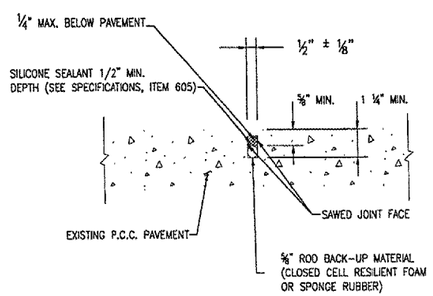

SEALANT DETAIL A

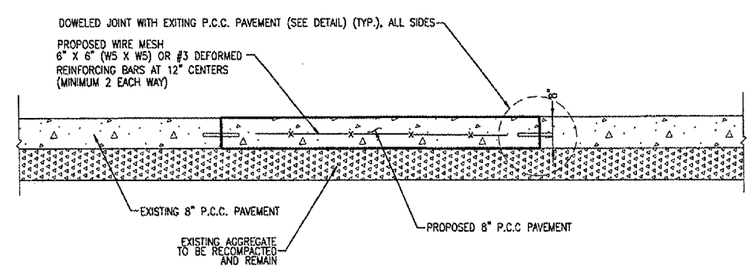

P.C.C. PAVEMENT REMOVAL AND PATCH

HANSON

HANSON PROFESSIONAL SERVICES INC.

815 Commerce Drive, Suite 200
Oak Brook, Illinois 60523
Telephone: 630.990.3800
Fax: 630.990.3801

Waukegan Regional Airport
Waukegan Regional Port District

3580 North McAree Road
Waukegan, Illinois 60087
Phone: 847.244.0055
Fax: 847.244.3813

REPAIR SELECTED PAVEMENT AREAS, REHABILITATE HANGAR TAXILANES AND SERVICE ROAD, AND CONSTRUCT NEW HANGAR PAVEMENTS

A.I.P. PROJ.: 3-17-0105-B30
IL. PROJ.: UGN-3449

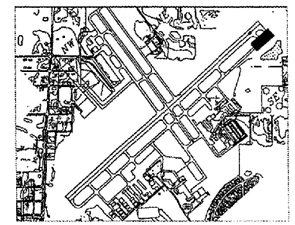

KEY MAP

No.	Drawing Issue Description	Date	By

Date

MAY 06, 2005

Sheet Title

TAXIWAY A PATCHING PLAN

RUNWAY 5-23 AND TAXIWAY A PAVEMENT REHABILITATION

831-04TXYD
Project Number

AAP 03/11/05
Layout By Date

RPH 03/11/05
Designed By Date

RMH/TMM 04/07/05
Reviewed By Date

AAP | DSY | RPH
Drawn By

12
Sheet No.

LDH
05/06/2005, 03:10 PM
I:\04Jobs\0083\1831\04TXYD\CM\SHEET\12 Sealing Plan_01.dgn