


F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
322	*	DEWITT	35	24
STA.		TO STA.		
FED. ROAD DIST. NO.	ILLINOIS	FED. AID PROJECT		

* (52BR-1 & 53R-B)BJR


SHEET 5 OF 7

JOINT REPAIR AT NORTH ABUTMENT


S.N. 020-0055

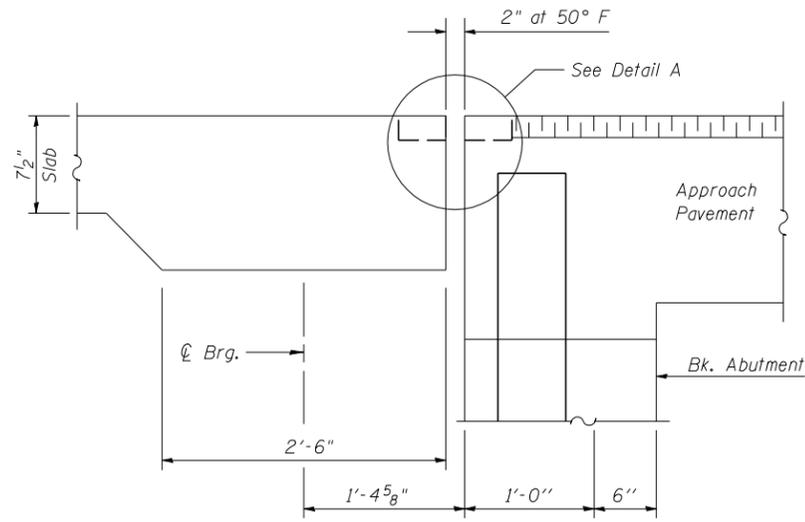


EXISTING SECTION AT NORTH ABUTMENT

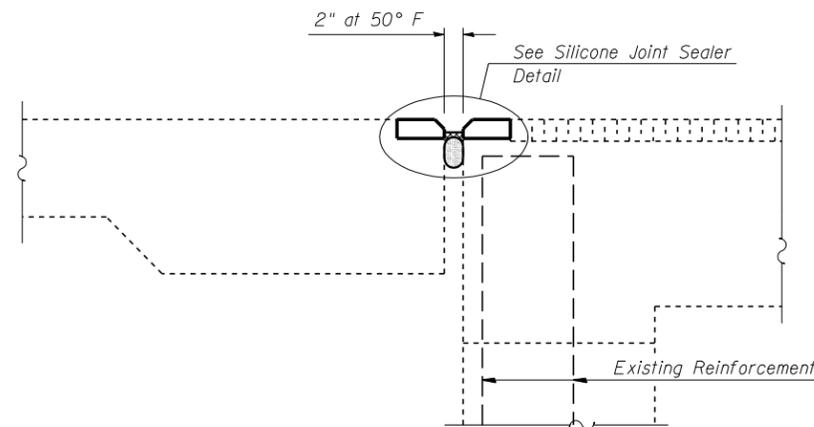


PROPOSED SECTION AT NORTH ABUTMENT

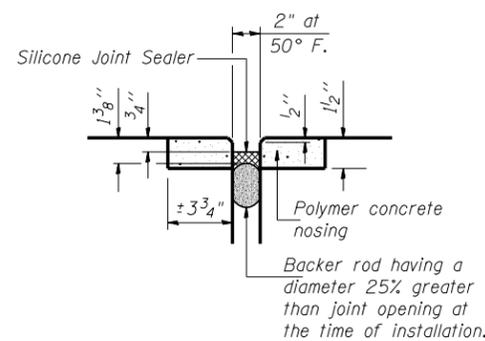


SILICONE JOINT SEALER DETAIL

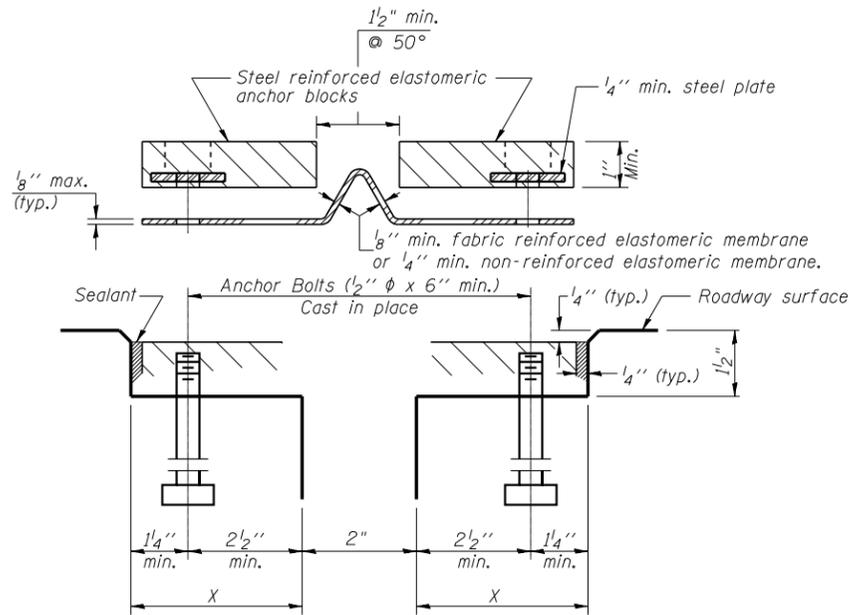


CROSS SECTION DETAIL A EXISTING JOINT

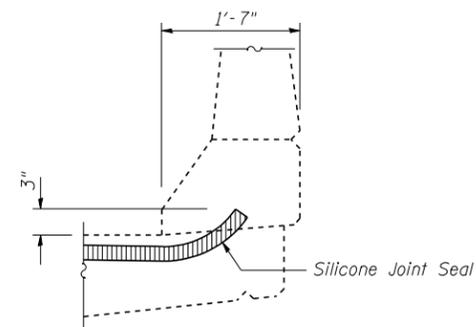

PROPOSED TYPICAL END OF SEAL TREATMENT AT ABUTMENT

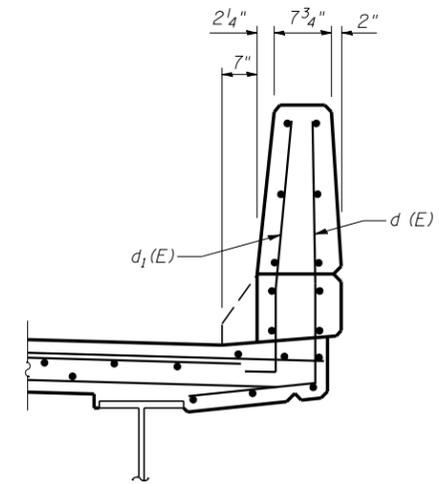

EXISTING SECTION THRU PARAPET

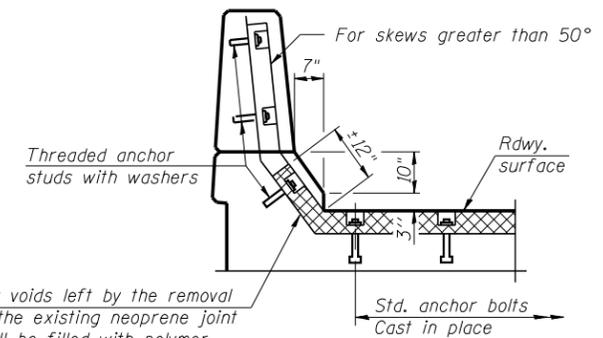

EXISTING NEOPRENE JOINT AT PARAPET

BILL OF MATERIALS

Item	Unit	Total
Polymer Concrete	Cu. Ft.	3.8
Silicone Joint Sealer	Foot	48.3

Notes:

Remove existing neoprene expansion joint leaving existing anchor bolts, replace with Silicone Joint Sealer and Polymer Concrete.

Removal of the existing anchor blocks and neoprene membrane is included in the cost of Polymer Concrete.

ILLINOIS DEPARTMENT OF TRANSPORTATION
JOINT REPAIR AT NORTH ABUTMENT
 F.A.P. ROUTE 322
 SECTION (52BR-1 & 53R-B)BJR
 DEWITT COUNTY
 S.N. 020-0055

SCALE: NA DRAWN BY: JRP
 DATE: 11/08/06 CHECKED BY: