


Contract # 60D74

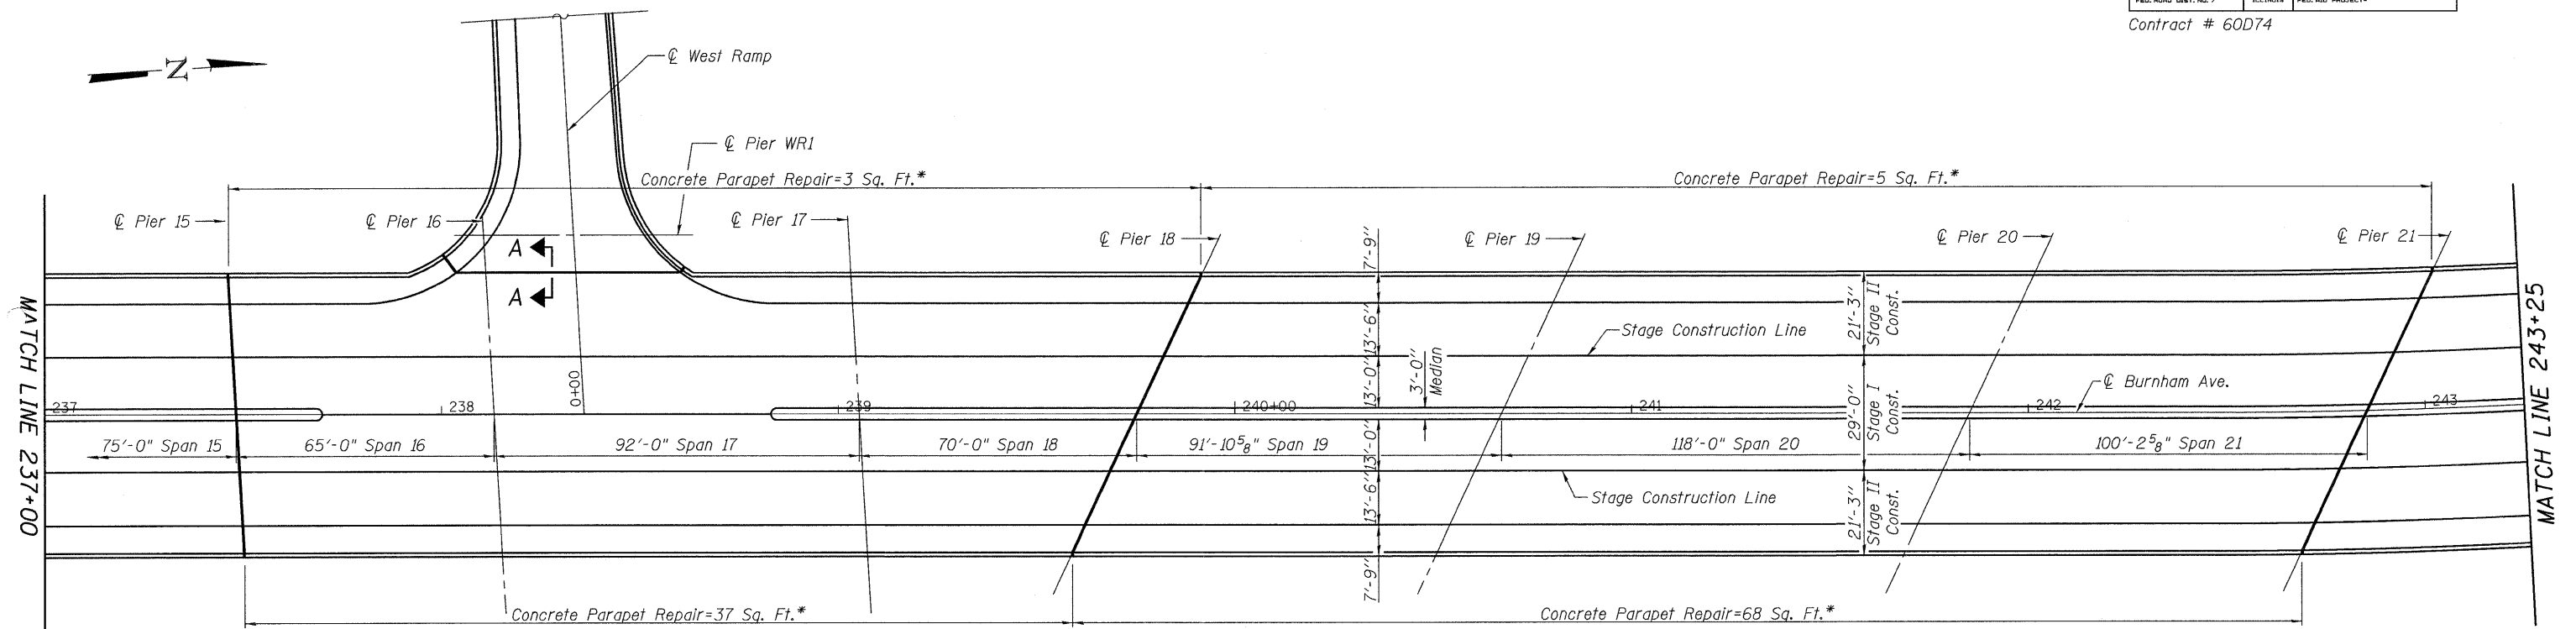

NOTES

- Existing HMA surface shall be removed from entire deck.
- Entire existing deck to be Hydro-Scarified 3/4" and overlaid with 2 1/4" Latex Concrete.
- Existing reinforcement bars & dowel rods extending into new concrete are to be cleaned and incorporated into new construction.
- Deck repair areas are estimated from IDOT in the Winter of 2007. Actual locations of repairs made shall be shown by the Engineer on As Built plans.
- The deck slab repair quantities are estimates from a Visual Survey. After removing the HMA surface the Contractor shall verify the quantities and determine the repair locations in the field.
- See sheet 27 of 35 for Section A-A.
- Clean all drainage scuppers. Cost included with Hot-Mix Asphalt Surface Removal (Deck).
- Any removal of existing Preformed Joint Sealer material shall be included with Silicone Joint Sealer.


BILL OF MATERIAL

(Quantity for Entire Deck)

Item	Unit	Quantity
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	30
Bridge Deck Latex Concrete Overlay, 2 1/4"	Sq. Yd.	14,500
Hot-Mix Asphalt Surface Removal (Deck)	Sq. Yd.	14,500
Bridge Deck Hydro-Scarification, 3/4"	Sq. Yd.	14,500
*** Bridge Deck Grooving	Sq. Yd.	13,652
* Structural Repair of Concrete (Depth equal to or less than 5")	Sq. Ft.	746
** Protective Coat	Sq. Yd.	83
Silicone Joint Sealer	Foot	125

**For the Structural Repairs on the Parapets only
***Includes the transverse and longitudinal joint replacement

PLAN

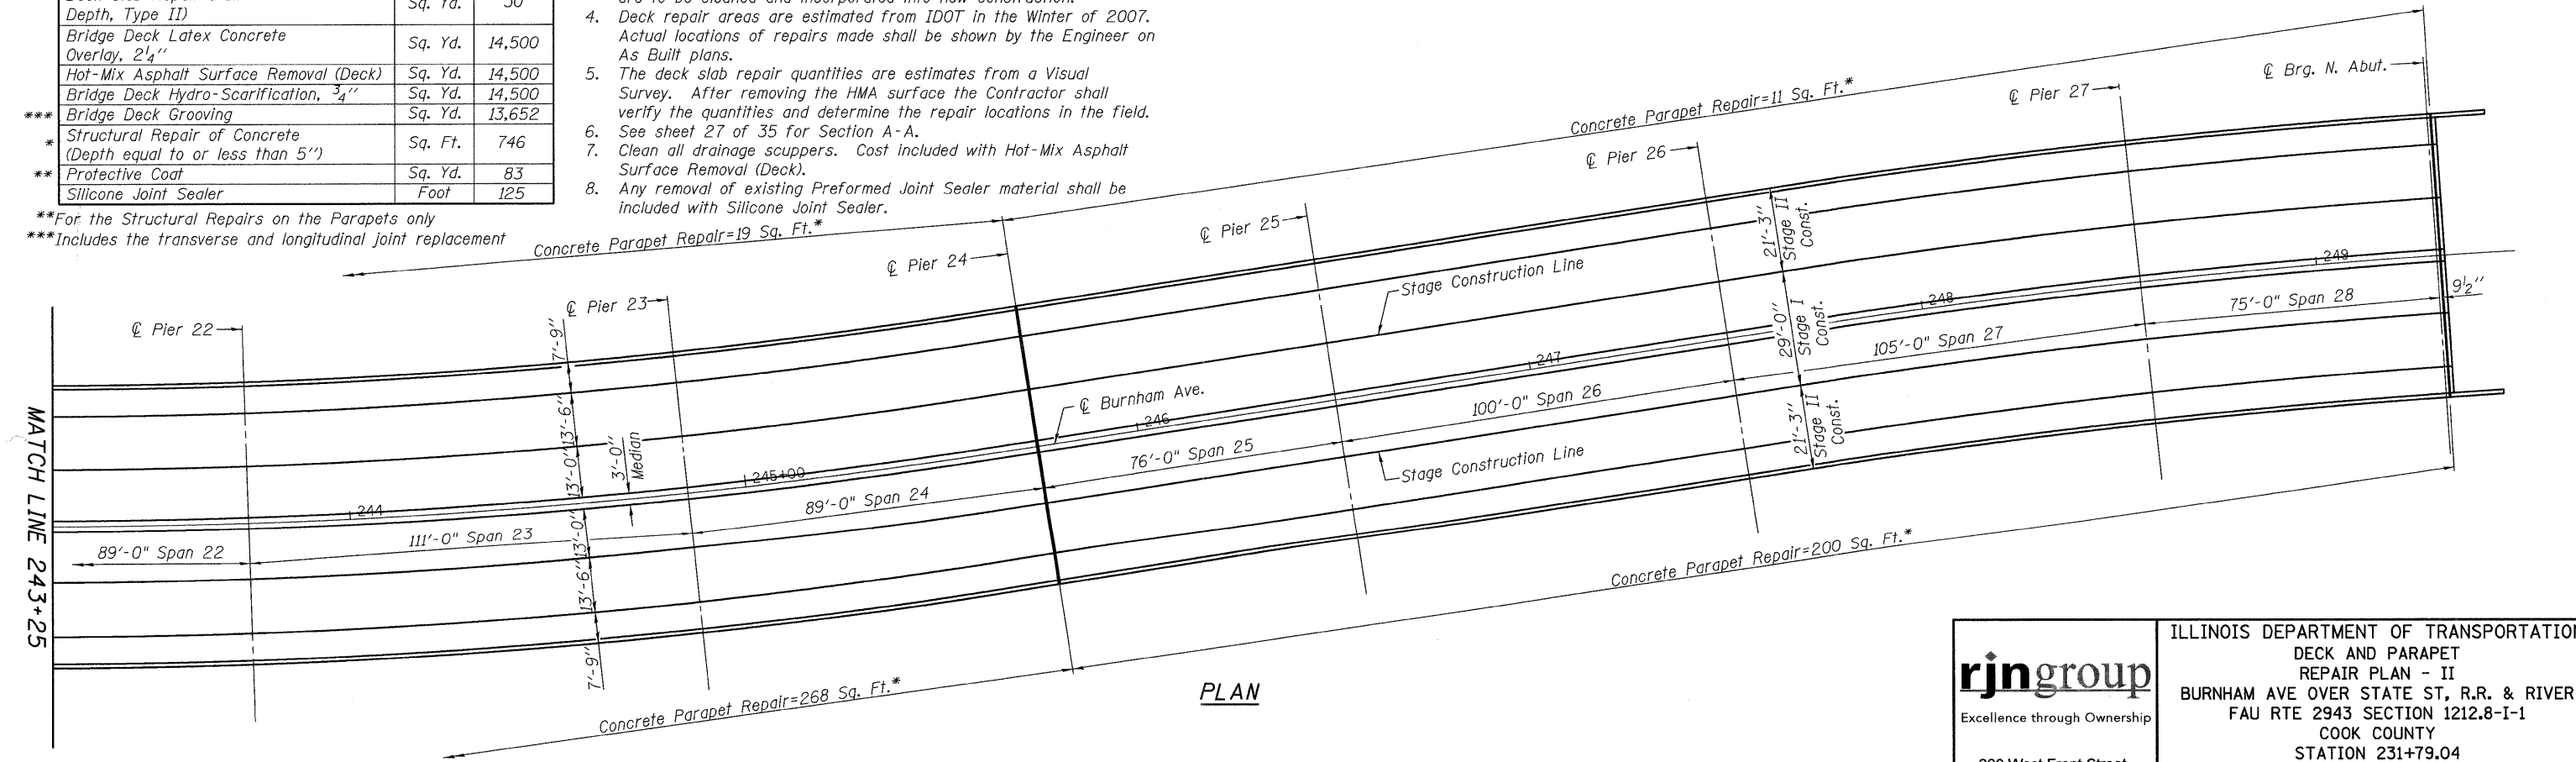

PLAN

<p>Excellence through Ownership</p> <p>200 West Front Street Wheaton, IL 60187</p>	<p>ILLINOIS DEPARTMENT OF TRANSPORTATION DECK AND PARAPET REPAIR PLAN - II BURNHAM AVE OVER STATE ST, R.R. & RIVER FAU RTE 2943 SECTION 1212.8-I-1 COOK COUNTY STATION 231+79.04 STRUCTURE NO. 016-0806</p>
	<p>DATE: 1-14-2009</p> <p>DRAWN BY JMT CHECKED BY WJV</p>

K:\11225593\Structures\Burnham Ave. Over R.R. & River\Final\Plans\Repairs.dgn 1/13/2009