


STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

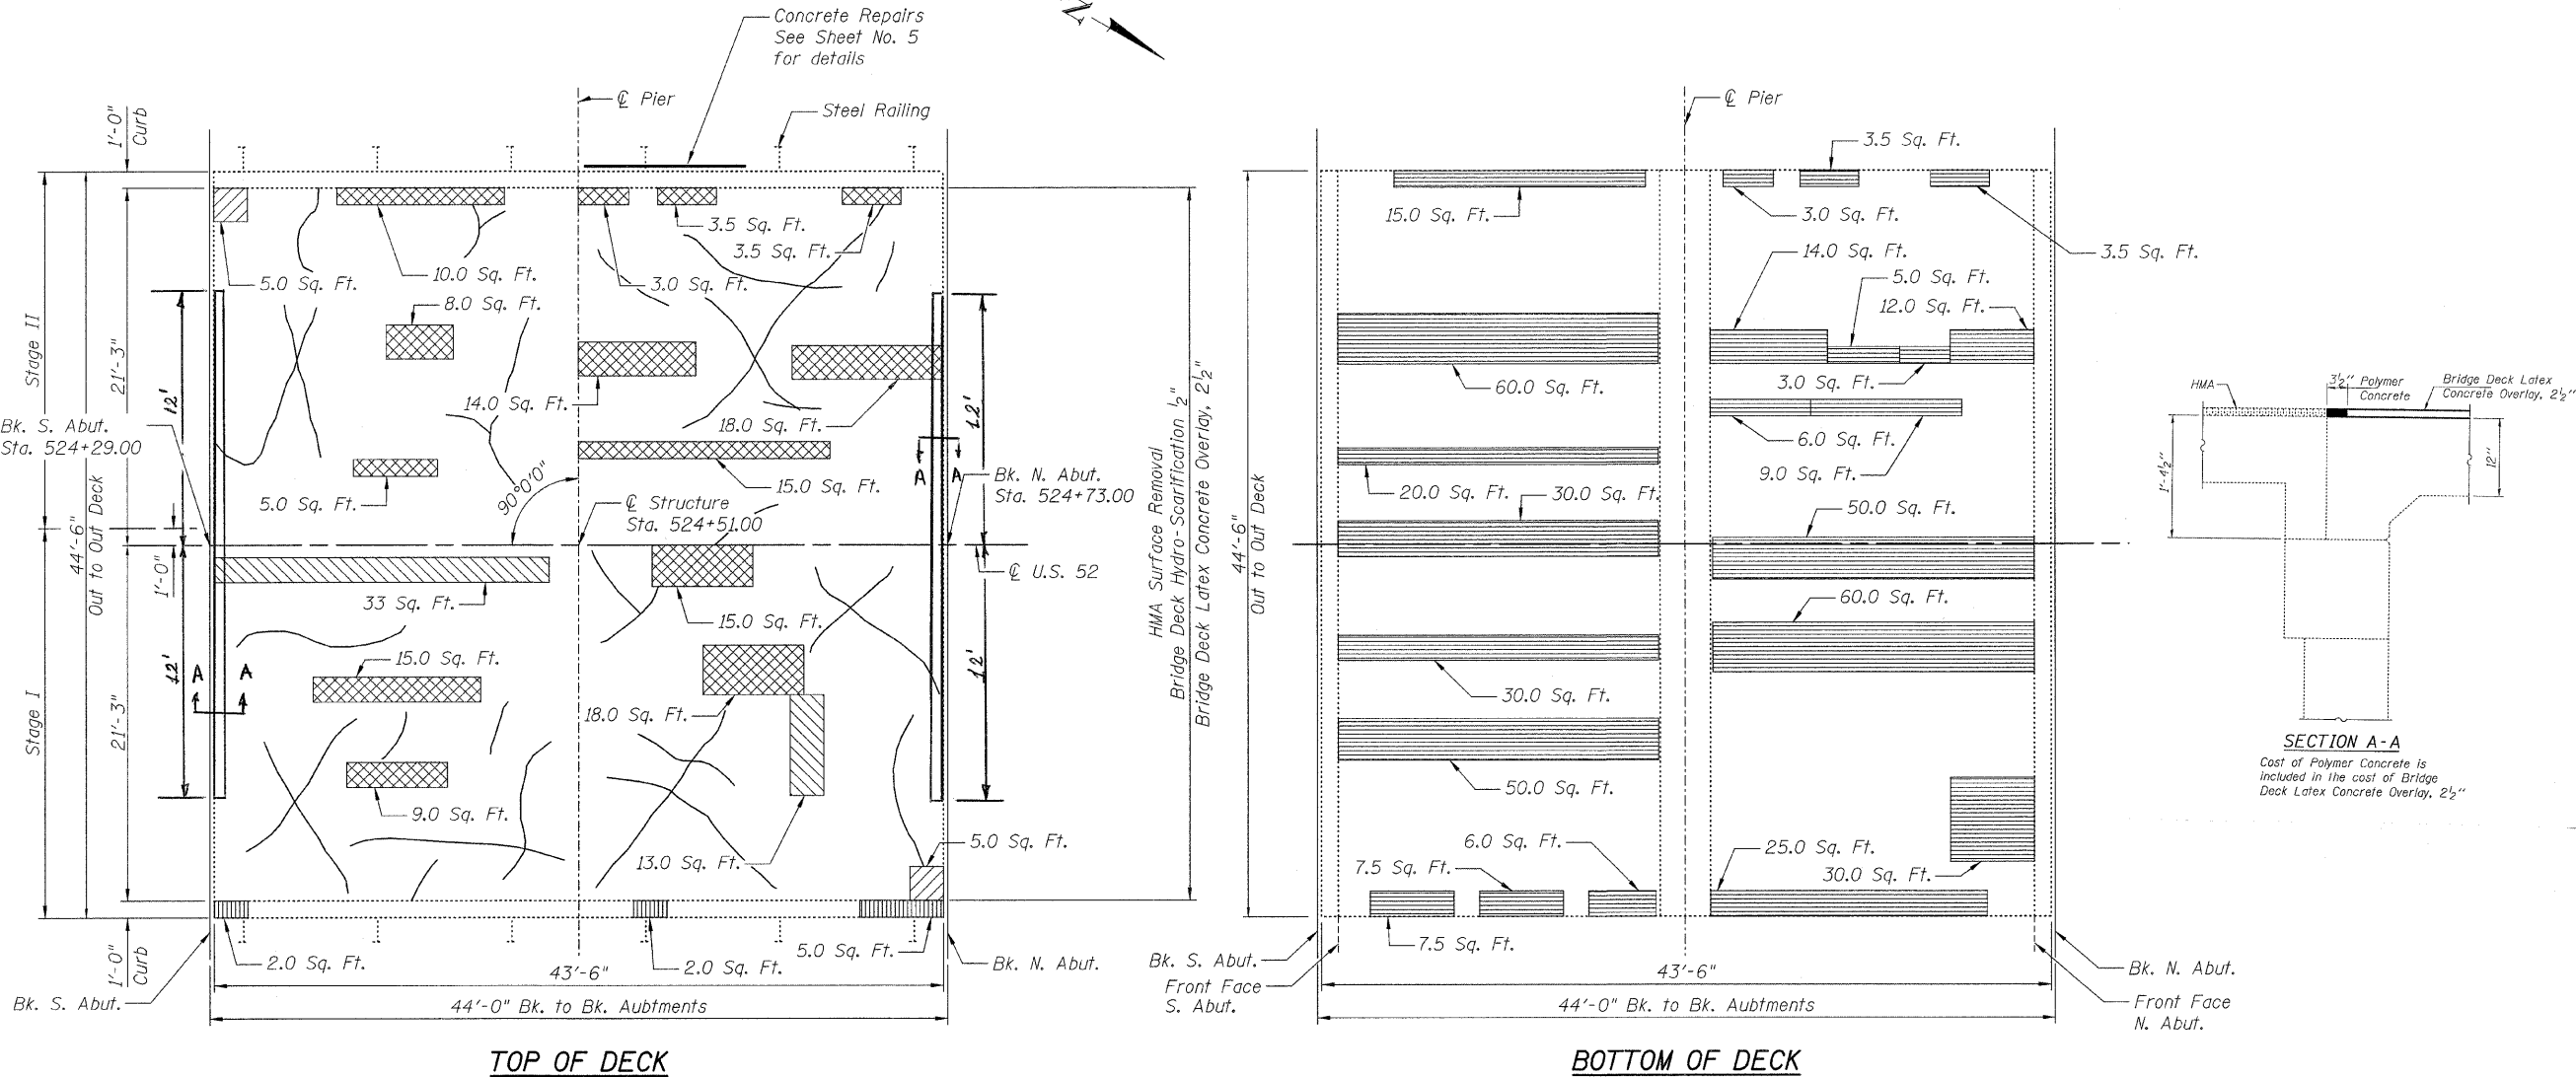

LEGEND

- Map Cracking in bituminous overlay (For Information Only)
- ▤ Partial Depth Repair (For Information Only)
- ▥ Full Depth Repair (Type I)
- ▧ Full Depth Repair (Type II)
- ▨ Cleaning and Painting Exposed Rebar
- ▩ Structural Repair of Concrete (Depth Equal to or Less than 5 inches)

NOTES:

1. Repairs shall include but not be limited to the areas shown. The actual areas to be determined by engineer at the time of construction.
2. The engineer shall record the actual deck repair areas in order to document as-built conditions for the future reference.
3. See Sheet S6 for information about the existing deck reinforcement.

BILL OF MATERIAL

ITEM	UNIT	QUANTITY
Deck Slab Repair (Full Depth, Type I)	Sq. Yd.	1.1
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	5.1
Bridge Deck Hydro-Scarification 1/2"	Sq. Yd.	208
Cleaning and Painting Exposed Rebar	Sq. Ft.	450
Structural Repair of Concrete (Depth Equal to or less than 5 inches)	Sq. Ft.	9
Bridge Deck Latex Concrete Overlay 2 1/2 inches	Sq. Yd.	208
Protective Coat	Sq. Yd.	208

SUPERSTRUCTURE REPAIRS I
U.S. 52 OVER N. BR. JACKSON CREEK
STA. 524+51.00
S.N. 099-0129

DESIGNED	E. Mroczek
CHECKED	B. Sauter
DRAWN	R. Danley
CHECKED	E. Mroczek

Giorba Group, Inc.
CONSULTING ENGINEERS
5507 North Cumberland Avenue, Suite 402 Chicago, Illinois 60656
Tel. 773.775.4009 Fax 773.775.4014 Email chicago@giorba.com

SHEET NO. S4	F.A.P. RTE. 852	SECTION 18 B-4-R-1	COUNTY WILL	TOTAL SHEETS 27	SHEET NO. 20
S6 SHEETS			CONTRACT NO. 60D84		
FED. ROAD DIST. NO.		ILLINOIS	FED. AID PROJECT		

1/13/2009 rdenley m:\proj\3329\3329_27\design\structure\lead\sh\3329_27_04 Superstructure Details.dwg