
PROP. PAY LIMIT OF HMA SURF. REMOVAL FULL THICKNESS OF MILLING TEMP. RAMP (NOTE "C") (NOTE "E") PROP. HMA SURFACE REMOVAL EXIST. HMA EXIST. PAVEMENT SURFACE MILLED TEMPORARY RAMP

(FOR BUTT JOINT AND HMA TAPER SEE DETAIL BELOW)


### OPTION 1

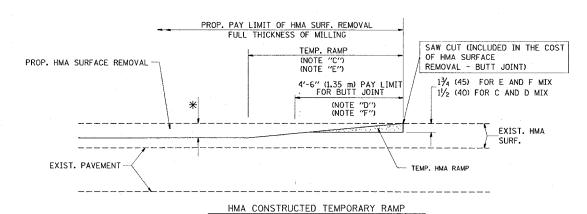

OPTION 2


## TYPICAL TEMPORARY RAMP


(FOR BUTT JOINT AND HMA TAPER SEE DETAIL BELOW)

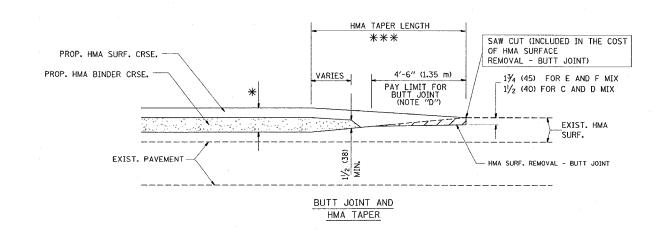

TYPICAL BUTT JOINT AND HMA TAPER FOR MILLING AND RESURFACING

F.A.P SECTION COUNTY TOTAL SHEET NO. 525 (11#12) RS-11 MCHENRY 21 13 STA. TO STA. FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT

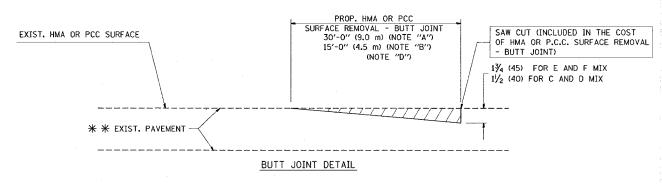

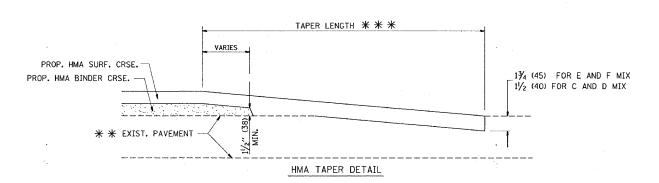

# TYPICAL BUTT JOINT AND HMA TAPER FOR RESURFACING ONLY

\* \* PC CONCRETE, HMA OR HMA RESURFACED PAVEMENT.

- A: MAINLINE ROADWAYS AND MAJOR SIDE ROADS.
- B: MINOR SIDE ROADS.
- C: THE TEMP. RAMP SHALL BE CONSTRUCTED IMMEDIATELY UPON REMOVAL OF THE EXISTING HMA SURFACE.
- D: THE BUTT JOINT SHALL BE CONSTRUCTED IMMEDIATELY PRIOR TO PLACING THE PROPOSED HMA COURSES.
- E: TAPER THE TEMP. RAMP AT A RATE OF 3'-0" (900 mm) PER 1 INCH (25 mm) OF MILLING THICKNESS.
- F: INSTALLATION AND REMOVAL OF THE 4'-6" (1.35 m) TEMP. RAMP IS INCLUDED IN COST OF HMA SURFACE REMOVAL - BUTT JOINT
- G: SEE ARTICLE 406.08 AND 406.14 OF THE STANDARD SPECIFICATIONS FOR "HMA AND/OR PCC SURFACE REMOVAL, BUTT JOINT".
- \* SEE TYPICAL SECTIONS FOR MILLING THICKNESS.
- \*\* \*\* \* 20'-0" (6.1 m) PER 1 (25) RESURFACING (NOTE "A") 10'-0" (3.0 m) PER 1 (25) RESURFACING (NOTE "B")

ALL DIMENSIONS ARE IN INCHES (MILLIMETERS) UNLESS

OTHERWISE SHOWN. REVISIONS ILLINOIS DEPARTMENT OF TRANSPORTATION

# BASIS OF PAYMENT:

THE BUTT JOINT WILL BE PAID FOR AT THE CONTRACT UNIT PRICE PER SQUARE YARD (SQUARE METER) FOR "HOT-MIX ASPHALT SURFACE REMOVAL - BUTT JOINT" OR FOR "PORTLAND CEMENT CONCRETE SURFACE REMOVAL" BUTT JOINT".

NAME	DATE	
M. DE YONG	6-13-90	
M. DE YONG	7-3-90	
M. DE YONG	3-27-92	
R. SHAH	09/09/94	
R. SHAH	10/25/94	
A. ABBAS	03/21/97	
M. GOMEZ	04/06/01	
R. BORO	01/01/07	

BUTT JOINT AND HMA TAPER DETAILS

SCALE: VERT. NONE PLOT DATE: 2/13/2007

DRAWN BY

BD400-05 (VI=BD32) REVISION DATE: 01/01/07