
815 Commerce Drive Suite 200 Oak Brook, Illinois 60523 Telephone: 630.990.3800 Fax: 630.990.3801




CITY OF DIXON, ILLINOIS

Post Office Box 386 Dixon, Illinois 61021 Telephone: 815.288.1485


DIXON MUNICIPAL AIRPORT CHARLES R. WALGREEN FIELD

OVERLAY TAXIWAYS B, D AND E: REHABILITATE FRONTAGE APRON


AIP PROJECT NO. 3-17-0036-B7 IDA PROJECT NO. C73-3436

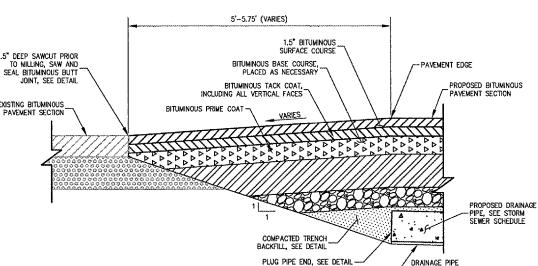


BITUMINOUS TAPER DETAIL A

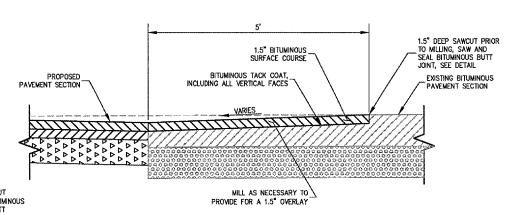

BITUMINOUS TAPER DETAIL B

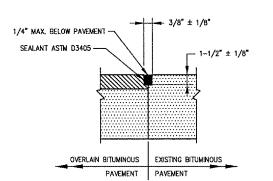

BITUMINOUS/BITUMINOUS SEAL

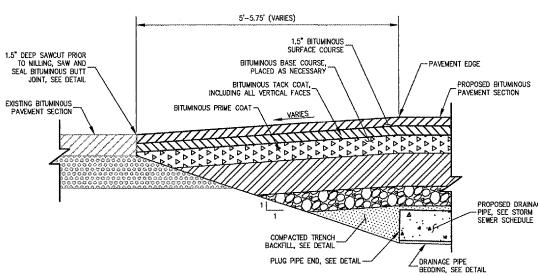

1. FOR SECTION LOCATION, SEE PLAN SHEET.

_EXISTING GRADE



SECTIONS FROM STA. 900+38.40 TO STA. 901+61.35 ARE SIMILAR TO SECTION A-A. FOR VARYING CONDITIONS, SEE STAKING PLAN.

- (9) PROPOSED UNDERDRAIN, ITEM AR705524.
- (10) PROPOSED COMPACTED TRENCH BACKFILL, SEE DETAIL.
- 1 PROPOSED DRAINAGE PIPE, ITEM AR701. (12) PROPOSED DRAINAGE MANHOLE, ITEM AR751.

SEED & MULCH (VARIES)


1.5" DROP

- (TYPICAL ALL FREE

PAVEMENT EDGES)

MANHOLE K8

(13) PROPOSED 4 INCH TOPSOIL, ITEM AR905520. SEEDING AND MULCHING AREAS, ITEMS AR901510 AND AR908520.

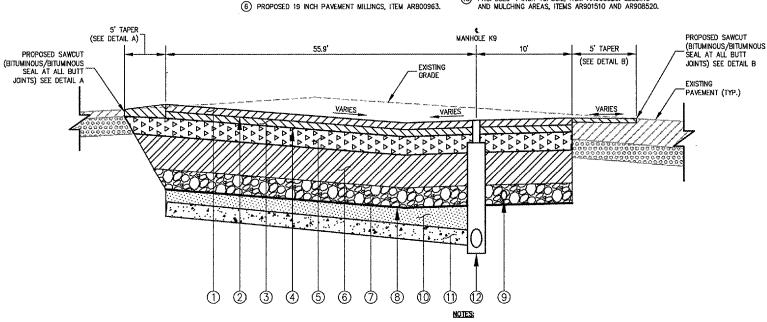

5' TAPER (SEE DETAIL A)

44.6'

(1) (2) (3) (4) (5) (6) (7) (8) (9)

1 PROPOSED 1.5 INCH BITUMINOUS SURFACE COURSE, ITEM AR401610.

2 PROPOSED BITUMINOUS TACK COAT, ITEM AR603510.

PROPOSED 1.5 INCH BITUMINOUS BASE COURSE, ITEM AR201610.

4 PROPOSED BITUMINOUS PRIME COAT, ITEM AR602510.

⑤ PROPOSED 8 INCH CRUSHED AGGREGATE BASE COURSE, ITEM AR209608.

SECTION A-A (SECTION SHOWN LOOKING EAST)

PROPOSED SAWCUT

JOINTS) SEE DETAIL A

PAVEMENT

(BITUMINOUS/BITUMINOUS SEAL AT ALL BUTT

1. FOR SECTION LOCATION, SEE PLAN SHEET.

2. SECTIONS FROM STA. 901+61.35 TO STA. 903+16.93 ARE SIMILAR TO SECTION B-B. FOR VARYING CONDITIONS, SEE STAKING PLAN.

SECTION B-B

(SECTION SHOWN LOOKING EAST)

No. Drawing Issue Description Date By

11 MARCH 2005

TYPICAL SECTIONS AND PAVEMENT DETAILS

843-04B	8007
Project Number	
KLK	02/03/05
Layout By	Date
KLK,TMM	02/03/05
Dasigned By	Date
RMH	03/11/05
Reviewed By	Date

KLK]----