



PLAN

Notes:
 Repair of the existing deck slab shall include but may not be limited to the areas shown. The actual area to be repaired will be determined by the Engineer at the time of construction.
 Cost of removal of entire existing scupper assembly and surrounding concrete including Concrete Superstructure replacement is included with Drainage Scuppers, DS-11.
 Existing reinforcement shall be cleaned and incorporated into new construction. Cost included with Drainage Scuppers, DS-11.
 Cost of concrete overlay removal for deck slab repair is included with the cost of Deck Slab Repair.
 See Sheet 7 of 7 for Permanent Protective Shield Details.

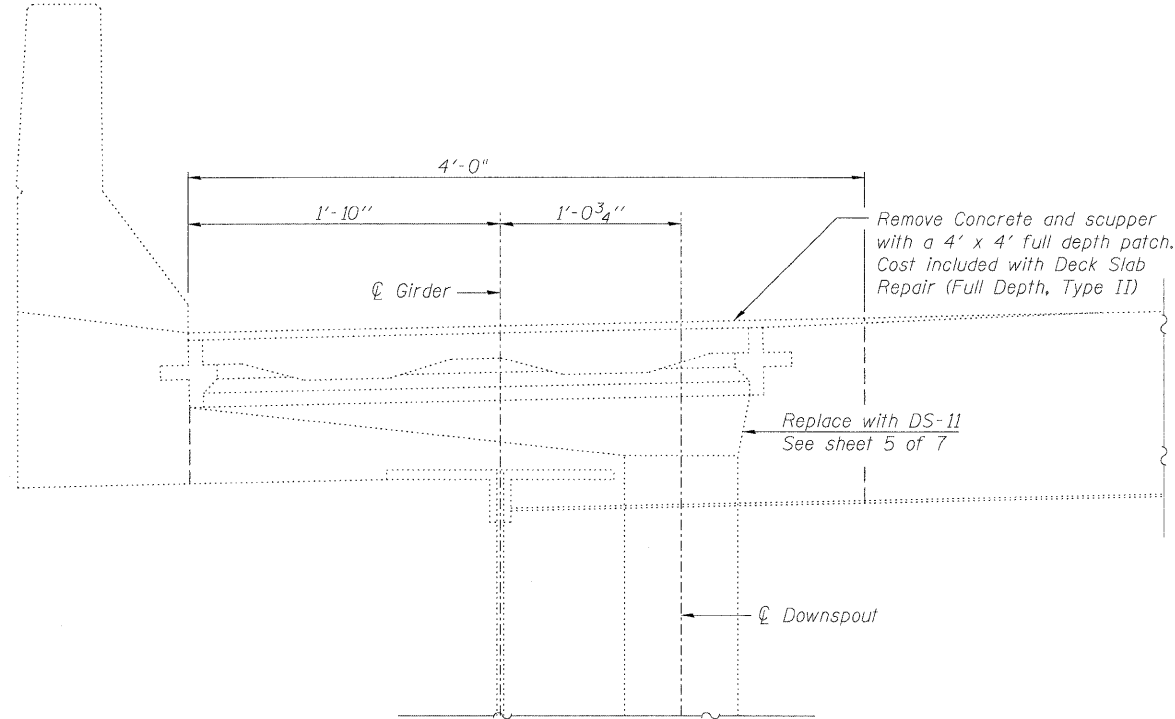

EXISTING

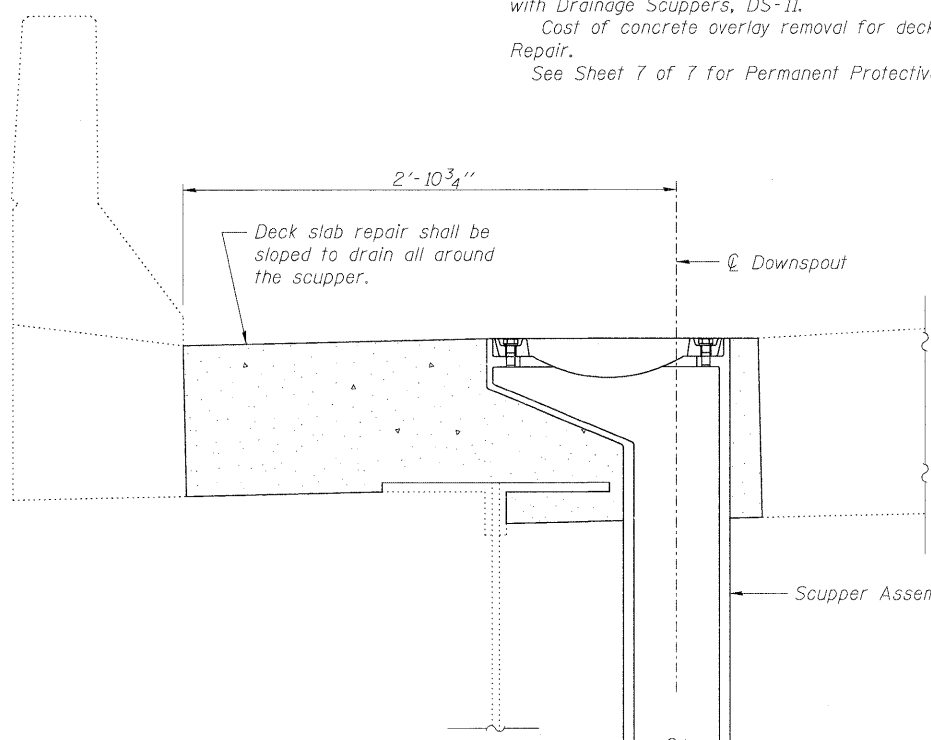

PROPOSED

* Due to the long length of the downspout, the Contractor shall add a new bracket near the bottom of the downspout that is to be mechanically attached to the girder. Remove the existing weld and grind smooth. Add a 45° bend near the bottom of downspout to direct the flow into the gutter at the abutment.

LEGEND

- Deck Slab Repair (Full Depth, Type II)
- Deck Slab Repair (Partial)
- sf Square Feet

SCUPPER REPLACEMENT

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Deck Slab Repair (Full Depth, Type II)	Sq. Yd.	25.1
Deck Slab Repair (Partial)	Sq. Yd.	246.9