PROP. PAY LIMIT OF HMA SURF. REMOVAL

FULL THICKNESS OF MILLING

TEMP. RAMP

(NOTE "C")

(NOTE "E")


EXIST. PAVEMENT

EXIST. PAVEMENT

MILLED TEMPORARY RAMP

(FOR BUTT JOINT AND HMA TAPER SEE DETAIL BELOW)


OPTION 1

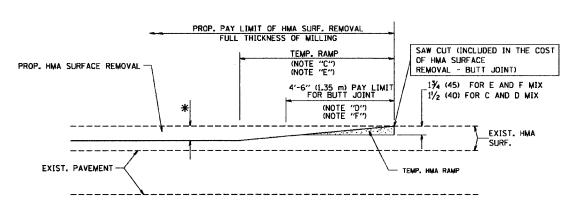

HMA CONSTRUCTED TEMPORARY RAMP


(FOR BUTT JOINT AND HMA TAPER SEE DETAIL BELOW)

OPTION 2 TYPICAL TEMPORARY RAMP

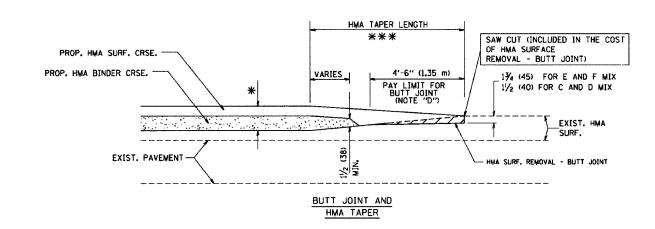

TYPICAL BUTT JOINT AND HMA TAPER
FOR MILLING AND RESURFACING

1601 08-00115-00-RS COOK 19 14 FEO. RONO DIST. NO. 1 ILUNOIS FED. AID PROJECT CONTRACT #63046 PROP. HMA OR PCC
SURFACE REMOVAL - BUTT JOINT SAW CUT (INCLUDED IN THE COST EXIST. HMA OR PCC SURFACE 30'-0" (9.0 m) (NOTE "A") 15'-0" (4.5 m) (NOTE "B") OF HMA OR P.C.C. SURFACE REMOVAL - BUTT JOINT) (NOTE "D") 13/4 (45) FOR E AND F MIX 11/2 (40) FOR C AND D MIX * * EXIST. PAVEMENT BUTT JOINT DETAIL

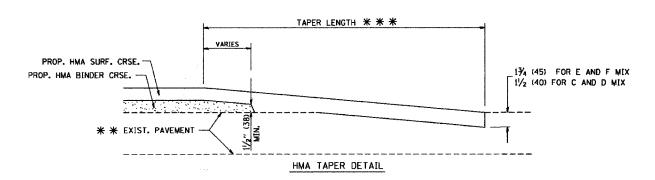

TYPICAL BUTT JOINT AND HMA TAPER FOR RESURFACING ONLY

 $\ensuremath{**}$ PC CONCRETE, HMA OR HMA RESURFACED PAVEMENT.

NOTES

- A: MAINLINE ROADWAYS AND MAJOR SIDE ROADS.
- B: MINOR SIDE ROADS.

THE BUTT JOINT WILL BE PAID FOR AT THE CONTRACT UNIT PRICE PER SOUARE YARD (SOUARE METER) FOR "HOT-MIX ASPHALT SURFACE REMOVAL - BUTT JOINT" OR FOR "PORTLAND CEMENT CONCRETE SURFACE REMOVAL- BUTT JOINT".

BASIS OF PAYMENT:

- C: THE TEMP. RAMP SHALL BE CONSTRUCTED IMMEDIATELY UPON REMOVAL OF THE EXISTING HMA SURFACE.
- D: THE BUTT JOINT SHALL BE CONSTRUCTED IMMEDIATELY PRIOR TO PLACING THE PROPOSED HMA COURSES.
- E: TAPER THE TEMP. RAMP AT A RATE OF 3'-0" (900 mm) PER 1 INCH (25 mm) OF MILLING THICKNESS.
- F: INSTALLATION AND REMOVAL OF THE 4'-6" (1.35 m) TEMP. RAMP IS INCLUDED IN COST OF HMA SURFACE REMOVAL BUTT JOINT
- G: SEE ARTICLE 406.08 AND 406.14 OF THE STANDARD SPECIFICATIONS FOR "HMA AND/OR PCC SURFACE REMOVAL, BUTT JOINT".
- * SEE TYPICAL SECTIONS FOR MILLING THICKNESS.

ALL DIMENSIONS ARE IN INCHES (MILLIMETERS) UNLESS

SECTION

COUNTY

TOTAL SHEETS

OTHERWISE SHOWN.

ILLINOIS DEPARTMENT OF TRANSPORTATION

BUTT JOINT AND HMA TAPER DETAILS

SCALE: VERT. NONE

DRAWN BY CHECKED BY

BD400-05 (VI=BD32)