FOR INDEX OF SHEETS SEE SHEET 2

IMPROVEMENTS ARE LOCATED WITHIN THE CITY OF CHICAGO

IMPROVEMENT LOCATION

38 N

Plan Preparation Engineer: Issam Rayyan Project Manager: Robert Boro (847)-705-4237 CONTRACT NO.60V31 ROUTE VARIOUS

SECTION 2012-042-I

COUNTY

NTY

TOTAL SHEETS

*20-9=1

SHEET NUMBER

CONTRACT NO.:60V31

D-91-009-12

PROPOSED HIGHWAY PLANS

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

DIVISION OF HIGHWAYS


VARIOUS ROUTES
VARIOUS LOCATIONS (NEAR MIDWAY AIRPORT)
SECTION 2012-042-I
CURB AND GUTTER REPAIR
COOK COUNTY
C-91-538-12

R 13 E



LAKE TOWNSHIP

1 Rev. 7-23-12

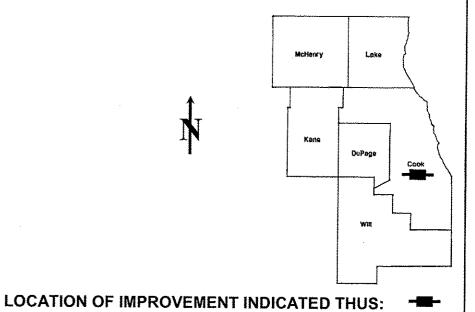

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION
DIVISION OF HIGHWAYS

SUBMITTED: JUNE 15, 2012

actory

DEPUTY DIRECTOR OF HIGHWAYS, REGION ENGINEER

20 12

ENGINEER OF DESIGN AND ENVIRONMENT

June 29 20 12 William R. Froy Jac

PRINTED BY THE AUTHORITY
OF THE STATE OF ILLINOIS

C.U.A.N.: CHICAGO UTILITY ALERT NETWORK (312) 744-7000

INDEX	OF	SH	IEE	TS
-------	----	----	-----	----

3	TITLE SHEET
	113 July VI II-I-1

2. INDEX OF SHEETS, STATE STANDARDS, GENERAL NOTES AND MIXTURE REQUIREMENTS

3. SUMMARY OF QUANTITIES

4.-15. SCHEDULE OF QUANTITIES
Delete Sheets 7.-15.

16. DETAIL: CONCRETE DRIVEWAY

17. CURB AND GUTTER REMOVAL AND REPLACEMENT

18. CITY OF CHICAGO DETAILS FOR P.C. CONCRETE DRIVEWAY, ALLEY RETURN AND SIDEWALK

19. TRAFFIC CONTROL AND PROTECTION FOR SIDEROADS, INTERSECTIONS AND DRIVEWAYS (TC-10)

20. ARTERIAL ROAD INFORMATION SIGN (TC-22)

STATE STANDARDS

424001-06	PERPENDICULAR CURB RAMPS FOR SIDEWALKS
424021	DEPRESSED CORNER FOR SIDEWALKS
424026	ENTRANCE/ALLEY PEDESTRIAL CROSSING
701301-04	LANE CLOSURE, 2L, 2W, SHORT TIME OPERATIONS
701501-06	URBAN LANE CLOSURE, 2L, 2W, UNDIVIDED
701606-00	URBAN LANE CLOSURE WITH MOUNTABLE MEDIAN
701701 <i>-08</i>	URBAN LANE CLOSURE MULTILANE INTERSECTION
701801 <i>-0</i> 5	SIDEWALK, CORNER OR CROSSWALK CLOSURE
701901-02	TRAFFIC CONTROL DEVICES

MIXTURE REQUIREMENTS

MIXTURE TYPE	AIR VOIDS @ Ndes
HOT-MIX ASPHALT SURFACE COURSE MIX "D", N70 (IL 9.5 mm), (1.5-3.0 in)	4% @ 70 GYR.

THE UNIT WEIGHT USED TO CALCULATE ALL HMA SURFACE MIXTURES IS 112 LBS/SQ YD/IN.

- THE AC TYPE FOR POLYMERIZED HMA MIXES SHALL BE SBS/SBR PG 76-22" AND FOR NON-POLYMERIZED HMA THE AC TYPE SHALL BE "PG 64-22" UNLESS MODIFIED BY DISTRICT ONE SPECIAL PROVISIONS. FOR "PERCENT OF RAP" SEE SPECIAL PROVISIONS.

ROUTE	SECTION	COUNTY	TOTAL SHEETS	SHEET NUMBER
VARIOUS	2012-042-1	COOK	20	2

CONTRACT NO.: 60V31

GENERAL NOTES

BEFORE STARTING ANY EXCAVATION, THE CONTRACTOR SHALL CALL "C.U.A.N." (CHICAGO UTILITY ALERT NETWORK) AT (312)744-7000 FOR FIELD LOCATIONS OF BURIED ELECTRIC, TELEPHONE AND GAS UTILITIES. (48 HOUR NOTIFICATION IS REQUIRED).

THE CONTRACTOR WILL NOT BE ALLOWED TO SET UP A YARD OR FIELD OFFICE ON STATE PROPERTY WITHOUT WRITTEN PERMISSION FROM THE DEPARTMENT.

WHEN CONSTRUCTING SIDEWALK RAMPS FOR THE HANDICAPPED (STATE STANDARD 424001), USE TYPE B RAMPS UNLESS OTHERWISE SPECIFIED.

THESE PLANS HAVE BEEN PREPARED FROM NOTES RECEIVED FROM BUREAU OF MAINTENANCE.

THE COST OF HOT-MIX ASPHALT REMOVAL IN THE EXISTING GUTTER FLAG WILL BE INCLUDED IN THE UNIT PRICE BID FOR COMBINATION CURB AND GUTTER REMOVAL AND REPLACEMENT.

ALL DAMAGE TO EXISTING PAVEMENT MARKINGS SHALL BE REPLACED AT THE CONTRACTOR'S EXPENSE.

THE ENGINEER SHALL OBTAIN APPROVAL FROM THE DISTRICT ONE BUREAU CHIEF OF MAINTENANCE FOR ANY PROPOSED REVISIONS IN THE SCHEDULED CURB AND GUTTER REPAIR LOCATIONS.

DO NOT SCALE PLANS FOR CONSTRUCTION DIMENSIONS.

IT SHALL BE THE CONTRACTOR'S RESPONSIBILITY TO VERIFY ALL DIMENSIONS AND CONDITIONS EXISTING IN THE FIELD PRIOR TO CONSTRUCTION AND ORDERING OF MATERIALS.

PAINT CURB YELLOW AT FIRE HYDRANTS ACCORDING TO THE APPLICABLE REQUIREMENTS OF SECTION 780 OF THE STANDARD SPECIFICATIONS FOR PAINTED PAVEMENT MARKINGS, EXCEPT THE COST SHALL NOT BE PAID FOR SEPERATELY BUT SHALL BE INCLUDED IN "COMB. CONC. C&G, REMOVAL AND REPLACEMENT."

ADJACENT PARALLEL SIDEWALK, REMOVE AND REPLACE ENTIRE WIDTH OF SIDEWALK JOINT TO JOINT

THE CONTRACTOR SHALL CONTACT THE DISTRICT ONE TRAFFIC CONTROL SUPERVISOR AT (847)705-4470 A MINIMUM OF 72 HOURS IN ADVANCE OF BEGINNING WORK.

ILLINOIS DEPARTMENT OF TRANSPORTATION

INDEX OF SHEETS STATE STANDARDS GENERAL NOTES

		**************************************	100%. STATE	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~								***************************************	100% STATE	~ ~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~					
	SUMMARY OF QUANTITIES	*************************************	URBAN			CONSTRUCT	ION TYPE	CODE 002	I		SUMMARY OF QUANTITIES		URBAN		T	CONSTRUCTION	ON TYPE C	ODE 002	21
CODE NO	ITEM TO ASSES	UNIT	TOTAL	0021				***************************************		CODE NO	ITEM	UNIT	TOTAL	0021		The state of the s			
21101615	TOPSOIL FURNISH AND PLACE, 4"	SO YD	112	112	\					X4401198	HOT-MIX ASPHALT SURFACE REMOVAL. VARIABLE DEPTH	SO YD	185	185					
		Andreas de la constitución de la	(And Andread and An]	And the second section of the sectio					7						
25200110	SODDING. SALT TOLERANT	SO YD	112	112	\					Z0004562	COMBINATION CONCRETE CURB AND GUTTER REMOVAL AND REPLACEMENT	FOOT	1101	1101					
40603340	HOT-MIX ASPHALT SURFACE COURSE, MIX "D", N70	TON	32	32	\					20030850	TEMPORARY INFORMATION SIGNING	SO FT	309	309					
		Video Contraction of the Contrac					nage of the state												
42001300	PROTECTIVE COAT	SQ YD	2882	2882	\														
42300400	PORTLAND CEMENT CONCRETE DRIVEWAY PAVEMENT, 8 INCH	SO YD	1604	1664	\int_{Λ}		At the state of th	and the state of t											
WALLAND AND AND AND AND AND AND AND AND AND)													491-144			
42400200	PORTLAND CEMENT CONCRETE SIDEWALK 5 INCH	SO FT	5755	5755	-			***************************************					***************************************						
42400410	PORTLAND CEMENT CONCRETE SIDEWALK 8 INCH	SO FT	3000	3000	}			Anna da				**************************************	A						
<u></u>	1101		\$		\			 											
42400800	DETECTABLE WARNINGS	SO FT	430	430	<u> </u>														
							TO THE PERSON NAMED IN COLUMN TO THE												
44000200	DRIVEWAY PAVEMENT REMOVAL	SO YD (1664	1664		ANNE CONTRACTOR CONTRA										-			
44000600	SIDEWALK REMOVAL	SO FT	8755	8755	{			An designation of the second o					Anness de selection de selectio			***************************************			
					7			***************************************								***************************************			
67100100	MOBIL 1ZATION	L SUM		1								And the second s						, , , , , , , , , , , , , , , , , , , ,	
70102620	TRAFFIC CONTROL AND PROTECTION. STANDARD 701501	L SUM	1	1													an uniteraction of the state of		
		***************************************				and the state of t													
70102625	TRAFFIC CONTROL AND PROTECTION, STANDARD TO1606	L SUM	1	1	······································	Annual		of the control of the				of market shared and a state of the state of					Alexandria Andreas		
70102635	TRAFFIC CONTROL AND PROTECTION. STANDARD 701701	L SUM	ı	-	,														
								***************************************						ļ	ļ				
70102640	TRAFFIC CONTROL AND PROTECTION. STANDARD 701801	L SUM	and the same of th	4-4				* Andrews Andr				Anna Anna Anna Anna Anna Anna Anna Anna							
					***************************************							Average de la constitución de la	And the state of t	\	Pari	7-23	-17		
FILE NAME = GIVAN_WORKPUMPHISTORY	USER NAME * CU1704* 17/201-007-236-1/7169009-0661/gruph	DESIGNED - DRAWN -	-	REVISED REVISED					TATE OF		Ciliaga	ARY OF QUANT	 TITIEC	121	RTE.	/ インコ ・ SECTI OUS 2012-0	ON 42^I	COOK	TOTAL SHEET SHEETS NO. 20 3
	PLOY SCALE : 5000,0000 '/ In. PLOY DATE : 6/15/2012	CHECKED -		REVISED REVISED				DEPARTM	ENT OF T	RANSPORTA	TION SCALE: SHEET NO. OF			O STA.		ROAD DIST, No. 1 R		CONTRACT	NO. 60V31

/			TOTAL	SHEET
ROUTE	SECTION	COUNTY	SHEETS	NUMBER
VARIOUS	2012-042-l	COOK	20	4

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 5' PARALLEL	SIDEWALK 8" R&R (SQFT) 5' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
5931 West 59th Street	100.0	16.7	15.0	15.0	0.0	0.0	0.0	0.0	Replace 100 Feet of Broken Curb Along Mason Avenue Side of House
3810 West 60th Place	8.0	1.4	0.0	18.0	150.0	0.0	0.0	10.0	Install Depressed Curb For Handicapped Accessible Access, and Replace 6 Sidewalk Squares and 4 Courtesy Walk Squares
5838 West 63rd Place	0.0	0.0	0.0	0.0	200.0	0.0	840.0	0.0	Replace Alley In Concrete From 5822 to 5846 West 63rd Place, 2 Locations
4501 West 66th Place	0.0	0.0	0.0	9.0	600.0	0.0	0.0	0.0	Replace Entire Sidewalk On Front and Side of Home
3650 West 67th Place	0.0	0.0	0.0	0.0	225.0	0.0	0.0	0.0	9 Sidewalk Squares
3859 West 67th Place/3858 West 68th Street	10.0	1.7	0.0	4.5	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3858 to 3854 West 68th Street	11.0	1.9	1.5	3.0	0.0	0.0	0.0	0.0	Replace 11 Feet of Broken Curb and Missing Gutter in Front of These Two Addresses
3901 West 68th Place/3900 West 69th Street	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron in its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3816 West 68th Street	0.0	0.0	0.0	0.0	100.0	0.0	0.0	0.0	Replace 4 Sidewalk Squares
3834 West 68th Street	0.0	0.0	0.0	13.5	0.0	0.0	0.0	0,0	Replace 3 Sunken Carriage Walk Squares
3901 West 68th Street/3900 West 68th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3630 West 70th Street	30.0	5.0	3.4	15.0	0.0	0.0	0.0	0.0	Replace 30 Feet of Curb and Gutter in Front of Entire Length of Home
3634 West 70th Street	30.0	5.0	3.4	15.0	0.0	0.0	0.0	0.0	Replace 30 Feet of Curb and Gutter In Front of Entire Length of Home
3803 West Marquette Road/3800 West 67th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3859 West Marquette Road/3858 West 67th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3901 West Marquette Road/3900 West 67th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3757 West Marquette Road/6715 South Hamlin Avenue	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
4025 West Marquette Road/6715 South Komensky Avenue	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6048 South Austin Avenue	0.0	0.0	0.0	0.0	25.0	0.0	0.0	0.0	Replace 1 Sidewalk Square
6052 South Austin Avenue	10.0	1.7	1.7	0.0	0.0	0.0	0.0	0.0	Repair Curb and Gutter In Front of This Address
6419 South Austin Avenue	30.0	5.0	1.7	30.0	0.0	0.0	0.0	0.0	Replace Courtesy Walk, and 30 Feet of Curb and Gutter in front of home. It is currently too high and too deep, and is causing a standing water issue.
6423 South Austin Avenue	0.0	0.0	0.0	0.0	50.0	0.0	0.0	0.0	Repair Caving-In Cement/Concrete in Front of This Address
7200 South Avers	7.0	1.2	1.2	0.0	0.0	0.0	0.0	0.0	Replace 7 Feet of Missing Gutter on Either Side of Adjacent Sewer Catch Basin on 72nd Street Side
SUB-TOTAL.	306.0	51.5	27.9	123.0	2150.0	1200.0	6440.0	170.0	

ILLINOIS DEPARTMENT OF TRANSPORTATION

SCHEDULE OF QUANTITIES

ROUTE	SECTION	COUNTY	TOTAL SHEETS	SHEET NUMBER
VARIOUS	2012-042-1	COOK	20	5

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 5' PARALLEL	SIDEWALK 8" R&R (SQFT) 5' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
6412 South Karlov Avenue	0.0	0.0	0.0	36.0	150.0	0.0	0.0	0.0	Replace 6 Sidewalk Square, Courtesy Walk, and Carriage Walk
6558 South Keating Avenue	100.0	16.7	13.4	30.0	0.0	0.0	0.0	0.0	Replace 100 Feet of Broken, Cracked, and Low Curb and Gutter on the 66th Street of This Address - North Side of Street
6600 South Keating Avenue	100.0	16.7	13.4	30.0	0.0	0.0	0.0	0.0	Replace 100 Feet of Missing Curb and Gutter on the 66th Street of This Address - South Side of Street
6023 South Kenneth Avenue	12.0	2.0	0.4	15.0	150.0	0.0	0.0	0.0	replace 12 feet of curb and gutter
6559 South Kilbourn Avenue	20.0	3.4	0.0	0.0	50.0	0.0	30.0	0.0	Replace Side Driveway Apron & Adjacent Curb Around Perimeter of Driveway Apron Facing 66th Street
6058 South Kilpatrick Avenue	20.0	3.4	0.0	22.5	0.0	0.0	0.0	0.0	Replace Side Concrete Driveway Apron Facing 61st Street Side, Including Driveway Apron Curb and Gutter. There is currently a standing water issue here.
7759 South Kilpatrick Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0	0.0	Replace Missing Curb and Gutter on 78th Street Side of Home Directly In Front of Driveway Apron
6058 South Kilpatrick Avenue/6059 South Keating Avenue	10.0	1.7	0.0	22.5	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6459 South Knox Avenue	100.0	16.7	15.4	12.0	0.0	0.0	0.0	0.0	Replace 100 Feet of Curb and Gutter on the 65th Street of This Address, Between Knox Avenue and Train Tracks - North Side of Street
6500 South Knox Avenue	100.0	16.7	15.4	12.0	0.0	0.0	0.0	0.0	Replace 100 Feet of Curb and Gutter on the 65th Street of This Address - South Side of Street - Standing Water Issue Here.
6501 South Knox Avenue	100.0	16.7	15.4	12.0	0.0	0.0	0.0	0.0	Replace 100 Feet of Curb and Gutter on the 65th Street of This Address, Between Knox Avenue and Train Tracks - South Side of Street
6149 South Kostner Avenue	0.0	0.0	0.0	0.0	100.0	0.0	0.0	0.0	Replace 3 or 4 Sidewalk Squares
6340 South Kostner Avenue	0.0	0.0	0.0	0.0	150.0	0.0	0.0	0.0	Replace 6 Sidewalk Squares
6348 South La Crosse Avenue	0.0	0.0	0.0	0.0	25.0	0.0	0.0	10.0	Replace ADA Ramp on the SouthWest Corner of 6300 South La Crosse Avenue -
6349 South La Crosse Avenue	0.0	0.0	0.0	0.0	50.0	0.0	0.0	0.0	Replace 2 Sidewalk Squares
6351 South La Crosse Avenue	0.0	0.0	0.0	0.0	50.0	0.0	0.0	0.0	Replace Sidewalk Squares Impacted By The Sewer
6459 South Lamon Avenue	0.0	0.0	0.0	0.0	75.0	0.0	0.0	0.0	Replace 3 Raised Sidewalk Squares on 65th Street Side of House
6459 South Laporte Avenue/6458 South Lamon Avenue	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron, Facing 65th Street
6751 South Lawndale Avenue	0.0	0.0	0.0	0.0	150.0	0.0	0.0	0.0	Replace 6 Cracked, Broken Sidewalk Squares
6000 South Major Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0	0.0	Replace Side Concrete Driveway Apron Facing 60th Street Side
6025 South Mason Avenue	0.0	0.0	0.0	22.5	150.0	0.0	0.0	0.0	Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares, and 3 Carriage Walk Squares
6001 South Massasoit Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0	0.0	Replace Side Concrete Driveway Apron Facing 60th Street Side
6001 South Massasolt Avenue/6000 South Major Avenue	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
SUB-TOTAL	642,0	107.6	73.4	214.5	1400.0	450.0	2220.0	70.0	

ILLINOIS DEPARTMENT OF TRANSPORTATION

SCHEDULE OF QUANTITIES

_				TOTAL	SHEET
	ROUTE	SECTION	COUNTY	SHEETS	NUMBER
	VARIOUS	2012-042-1	COOK	20	6

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 5' PARALLEL	SIDEWALK 8" R&R (SQFT) 5' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
5914 South Mayfield Avenue	5.0	0.9	0.0	22.5	50.0	75.0	350.0	10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps At This Address
5915 South Mayfield Avenue	5.0	0.9	0.0	0.0	50.0	75.0	350,0	10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps At This Address
6110 South Mayfield Avenue	3.0	0.5	0.4	9.0	0.0	0.0	0.0	0.0	Replace 3 Feet of Curb, 3 Feet of Carriage Walk, and 1 Courtesy Walk Square
5830 South New England Avenue	0.0	0.0	0.0	22.5	200.0	0.0	0.0	0.0	Replace 8 Sidewalk Squares and Entire Courtesy Walk
6725 South Pulask Road/3944 West 67th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6825 South Pulask Road/3944 West 68th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6735 South Pulask Road/3945 West 67th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6835 South Pulask Road/3945 West 68th Place	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6735 South Pulaski Road/3944 West 68th Street	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6805 South Pulaski Road/3945 West 68th Street	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6750 South Pulaski Road/6759 South Komensky Avenue	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron in its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7237 South Springfield Avenue	0.0	0.0	0.0	0.0	0.0	0.0	16.0	0.0	Repair 4 Foot by 4 Foot Concrete Alley Hole Directly In Front of Asphalt Spe- Humps on 73rd Street/Alley Side of Home
6732 South Springfield Avenue/3900 West 68th Street	10.0	1.7	0.0	0.0	100.0	150.0	700.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
5724 South Tripp	60.0	10.0	9.5	4.5	0.0	0.0	0.0	0.0	Replace Broken Sidewalk Squares
5623 South Tripp Avenue	0.0	0.0	0.0	0.0	25.0	0.0	0.0	0.0	Replace 1 Sidewalk Square
5701 South Tripp Avenue	0.0	0.0	0.0	0.0	75.0	0.0	0.0	0.0	Replace 3 Sidewalk Squares
5741 South Tripp Avenue	0.0	0.0	0.0	0.0	150.0	0.0	0.0	0.0	Replace 6 Sidewalk Squares
5742 South Tripp Avenue	0.0	0.0	0.0	9.0	150.0	0.0	0.0	0.0	Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
6341 South Tripp Avenue	0.0	0.0	0.0	0.0	100.0	0.0	0.0	0.0	Replace Broken Sidewalk Squares
6437 South Tripp Avenue	0.0	0.0	0.0	0.0	150.0	0.0	0.0	0.0	Replace 6 or 7 Sidewalk Squares
6443 South Tripp Avenue	0.0	0.0	0.0	0.0	50.0	0.0	0.0	10.0	Replace 2 Sidewalk Squares
SUB-TOTAL	153.0	25.9	9.9	67.5	1800.0	1350.0	6316.0	190.0	

ILLINOIS DEPARTMENT OF TRANSPORTATION

SCHEDULE OF QUANTITIES

1101.0

TOTAL

form date: 5/05/2003

430.0

14976.0