



PIER 2 ELEVATION
(West face)

LEGEND

- ① Epoxy Crack Injection
- ② Structural Repair of Concrete (Depth equal to or less than 5 inches)

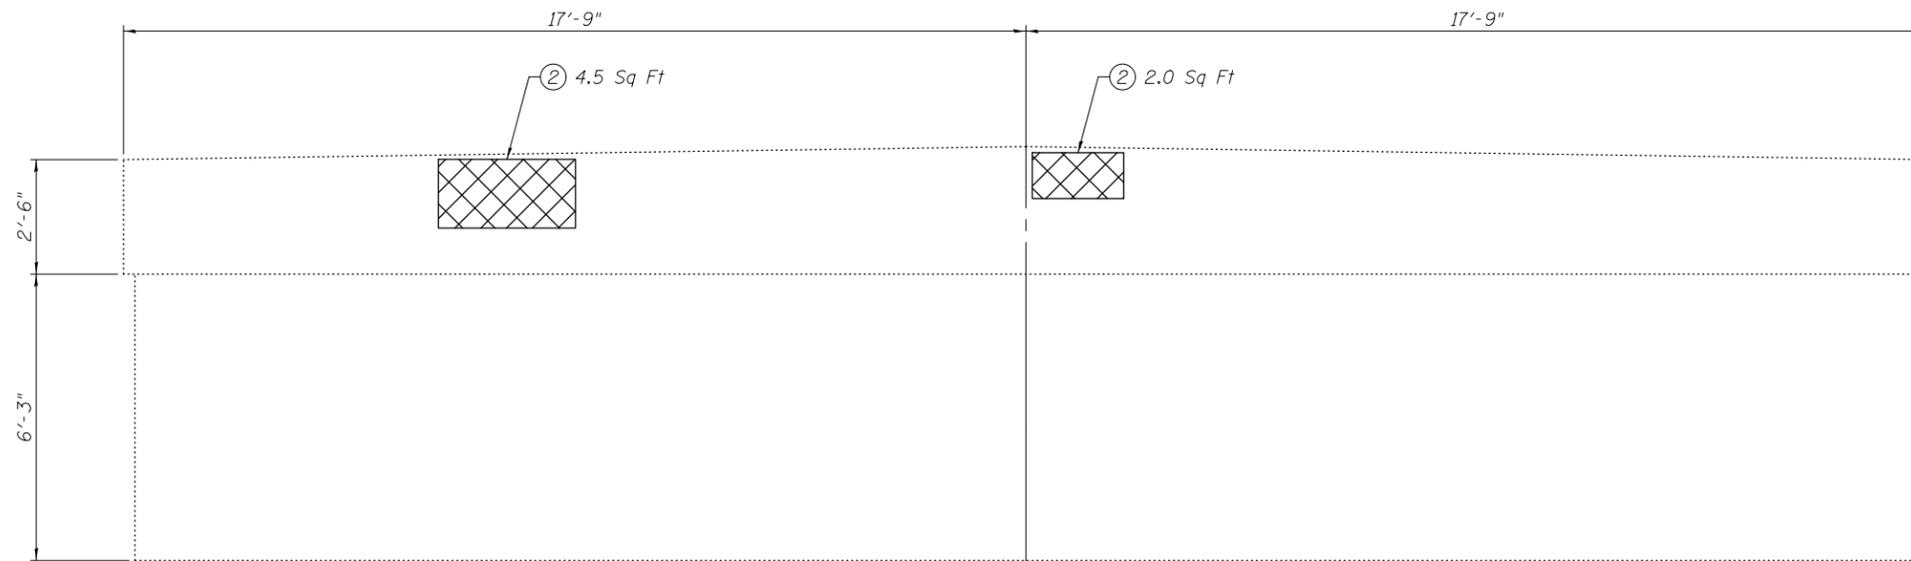

PIER 2 ELEVATION
(East face)

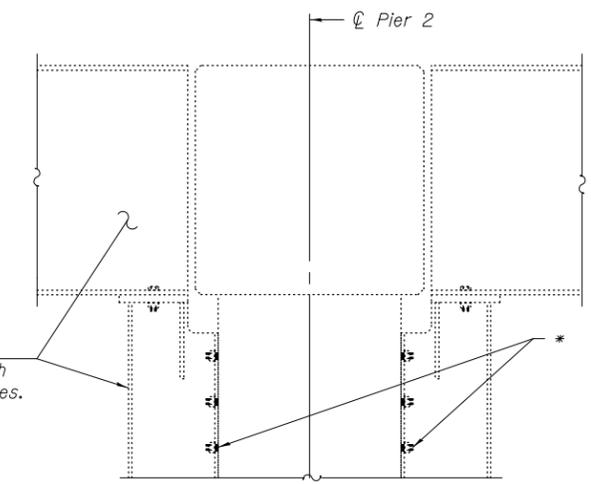

SECTION THRU PIER 2

Existing steel deck beam supports to be salvaged. Cost included with Removal of Existing Superstructures. See sheet 1 of 18.

* Existing grouted bars shall be cut off to existing concrete surface. Grind smooth and seal with epoxy. Cost included with Removal of Existing Superstructures.

BILL OF MATERIAL

Item	Unit	Quantity
Epoxy Crack Injection	Foot	1.0
Structural Repair Of Concrete (Depth Equal to or Less than 5 Inches)	Sq. Ft.	7.5

DESIGNED - IRENE PANTOJA	EXAMINED - <i>Joanne F. J...</i>	DATE - SEPTEMBER 16, 2014
CHECKED - JOSUE D. ORTIZ-VARELA	PASSED - <i>Carl...</i>	REVISIONS
DRAWN - MICHAEL B. MOSSMAN	ACTING ENGINEER OF BRIDGES AND STRUCTURES	REVISIONS
CHECKED - J.O.V. / I.P. / G.R.A.		

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

PIER 2 REMOVAL & REPAIRS
STRUCTURE NO. 096 - 0063

F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
823	(22BR2)BR	WAYNE	34	33
CONTRACT NO. 74365			ILLINOIS FED. AID PROJECT	