




BROKEN DRAIN

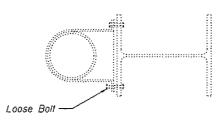


I LOOSE BOLT IN DRAIN CONNECTION

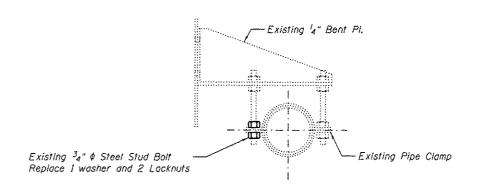


## MISSING FASTENER ON DRAIN PIPE SUPPORT

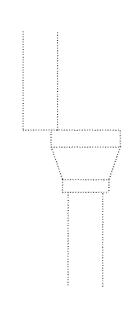

DRAIN DOWNSPOUT MISALIGNED

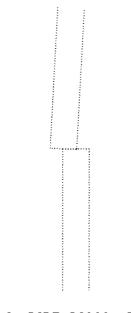

DRAIN PIPE DISCONNECTED

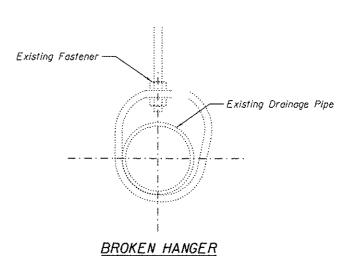

## TABLE OF REPAIRS

NBIS Item #	Span	Location	Deficiency	Repair
72	4	Midspan at Girder 4	Broken Hanger	Replace Hanger
72	9	Pan. 3, N. Side	Broken Hanger	Replace Hanger
72	9	Pan. 6, N. Side	Broken Hanger	Replace Hanger
72	9	Pan. 8, N. & S. Side	Broken Hanger	Replace Hanger
100	W	Under Stringer 5 at Bent W	Missing Fastener on Drain Pipe Support	Replace Fastener
144	9	Between L7 & L8, N. Side	Drain Downspout Misaligned	Realign Downspout
<i>30</i> 5	31, 32	North Column of Bent 31	Drain Pipe is Disconnected	Reconnect Drain Pipe
<i>305</i>	31, 32	North Column of Bent 31	Clogged, Full of Debris	*Unclog Drain
309	4	20' from Bent 3 at Girder 1	Broken Drain	Reconnect Drain Pipe
368	W	Throughout South Side	Clogged, Full of Debris	*Unclog Drain
369	1, 2	North Column, 6' from Ground Level	1 Loose Bolt in Drain Connection	Tighten Bolt
<i>372</i>	9	Throughout South Side	Clogged, Full of Debris	*Unclog Drain

\*Cost included with Cleaning Drainage System.

## Notes

Repair of the existing drainage system shall include but may not be limited to the locations shown. The final repair locations will be determined by the Engineer prior to repair.

All work shown on this sheet shall be included in pay item Bridge Drainage System Repair unless noted otherwise.

In addition to the repairs shown on this sheet, the drainage system for the entire bridge including scuppers, floor drains and downspouts shall be cleaned. Cost included with Cleaning Drainage System.

## BILL OF MATERIAL

<u>Item</u>	Unit	Total
Bridge Drainage System Repair	Each	10
Cleaning Drainage System	L Sum	1

LIN ENGINEERING, LTD.
Consulting Engineers
Springfeld, Serios

D. FILE NAME . CHECKED - TBP REVISED - PLOT SCALE . DRAWN - AJF REVISED - PLOT DATE . 05/02/2014 CHECKED - VBT REVISED -		USER NAME :	DESIGNED - JJA	REVISED -	1
	D.	FILE NAME .	CHECKED - TBP	REVISED -	
BIOT DATE 4 05/02/2014 CHECKED - MRT DEWISED -		PLOT SCALE .	DRAWN - AJF	REVISED -	
CHECKED - ALL MEATER		PLOT DATE . 05/02/2014	CHECKED - VPT	REVISED -	

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

DRAINAGE REPAIR DETAILS							
S.N. 082-6001	MLK	BRIDGE	OVER	MISSISSIPPI	RIVER		
	SHEET	NO. \$128 O	F \$138	SHEETS			

		ILLINOIS	FEO.	AID	PRO.	ECT		
				T	CO	NTRACT	NO.	76B0
799	1BR.	ORS-2			ST.	CLAIR	156	146
F.A.P. RTE.	SEC	CTION			CO	UNTY	TOTAL	SHE