
NOTES:

- THIS DETAIL IS INTENDED ONLY TO SHOW THE REQUIRED SEPARATION OF THE VARIOUS CABLES WITHIN THE TRENCH. FOR EXACT NUMBER OF CABLES RUNNING TO EACH PAPI UNIT, SEE WIRING DIAGRAM BY MANUFACTURER.
- 2. CABLE MARKER TAPE, PN 0761315 MANUFACTURED BY ALLEN SYSTEMS, OR EQUAL, SHALL BE PLACED IN ALL CABLE TRENCHES AT 6" ABOVE GROUNDING CONDUCTOR


PAPI CABLES TRENCH DETAIL

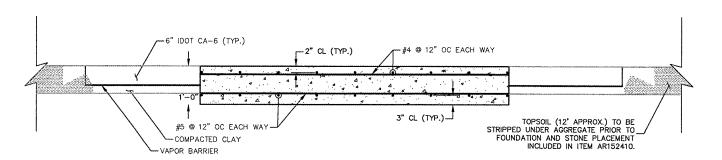

PAPI FOUNDATION SECTION

NOTES:

COMPACTED STONE TO BE PAID SEPERATELY UNDER ITEM AR208606. VAPOR BARRIER TO BE PAID SEPERATELY UNDER ITEM
AR800968.

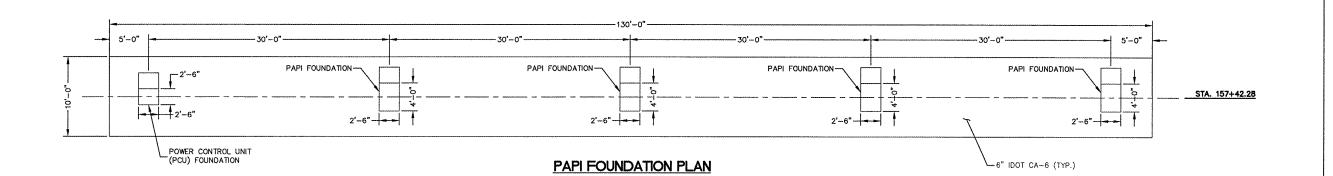

LE039



HANSON PROFESSIONAL SERVICES INC.

815 Commerce Drive, Suite 200 Oak Brook, Illinois 60523 Telephone: 630.990.3800 Fax: 630.990.3801

Illinois Professional Design Firm Registration No. 184—001084

© Copyright Hanson Professional Service Inc. 2008




JOLIET REGIONAL PORT DISTRICT

1 George Michas Drive Romeoville, Illinois 60446 Telephone: 815.838.9497 Fax: 815.838.9524

EXTEND RUNWAY 2-20; CONSTRUCT TAXIWAY TURNAROUND

AIP PROJECT NO. 3-17-0140-B42 IDA PROJECT NO. LOT-3792

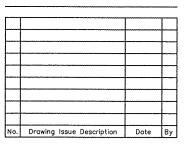

APRIL 18, 2008

Sheet Title

PAPI FOUNDATION **DETAILS**

07A0166	
Project Number	
LDH	03/07/08
Loyout By	Date
LDH	03/07/08
Designed By	Date
RMH	03/20/08
Reviewed By	Date

66

DETAILS SHOWN ARE NOT TO SCALE