
STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION

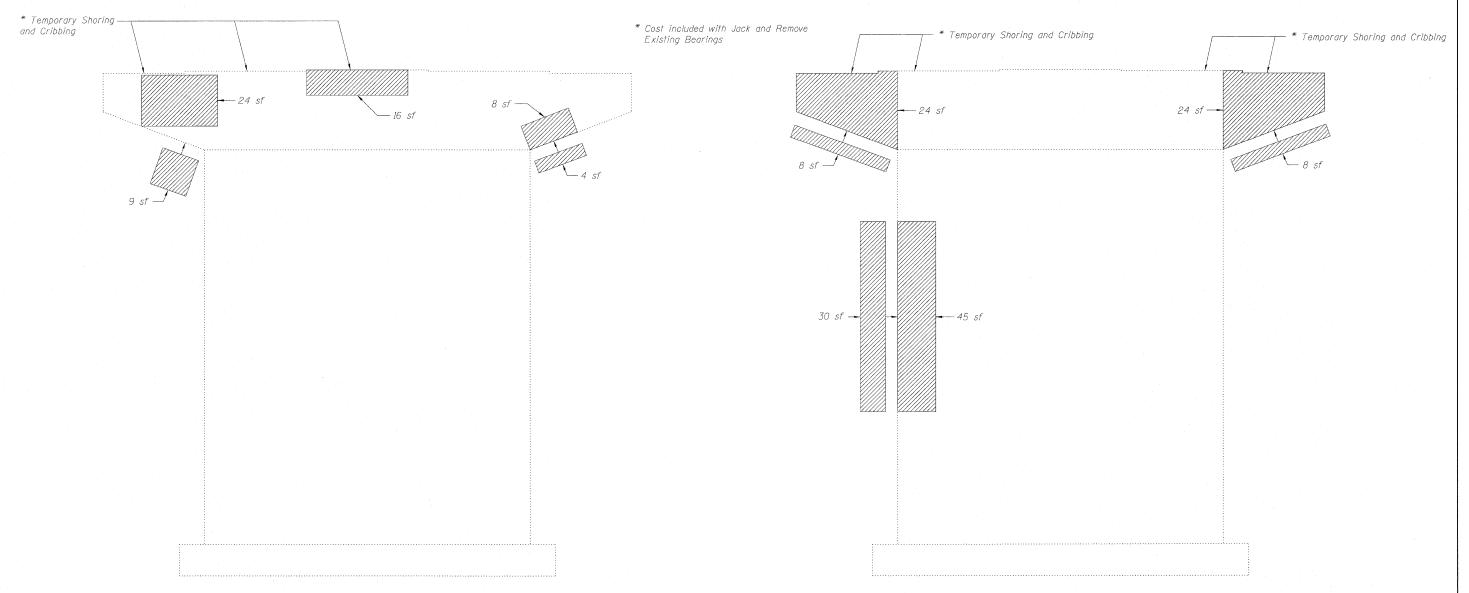

PIER 20 (North Face)

Notes:

Temporary Shoring and Cribbing required to complete bearing replacement and/or Structural Repair of Concrete (Depth Equal to or Less Than 5 inches) shall not be paid for separately but shall be included in the cost of Jack and Remove Existing Bearings. When doing the pier repair and bearing replacement at the same time, the structure shall not be jacked up from the pier, the weight must be taken off the pier, in the area of the pier repair. Concrete must be cured to minimum strength for the repair before bearing can be replaced and weight put back on the pier, according to special provisions.
See Sheet 21 of 27 for Reactions.

Repair of the existing piers shall include but may not be limited to the areas shown. The actual area to be repaired will be determined by the Engineer at the time of construction.

BILL OF MATERIAL

<i>Item</i>	Unit	Total	
Structural Repair of Concrete (Depth equal to or less than 5 in.)	Sq. Ft.	200	

LEGEND

Structural Repair of Concrete (Depth equal to or less than 5")

sf Square Feet

PIER 20

(South Face)

PIER REPAIR (3 of 4) STRUCTURE NO. 016-2407



					
HEET NO.25	F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEE NO.
110.23	330	462 X-B-I	COOK	54	45
7 SHEETS			CONTRACT	NO. 6	0J37
	ILLINOIS FED AID PROJECT				