


STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	SHEET NO.	SHEET TOTAL
FAP 328	*	WHITE	42	26
FED. ROAD DIST. NO.	ILLINOIS	FED. AID PROJECT NO.		
98997			*105X1BR	

SHEET NO. 15  
17 SHEETS

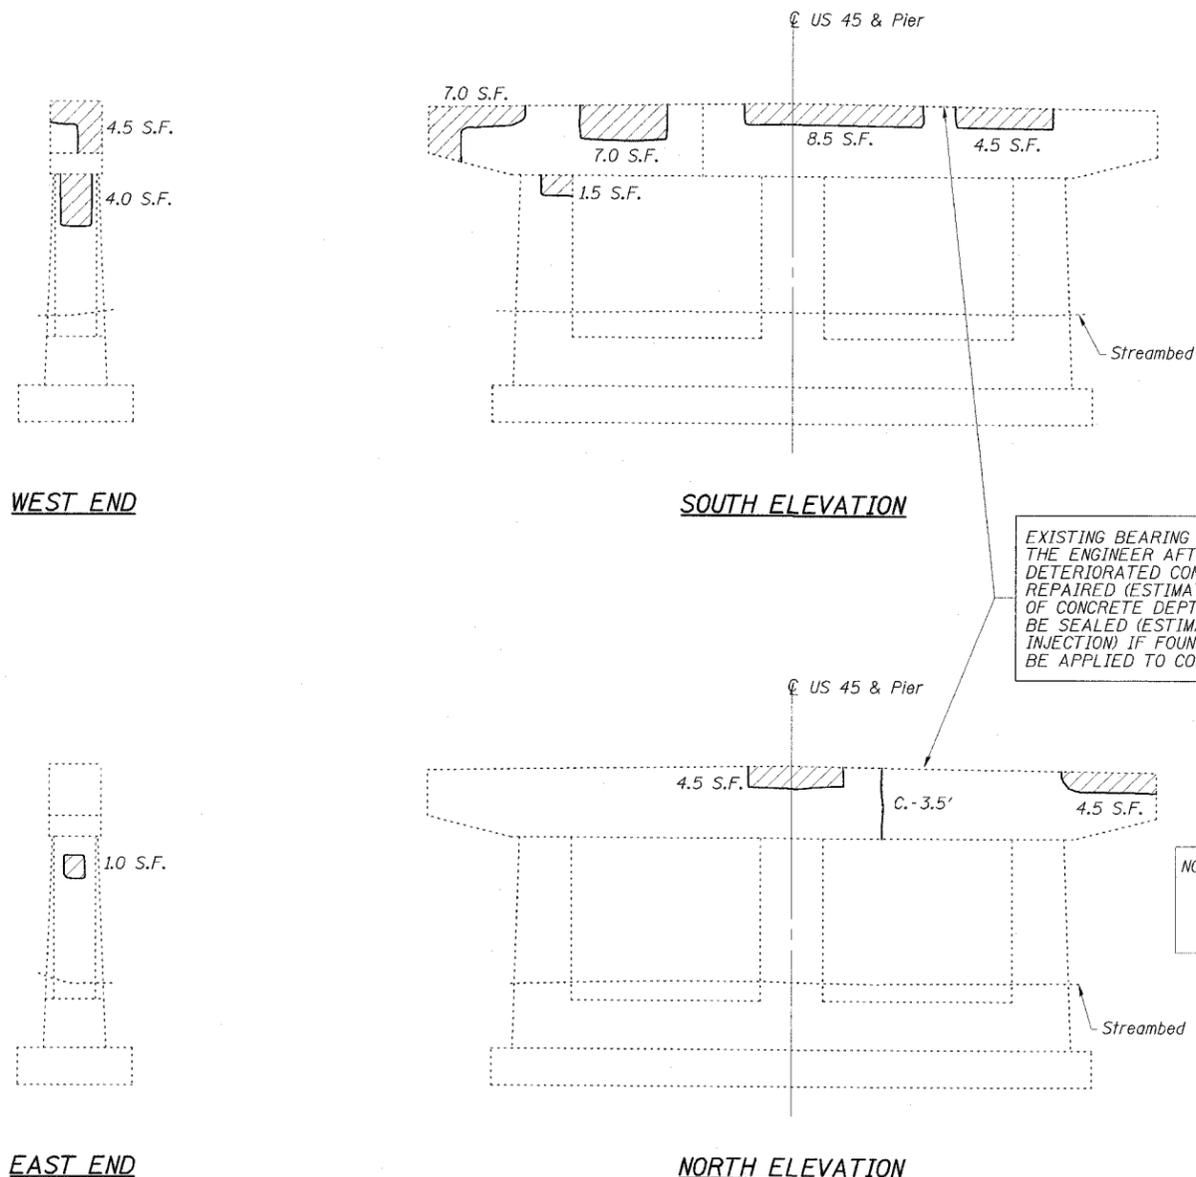

**PIER 3  
BILL OF MATERIAL**

ITEM	UNIT	TOTAL
Epoxy Crack Injection	Foot	23
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	62
Concrete Sealer	Sq. Ft.	15

**REPAIR LEGEND**

Inspection Date: 12/14/06

- C.-6' Crack to be epoxy injected
- S.F. Delaminated or Spalled Area - Use Structural Repair of Concrete

**ESCA**  
CONSULTANTS, INC.

DESIGNED BY:	RDP	01/07
DRAWN BY:	DWH	01/07
CHECKED BY:	JMS/MTD	01/07
APPROVED BY:	RDP	04/07

**PIER 3**  
**US 45 OVER SKILLET FORK OVERFLOW**  
**FAP ROUTE 328 - SECTION (105X)BR**  
**WHITE COUNTY**  
**STATION 598+76.00**  
**STRUCTURE NO. 097-0019**