

08-03-12 LETTING ITEM 042

ROUTE	SECTION	COUNTY	TOTAL SHEETS	SHEET NUMBER
VARIOUS	2012-042-I	COOK	20	1


CONTRACT NO.:60V31

FOR INDEX OF SHEETS SEE SHEET 2

STATE OF ILLINOIS  
 DEPARTMENT OF TRANSPORTATION  
 DIVISION OF HIGHWAYS  
 DISTRICT ONE  
**PROPOSED HIGHWAY PLANS**

D-91-009-12

VARIOUS ROUTES  
 VARIOUS LOCATIONS (NEAR MIDWAY AIRPORT)  
 SECTION 2012-042-I  
 CURB AND GUTTER REPAIR  
 COOK COUNTY  
 C-91-538-12

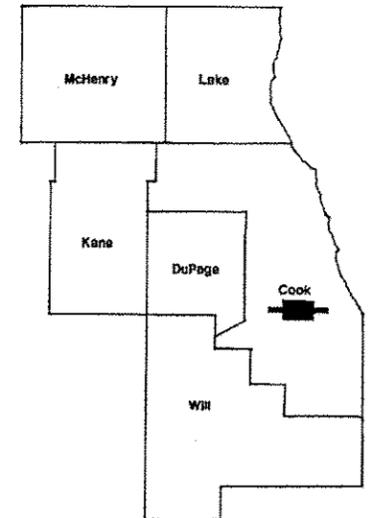

IMPROVEMENTS ARE  
 LOCATED WITHIN THE CITY  
 OF CHICAGO

LOCATION OF IMPROVEMENT INDICATED THUS: 

IMPROVEMENT  
 LOCATION



LAKE TOWNSHIP

Plan Preparation Engineer: Issam Rayyan  
 Project Manager: Robert Boro (847)-705-4237  
**CONTRACT NO.60V31**

STATE OF ILLINOIS  
 DEPARTMENT OF TRANSPORTATION  
 DIVISION OF HIGHWAYS

SUBMITTED: JUNE 15, 2012

*John P. ...*  
 DEPUTY DIRECTOR OF HIGHWAYS, REGION ENGINEER

June 29 2012  
*John D. Baranzelli, P.E.*  
 acting ENGINEER OF DESIGN AND ENVIRONMENT

June 29 2012  
*William R. ...*  
 acting DIRECTOR OF HIGHWAYS, CHIEF ENGINEER

**PRINTED BY THE AUTHORITY  
 OF THE STATE OF ILLINOIS**

C.U.A.N.: CHICAGO UTILITY ALERT  
 NETWORK  
 (312) 744-7000

ROUTE	SECTION	COUNTY	TOTAL SHEETS	SHEET NUMBER
VARIOUS	2012-042-I	COOK	20	2

CONTRACT NO.: 60V31

**INDEX OF SHEETS**

1. TITLE SHEET
2. INDEX OF SHEETS, STATE STANDARDS, GENERAL NOTES AND MIXTURE REQUIREMENTS
3. SUMMARY OF QUANTITIES
- 4.-15. SCHEDULE OF QUANTITIES
16. DETAIL: CONCRETE DRIVEWAY
17. CURB AND GUTTER REMOVAL AND REPLACEMENT
18. CITY OF CHICAGO DETAILS FOR P.C. CONCRETE DRIVEWAY, ALLEY RETURN AND SIDEWALK
19. TRAFFIC CONTROL AND PROTECTION FOR SIDEROADS, INTERSECTIONS AND DRIVEWAYS (TC-10)
20. ARTERIAL ROAD INFORMATION SIGN (TC-22)

**STATE STANDARDS**

- 424001-06 PERPENDICULAR CURB RAMPS FOR SIDEWALKS
- 424021 DEPRESSED CORNER FOR SIDEWALKS
- 424026 ENTRANCE/ALLEY PEDESTRIAL CROSSING
- 701301-04 LANE CLOSURE, 2L, 2W, SHORT TIME OPERATIONS
- 701501-06 URBAN LANE CLOSURE, 2L, 2W, UNDIVIDED
- 701606-08 URBAN LANE CLOSURE WITH MOUNTABLE MEDIAN
- 701701-08 URBAN LANE CLOSURE MULTILANE INTERSECTION
- 701801-05 SIDEWALK, CORNER OR CROSSWALK CLOSURE
- 701901-02 TRAFFIC CONTROL DEVICES

**MIXTURE REQUIREMENTS**

MIXTURE TYPE	AIR VOIDS @ Ndes
HOT-MIX ASPHALT SURFACE COURSE MIX "D", N70 (IL 9.5 mm), (1.5-3.0 in)	4% @ 70 GYR.

- THE UNIT WEIGHT USED TO CALCULATE ALL HMA SURFACE MIXTURES IS 112 LBS/SQ YD/IN.
- THE AC TYPE FOR POLYMERIZED HMA MIXES SHALL BE SBS/SBR PG 76-22" AND FOR NON-POLYMERIZED HMA THE AC TYPE SHALL BE "PG 64-22" UNLESS MODIFIED BY DISTRICT ONE SPECIAL PROVISIONS. FOR "PERCENT OF RAP" SEE SPECIAL PROVISIONS.

**GENERAL NOTES**

BEFORE STARTING ANY EXCAVATION, THE CONTRACTOR SHALL CALL "C.U.A.N." (CHICAGO UTILITY ALERT NETWORK) AT (312)744-7000 FOR FIELD LOCATIONS OF BURIED ELECTRIC, TELEPHONE AND GAS UTILITIES. (48 HOUR NOTIFICATION IS REQUIRED).

THE CONTRACTOR WILL NOT BE ALLOWED TO SET UP A YARD OR FIELD OFFICE ON STATE PROPERTY WITHOUT WRITTEN PERMISSION FROM THE DEPARTMENT.

WHEN CONSTRUCTING SIDEWALK RAMPS FOR THE HANDICAPPED (STATE STANDARD 424001), USE TYPE B RAMPS UNLESS OTHERWISE SPECIFIED.

THESE PLANS HAVE BEEN PREPARED FROM NOTES RECEIVED FROM BUREAU OF MAINTENANCE.

THE COST OF HOT-MIX ASPHALT REMOVAL IN THE EXISTING GUTTER FLAG WILL BE INCLUDED IN THE UNIT PRICE BID FOR COMBINATION CURB AND GUTTER REMOVAL AND REPLACEMENT.

ALL DAMAGE TO EXISTING PAVEMENT MARKINGS SHALL BE REPLACED AT THE CONTRACTOR'S EXPENSE.

THE ENGINEER SHALL OBTAIN APPROVAL FROM THE DISTRICT ONE BUREAU CHIEF OF MAINTENANCE FOR ANY PROPOSED REVISIONS IN THE SCHEDULED CURB AND GUTTER REPAIR LOCATIONS.

DO NOT SCALE PLANS FOR CONSTRUCTION DIMENSIONS.

IT SHALL BE THE CONTRACTOR'S RESPONSIBILITY TO VERIFY ALL DIMENSIONS AND CONDITIONS EXISTING IN THE FIELD PRIOR TO CONSTRUCTION AND ORDERING OF MATERIALS.

PAINT CURB YELLOW AT FIRE HYDRANTS ACCORDING TO THE APPLICABLE REQUIREMENTS OF SECTION 780 OF THE STANDARD SPECIFICATIONS FOR PAINTED PAVEMENT MARKINGS, EXCEPT THE COST SHALL NOT BE PAID FOR SEPERATELY BUT SHALL BE INCLUDED IN "COMB. CONC. C&G, REMOVAL AND REPLACEMENT."

ADJACENT PARALLEL SIDEWALK, REMOVE AND REPLACE ENTIRE WIDTH OF SIDEWALK JOINT TO JOINT

THE CONTRACTOR SHALL CONTACT THE DISTRICT ONE TRAFFIC CONTROL SUPERVISOR AT (847)705-4470 A MINIMUM OF 72 HOURS IN ADVANCE OF BEGINNING WORK.

ILLINOIS DEPARTMENT OF TRANSPORTATION

INDEX OF SHEETS  
STATE STANDARDS  
GENERAL NOTES

100%  
STATE  
URBAN

100%  
STATE  
URBAN

SUMMARY OF QUANTITIES			CONSTRUCTION TYPE CODE 0021				
CODE NO	ITEM	UNIT	TOTAL QUANTITIES	0021			
21101615	TOPSOIL FURNISH AND PLACE, 4"	SO YD	210	210			
25200110	SODDING, SALT TOLERANT	SO YD	210	210			
40603340	HOT-MIX ASPHALT SURFACE COURSE, MIX "D", N70	TON	80	80			
42001300	PROTECTIVE COAT	SO YD	6055	6055			
42300400	PORTLAND CEMENT CONCRETE DRIVEWAY PAVEMENT, 8 INCH	SO YD	204	204			
42400200	PORTLAND CEMENT CONCRETE SIDEWALK 5 INCH	SO FT	37062	37062			
42400410	PORTLAND CEMENT CONCRETE SIDEWALK 8 INCH	SO FT	7722	7722			
42400800	DETECTABLE WARNINGS	SO FT	855	855			
44000200	DRIVEWAY PAVEMENT REMOVAL	SO YD	204	204			
44000600	SIDEWALK REMOVAL	SO FT	47025	47025			
67100100	MOBILIZATION	L SUM	1	1			
70102620	TRAFFIC CONTROL AND PROTECTION, STANDARD 701501	L SUM	1	1			
70102625	TRAFFIC CONTROL AND PROTECTION, STANDARD 701606	L SUM	1	1			
70102635	TRAFFIC CONTROL AND PROTECTION, STANDARD 701701	L SUM	1	1			
70102640	TRAFFIC CONTROL AND PROTECTION, STANDARD 701801	L SUM	1	1			

SUMMARY OF QUANTITIES			CONSTRUCTION TYPE CODE 0021				
CODE NO	ITEM	UNIT	TOTAL QUANTITIES	0021			
X4401198	HOT-MIX ASPHALT SURFACE REMOVAL, VARIABLE DEPTH	SO YD	476	476			
Z0004562	COMBINATION CONCRETE CURB AND GUTTER REMOVAL AND REPLACEMENT	FOOT	2829	2829			
Z0030850	TEMPORARY INFORMATION SIGNING	SO FT	309	309			

FILE NAME * c:\pw\work\p1604\curry\007236\1169009-Design\p1604	USER NAME * currypw	DESIGNED * -	REVISED * -
		DRAWN * -	REVISED * -
		CHECKED * -	REVISED * -
		DATE * -	REVISED * -

**STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION**

SUMMARY OF QUANTITIES			
SCALE:	SHEET NO.	OF SHEETS	STA. TO STA.

F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
VARIOUS	2012-042-1	COOK	20	3
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT			CONTRACT NO. 60V31	

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	4

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
4043 West 56th Place	3.0	0.5	0.0	4.5	0.0	0.0	0.0		Replace 1 to 2 Feet of Broken Curb
3942 West 57th Place		0.0	0.0	9.0	60.0	0.0	0.0		Replace 2 Sidewalk Squares In Front of Stairs and 2 Courtesy Walk Squares
4049 West 57th Place		0.0	0.0	0.0	180.0	0.0	0.0		Replace 6 Sidewalk Squares
4141 West 57th Place		0.0	0.0	0.0	180.0	0.0	0.0		Replace 6 Sidewalk Squares
4024 West 57th Street	2.0	0.4	0.0	3.0	0.0	0.0	0.0		Replace 2 Feet of Curb
3940 West 58th Place		0.0	0.0	0.0	90.0	0.0	0.0		Replace 3 Cracked Sidewalk Squares
3928 West 58th Street	5.0	0.9	0.5	22.5	0.0	0.0	0.0		Replace Courtesy Walk and 5 Feet of Missing Curb In Front of House
4024 West 58th Street	10.0	1.7	0.0	22.5	0.0	0.0			Install New Courtesy Walk Parallel To Front Walkway Leading To Home In City Parkway
3849 West 59th Place		0.0	0.0	22.5	0.0	0.0			Replace 5 Sinking Courtesy Walk Squares
3944 West 59th Place		0.0	0.0	22.5	300.0	0.0	0.0		Replace 10 Sidewalk Squares and 5 Courtesy Walk Squares
4243 West 59th Street		0.0	0.0	0.0	150.0	0.0	0.0		Replace 5 Sidewalk Squares
4544 West 59th Street		0.0	0.0	22.5	0.0	0.0	0.0		Replace Courtesy Walk
5931 West 59th Street	100.0	16.7	15.0	15.0	0.0	0.0	0.0		Replace 100 Feet of Broken Curb Along Mason Avenue Side of House
3810 West 60th Place		0.0	0.0	0.0	270.0	0.0	0.0	10.0	Install Depressed Curb For Handicapped Accessible Access, and Replace 6 Sidewalk Squares and 4 Courtesy Walk Squares
3929 West 60th Place	6.0	1.0	1.0	0.0	0.0	0.0	0.0		Replace 6 Feet of Cracked Curb In Front of Sewer
6124 West 60th Street		0.0	0.0	22.5	60.0	0.0	0.0		Replace 1 or 2 Sidewalk Squares and Front Courtesy Walk
6348 West 60th Street		0.0	0.0	0.0	30.0	0.0	0.0		Replace Cracked Sidewalk Square
6348 West 60th Street		0.0	0.0	0.0	60.0	0.0	0.0		Replace 2 Cracked Sidewalk Squares
3853 West 61st Place		0.0	0.0	13.5	150.0	0.0	0.0		Replace 5 Sidewalk Squares and 3 Courtesy Walk Squares
3759 West 62nd Place		0.0	0.0	0.0	930.0	0.0	0.0	30.0	Replace 31 Front and Side Sidewalk Squares, 2 Corner ADA Ramps, and 1 Alley ADA Ramp
3804 West 62nd Street		0.0	0.0	45.0	180.0	0.0	0.0		Replace 6 Sidewalk Squares, 3 Courtesy Walk Squares, and 7 Carriage Walk Squares
3629 West 63rd Place		0.0	0.0	22.5	0.0	0.0	0.0		Replace Courtesy Walk
3837 West 63rd Place		0.0	0.0	22.5	150.0	0.0	0.0		Replace 5 Sidewalk Squares and 6 Courtesy Walk Squares
<b>SUB-TOTAL</b>	<b>126.0</b>	<b>21.2</b>	<b>16.5</b>	<b>270.0</b>	<b>2790.0</b>	<b>0.0</b>	<b>0.0</b>	<b>40.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION

**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	5

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
3839 West 63rd Place		0.0	0.0	18.0	150.0	0.0	0.0		Replace 5 Sidewalk Squares and 4 Courtesy Walk Squares
5532 West 63rd Place	5.0	0.9	0.0	22.5	0.0	0.0	0.0		Install Depressed Courtesy Walk/Curb
5743 West 63rd Place		0.0	0.0	0.0	30.0	0.0	0.0		Replace 1 Sidewalk Square
5754 West 63rd Place		0.0	0.0	22.5	0.0	0.0	0.0		Replace Cracked/Pitched Courtesy Walk
5838 West 63rd Place		0.0	0.0	0.0	240.0	0.0	240.0		Replace Entire Alley In Concrete From 5822 to 5846 West 63rd Place
6031 West 63rd Place		0.0	0.0	30.0	0.0	0.0	0.0		Replace Cracked Courtesy Walk and Carriage Walk
3958 West 63rd Street	8.0	1.4	0.0	0.0	48.0	0.0	25.0		Replace 8 Feet of Cracked Curb Just To The East of ADA Ramp on 63rd Street Side
5265 West 63rd Street		0.0	0.0	22.5	180.0	0.0	0.0		Replace 6 Sidewalk Squares and Courtesy Walk
6119 West 63rd Street	30.0	5.0	0.0	0.0	180.0	0.0	0.0		Replace Curb and Sidewalk
5625 West 64th Place		0.0	0.0	0.0	0.0	0.0	120.0		Replace Cracked Concrete In Gangway
5625 West 64th Place		0.0	0.0	0.0	0.0	0.0	0.0		Repair Busted Concrete in Gangway
3705 West 64th Place		0.0	0.0	22.5	210.0	0.0	0.0		Replace 7 Sidewalk Squares and 5 Courtesy Walk Squares
3923 West 64th Place		0.0	0.0	27.0	180.0	0.0	0.0		Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares, and 4 Carriage Walk
5517 West 64th Street		0.0	0.0	22.5	0.0	0.0	0.0		Replace Cracked Courtesy Walk
5639 West 64th Street		0.0	0.0	0.0	0.0	0.0	6.0		Repair Large 2 Foot By 3 Feet Concrete Square In Rear of Home Between Garage
5718 West 64th Street		0.0	0.0	22.5	0.0	0.0	0.0		Replace Damaged Courtesy Walk
5722 West 64th Street		0.0	0.0	0.0	0.0	0.0	240.0		Repair Concrete In Gangway - Between 5722 and 5718 West 64th Street
5736 West 64th Street		0.0	0.0	0.0	144.0	0.0	0.0		Repair Sidewalk in Gangway - West Side of House
5742 West 64th Street		0.0	0.0	22.5	0.0	0.0			Replace Courtesy Walk
5849 West 64th Street				22.5	0.0	0.0			Replace Courtesy Walk
6015 West 64th Street	3.0	0.5	0.5	0.0	0.0	0.0	0.0		Replace 3 Feet of Cracked, Broken Curb
6035 West 64th Street		0.0	0.0	22.5	180.0	0.0	0.0		Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares and 5 Carriage Walk Squares
<b>SUB-TOTAL</b>	<b>43.0</b>	<b>7.3</b>	<b>0.0</b>	<b>232.5</b>	<b>1362.0</b>	<b>0.0</b>	<b>631.0</b>	<b>0.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-1	COOK	20	6

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
6158 West 64th Street		0.0	0.0	22.5	1080.0	0.0			Replace 36 Front and Side Sidewalk Squares and Courtesy Walks
6241 West 64th Street		0.0	1.5	22.5	180.0	0.0	0.0		Replace 6 Sidewalk Squares and Courtesy Walk
3657 West 65th Place	20.0	3.4	0.0	45.0	930.0	0.0	30.0	20.0	Replace 31 Front and Side Sidewalk Squares , 1 Front and 1 Side Courtesy Walk, 1 Side Driveway Apron, and 2 ADA Ramps
3730 West 65th Place		0.0	0.0	0.0	90.0	0.0			Replace 3 Broken Sidewalk Squares
3732 West 65th Place		0.0	0.0	0.0	180.0	0.0			Replace 5 Broken Sidewalk Squares
3736 West 65th Place	2.0	0.4	0.0	3.0	150.0	0.0			Replace 5 Broken Sidewalk Squares and 2 Feet of Missing Curb
3738 West 65th Place		0.0	0.0	9.0	210.0	0.0			Replace 7 Broken Sidewalk Squares and 2 Courtesy Walk Squares
3740 West 65th Place		0.0	0.0	4.5	210.0	0.0			Replace 7 Broken Sidewalk Squares and 1 Courtesy Walk Square
3839 West 65th Place		0.0	0.0	18.0	180.0	0.0			Replace 6 Sidewalk Squares and 4 Courtesy Walk Squares
4525 West 65th Place		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares
North Side of West 65th Street, from Lavergne (5000 West) to Latrobe (5232 West) Avenue		0.0	0.0	0.0	6000.0	4800.0			Install 1800 Feet of Sidewalk, from Lavergne (5000 West) to Latrobe (5232 West) Avenue, North Side of West 65th Street Only
5708 West 65th Street		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares
3701 West 65th Street		0.0	0.0	0.0	0.0	180.0			Replace 6 Cracked Sidewalk Squares In Front of Garage On Lawndale Avenue Side of Home
3832 West 66th Place	8.0	1.4	0.4	9.0	0.0	0.0			Replace 8 Feet of Broken Curb In Front of Courtesy Walk
4501 West 66th Place		0.0	0.0	9.0	720.0	0.0			Replace Entire Sidewalk On Front and Side of Home
4508 West 66th Place	10.0	1.7	1.7	0.0	0.0	0.0			Replace Cracked Curb. There is a standing water issue here.
4509 West 66th Place	20.0	3.4	0.0	9.0	0.0	72.0			Replace 6 Sidewalk Squares and Sunken Driveway Apron
4517 West 66th Place	5.0	0.9	0.0	0.0	150.0	0.0			Replace 5 Sidewalk Squares
3825 West 66th Street		0.0	0.0	18.0	270.0	0.0			Replace 9 Sidewalk Squares and 4 Courtesy Walk Squares
3848 West 66th Street		0.0	0.0	0.0	0.0	270.0			9 Cracked Sidewalk Squares In Gangway Along Side of House Facing Alley
3650 West 67th Place		0.0	0.0	0.0	270.0	0.0			9 Sidewalk Squares
3859 West 67th Place/3858 West 68th Street	40.0	6.7	0.0	4.5	0.0	60.0	40.0	5.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3801 West 68th Place		0.0	0.0	9.0	900.0	120.0	100.0		Replace 34 Front and Side Sidewalk Squares , 3 Driveway Apron Squares, and 2 Side Courtesy Walk Squares
<b>SUB-TOTAL</b>	<b>105.0</b>	<b>17.9</b>	<b>3.6</b>	<b>183.0</b>	<b>11880.0</b>	<b>5502.0</b>	<b>170.0</b>	<b>25.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	7

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
3858 to 3854 West 68th Street	11.0	1.9	1.5	3.0	0.0	0.0			Replace 11 Feet of Broken Curb and Missing Gutter In Front of These Two Addresses
3901 West 68th Place/3900 West 69th Street	40.0	6.7	0.0	0.0	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3816 West 68th Street		0.0	0.0	0.0	120.0	0.0			Replace 4 Sidewalk Squares
3834 West 68th Street		0.0	0.0	13.5	0.0	0.0			Replace 3 Sunken Carriage Walk Squares
3901 West 68th Street/3900 West 68th Place	40.0	6.7	6.7	0.0	0.0	60.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3615 West 69th Place		0.0	0.0	9.0	150.0	0.0			Replace 5 Sidewalk Squares and 2 Courtesy Walk Squares
3828 West 69th Place		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares, and 3 Carriage Walk Squares
3900 West 69th Place	20.0	3.4	0.0	0.0	0.0	30.0		10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3917 West 69th Place		0.0	0.0	13.5	120.0	0.0			Replace 4 Sidewalk Squares and 3 Courtesy Walk Squares
3922 West 69th Place		0.0	0.0	0.0	60.0	0.0			Replace 2 Raised Sidewalk Squares
3928 West 69th Place		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares, and 3 Carriage Walk Squares
3944 West 69th Place	20.0	3.4	3.4	0.0	0.0	30.0		10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3945 West 69th Place	20.0	3.4	3.4	0.0	0.0	60.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3901 West 69th Place/3900 West 70th Street	20.0	3.4	0.0	0.0	0.0	0.0			Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3603 West 69th Street		0.0	0.0	18.0	180.0	0.0			Replace 2 Cracked Courtesy Walk Squares - 69th Street Side
3715 West 69th Street		0.0	0.0	0.0	60.0	0.0			Replace 6 Sidewalk Squares and 5 Courtesy Walk Squares
4035 West 69th Street		0.0	0.0	18.0	30.0	0.0			Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Next To This Address
3740 West 70th Place		0.0	0.0	0.0	60.0	0.0			Replace 6 to 7 Sidewalk Squares and 2 Courtesy Walk Squares
3859 West 70th Place		0.0	0.0	31.5	0.0	0.0			Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3901 West 70th Place	20.0	3.4	0.0	0.0	0.0	0.0	40.0		Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3917 West 70th Place		0.0	0.0	31.5	0.0	0.0			Replace 2 Sinking Courtesy Walk Squares and 8 Carriage Walk Squares
3616 West 70th Street	4.0	0.7	0.7	0.0	0.0	0.0			Replace 4 Feet of Gutter. There is currently a low spot on the gutter.
<b>SUB-TOTAL</b>	<b>195.0</b>	<b>33.0</b>	<b>15.7</b>	<b>183.0</b>	<b>1140.0</b>	<b>240.0</b>	<b>100.0</b>	<b>80.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	8

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
3630 West 70th Street	30.0	5.0	3.4	15.0	0.0	0.0			Replace 30 Feet of Curb and Gutter In Front of Entire Length of Home
3634 West 70th Street	30.0	5.0	3.4	15.0	0.0	0.0			Replace 30 Feet of Curb and Gutter In Front of Entire Length of Home
3901 West 70th Street	20.0	3.4	3.4	0.0	0.0	0.0			Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address (PUT BACK EXISTING LANDSCAPE)
3944 West 70th Street	20.0	3.4	3.4	0.0	0.0	30.0		10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3945 West 70th Street	20.0	3.4	3.4	0.0	0.0	30.0		10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
3803 West Marquette Road/3800 West 67th Place	40.0	6.7	0.0	0.0	0.0	60.0	40.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3859 West Marquette Road/3858 West 67th Place	40.0	6.7	3.4	0.0	0.0	60.0	40.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3901 West Marquette Road/3900 West 67th Place	40.0	6.7	2.0	0.0	0.0	60.0	56.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
3757 West Marquette Road/6715 South Hamlin Avenue	40.0	6.7	3.4	0.0	0.0	60.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
4025 West Marquette Road/6715 South Komensky Avenue	40.0	6.7	3.4	0.0	0.0	60.0	30.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6048 South Austin Avenue		0.0	0.0	0.0	30.0	0.0			Replace 1 Sidewalk Square
6052 South Austin Avenue	10.0	1.7	1.7	0.0	0.0	0.0			Repair Curb and Gutter In Front of This Address
6419 South Austin Avenue	30.0	5.0	1.7	30.0	0.0	0.0			Replace Courtesy Walk, and 30 Feet of Curb and Gutter in front of home. It is currently too high and too deep, and is causing a standing water issue.
6423 South Austin Avenue	0.0	0.0	0.0	0.0	60.0	0.0			Repair Caving-In Cement/Concrete In Front of This Address
6435 South Austin Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Cracked Sidewalk Squares and 2 ADA Ramps
7200 South Avers	7.0	1.2	1.2	0.0	0.0	0.0			Replace 7 Feet of Missing Gutter on Either Side of Adjacent Sewer Catch Basin on 72nd Street Side
7158 South Avers Avenue/7159 South Springfield Avenue	40.0	6.7	0.0	0.0	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Avers Avenue/7201 South Springfield Avenue	40.0	6.7	6.7	0.0	0.0	60.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7114 South Central Park Avenue	20.0	3.4	0.0	0.0	60.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Next To This Address
7158 South Central Park Avenue/7159 South Millard Avenue	40.0	6.7	6.7	0.0	0.0	60.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Central Park Avenue/7201 South Millard Avenue	40.0	6.7	0.0	0.0	0.0	60.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6545 South Hamlin Avenue	20.0	3.4	0.0	60.0	1200.0	0.0	30.0		Replace 40 Front and Side Sidewalk Squares, 2 Front and 1 Side Courtesy Walks, 21 Carriage Walk Squares, and 1 Side Driveway Apron
<b>SUB-TOTAL</b>	<b>567.0</b>	<b>95.2</b>	<b>47.2</b>	<b>120.0</b>	<b>1530.0</b>	<b>600.0</b>	<b>256.0</b>	<b>220.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	9

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
7158 South Hamlin Avenue/7159 South Avers Avenue	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Hamlin Avenue/7201 South Avers Avenue	40.0	6.7	3.4	0.0	0.0	120.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
5609 South Karlov Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Sidewalk Squares
6001 South Karlov Avenue		0.0	0.0	22.5	900.0	180.0			Replace 36 Front and Side Sidewalk Squares and Courtesy Walks
6043 South Karlov Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Sidewalk Squares
6412 South Karlov Avenue		0.0	0.0	36.0	180.0	0.0			Replace 6 Sidewalk Square, Courtesy Walk, and Carriage Walk
6754 South Karlov Avenue		0.0	0.0	31.5	0.0	0.0			Replace 7 Courtesy/Carriage Walk Squares
6800 South Karlov Avenue		0.0	0.0	0.0	210.0	0.0			Replace 7 Cracked Sidewalk Squares - 68th Street Side
6813 South Karlov Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6813 South Karlov Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
6858 South Karlov Avenue		0.0	0.0	9.0	180.0	0.0			Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind This Address
6914 South Karlov Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Cracked, Broken Sidewalk Squares
6918 South Karlov Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Cracked, Broken Sidewalk Squares
6325 to 6327 South Keating Avenue	11.0	1.9	0.9	9.0	180.0	0.0			Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares, and 11 Feet of Curb
6339 South Keating Avenue		0.0	0.0	9.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
6428 South Keating Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Cracked Sidewalk Squares
6558 South Keating Avenue	100.0	16.7	13.4	30.0	0.0	0.0			Replace 100 Feet of Broken, Cracked, and Low Curb and Gutter on the 66th Street of This Address - North Side of Street
6600 South Keating Avenue	100.0	16.7	13.4	30.0	0.0	0.0			Replace 100 Feet of Missing Curb and Gutter on the 66th Street of This Address - South Side of Street
7834 South Keating Avenue	20.0	3.4	1.7	0.0	0.0	120.0	9.0		Replace 4 Broken Sidewalk Squares and Driveway Apron
5559 South Kedvale Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Missing Sidewalk Squares on 56th Street Side
5800 South Keeler Avenue		0.0	0.0	22.5	900.0	180.0			Replace 36 Front and Side Sidewalk Squares and Courtesy Walks
5939 South Keeler Avenue		0.0	0.0	9.0	270.0	0.0			Replace 6 to 9 Sidewalk Squares and 2 Courtesy Walk Squares
<b>SUB-TOTAL</b>	<b>311.0</b>	<b>52.1</b>	<b>32.8</b>	<b>231.0</b>	<b>3960.0</b>	<b>600.0</b>	<b>9.0</b>	<b>40.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	10

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
5959 South Keeler Avenue		0.0	0.0	0.0	30.0	0.0			Replace 1 Square with Graffiti Etched In Cement
6040 South Keeler Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6315 South Keeler Avenue		0.0	0.0	0.0	90.0	0.0			Replace 3 Sidewalk Squares
6551 South Keeler Avenue		0.0	0.0	0.0	90.0	0.0			Replace Cracked, Broken Sidewalk Squares
6726 South Keeler Avenue		0.0	0.0	27.0	180.0	0.0			Replace 6 Sidewalk Squares, 2 Front Courtesy Walk Squares, and 4 Courtesy Walk Squares Leading To Gangway
5749 South Kenneth Avenue	1.0	0.2	0.0	1.5	0.0	0.0			Replace 1 Foot of Cracked Curb Adjacent To Curblin Sewer
5750 South Kenneth Avenue	5.0	0.9	0.0	7.5	0.0	0.0			Replace 4 to 5 Feet of Missing Curb and Carriage Walk
5805 South Kenneth Avenue		0.0	0.0	0.0	90.0	0.0			Replace Cracked Sidewalk Squares
5809 South Kenneth Avenue	30.0	5.0	0.0	45.0	0.0	0.0			Replace 30 Feet of Curb and Gutter In Front of Home. "Dropped Curb" is preventing water from properly draining, and is causing standing water on street.
6023 South Kenneth Avenue	12.0	2.0	0.4	15.0	180.0	0.0			replace 12 feet of curb and gutter
6200 South Kenneth Avenue		0.0	0.0	0.0	120.0	0.0			Replace 4 Sidewalk Squares
6729 South Kenneth Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0		Repair 20 to 25 Feet of Broken Gutter In Front of Driveway Entrance
5601 South Kilbourn Avenue		0.0	0.0	0.0	30.0	0.0			Replace 1 Sidewalk Square
5901 to 5905 South Kilbourn Avenue		0.0	0.0	0.0	30.0	0.0			Replace 1 Sidewalk Square Closer to 5905 South Kilbourn Avenue
5942 South Kilbourn Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
5946 South Kilbourn Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6501 South Kilbourn Avenue		0.0	0.0	0.0	150.0	0.0			Replace Cracked, Broken Sidewalk Squares
6559 South Kilbourn Avenue	20.0	3.4	0.0	0.0	60.0	0.0	30.0		Replace Side Driveway Apron & Adjacent Curb Around Perimeter of Driveway Apron Facing 66th Street
6758 South Kilbourn Avenue		0.0	0.0	0.0	600.0	0.0			Install 95 to 100 Feet of Missing Sidewalk on 68th Street Side of Home
5946 South Kildare Avenue		0.0	0.0	45.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walks
6058 South Kilpatrick Avenue	20.0	3.4	0.0	22.5	0.0	0.0	60.0		Replace Side Concrete Driveway Apron Facing 61st Street Side, Including Driveway Apron Curb and Gutter. There is currently a standing water issue here.
6125 South Kilpatrick Avenue		0.0	0.0	31.5	180.0	0.0			Replace 6 Sidewalk Squares, 3 Courtesy Walk Squares, and 4 Carriage Walk Squares
<b>SUB-TOTAL</b>	<b>108.0</b>	<b>18.3</b>	<b>0.4</b>	<b>262.5</b>	<b>2550.0</b>	<b>0.0</b>	<b>120.0</b>	<b>0.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	11

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
6342 South Kilpatrick Avenue		0.0	0.0	9.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
7759 South Kilpatrick Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0		Replace Missing Curb and Gutter on 78th Street Side of Home Directly In Front of Driveway Apron
6058 South Kilpatrick Avenue/6059 South Keating Avenue	40.0	6.7	0.0	22.5	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6122 South Knox Avenue		0.0	0.0	9.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
6459 South Knox Avenue	100.0	16.7	15.4	12.0	0.0	0.0			Replace 100 Feet of Curb and Gutter on the 65th Street of This Address, Between Knox Avenue and Train Tracks - North Side of Street
6500 South Knox Avenue	100.0	16.7	15.4	12.0	0.0	0.0			Replace 100 Feet of Curb and Gutter on the 65th Street of This Address - South Side of Street - Standing Water Issue Here.
6501 South Knox Avenue	100.0	16.7	15.4	12.0	0.0	0.0			Replace 100 Feet of Curb and Gutter on the 65th Street of This Address, Between Knox Avenue and Train Tracks - South Side of Street
6624 South Knox Avenue		0.0	0.0	22.5	210.0	0.0			Replace 7 Sidewalk Squares and 4 Courtesy Walk Squares
5524 South Kolin Avenue		0.0	0.0	9.0	0.0	0.0			Replace 2 Sinking Carriage Walk Squares Towards the South End - Adjacent to Courtesy Walk
6401 South Kolin Avenue		0.0	0.0	0.0	180.0	0.0			Replace 2 to 6 Sidewalk Squares
6617 South Kolin Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6823 South Kolin Avenue		0.0	0.0	0.0	180.0	0.0			Replace 3 to 9 Sidewalk Squares
6131 South Kolmar Avenue		0.0	0.0	4.5	60.0	0.0			Replace 6 Broken Sidewalk Squares
6141 South Kolmar Avenue		0.0	0.0	4.5	0.0	0.0			Replace 1 Sidewalk Square with Crack Closest To Home, 1 Sidewalk Square With Bird Foot Prints, and 1 Courtesy Walk Square with Crack
6715 South Kolmar Avenue	8.0	1.4	1.0	3.0	0.0	0.0			Replace 8 Feet of Broken Curb Closest To Home, Adjacent to ADA Ramp
7808 South Kolmar Avenue		0.0	0.0	0.0	180.0	0.0			Replace 5 or 6 Sidewalk Squares
6517 South Komensky Avenue		0.0	0.0	18.0	180.0	0.0			Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares , and 2 Carriage Walk Squares
6606 South Komensky Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Cracked Sidewalk Squares
6725 South Komensky Avenue		0.0	0.0	27.0	150.0	0.0			Replace 5 Sidewalk Squares, 2 Courtesy Walk Squares, and 4 Carriage Walk Squares
6843 South Komensky Avenue		0.0	0.0	0.0	210.0	0.0			Replace 7 Cracked, Broken Sidewalk Squares
6149 South Kostner Avenue		0.0	0.0	0.0	120.0	0.0			Replace 3 or 4 Sidewalk Squares
6340 South Kostner Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares
<b>SUB-TOTAL</b>	<b>368.0</b>	<b>61.6</b>	<b>47.2</b>	<b>187.5</b>	<b>2250.0</b>	<b>60.0</b>	<b>90.0</b>	<b>20.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	12

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
6340 South Kostner Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares
6542 South Kostner Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6348 South La Crosse Avenue		0.0	0.0	0.0	30.0	0.0		10.0	Replace ADA Ramp on the SouthWest Corner of 6300 South La Crosse Avenue - Currently gravel next to fire hydrant
6349 South La Crosse Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Sidewalk Squares
6351 South La Crosse Avenue		0.0	0.0	0.0	60.0	0.0			Replace Sidewalk Squares Impacted By The Sewer
6459 South Lamont Avenue		0.0	0.0	0.0	90.0	0.0			Replace 3 Raised Sidewalk Squares on 65th Street Side of House
6459 South Laporte Avenue/6458 South Lamont Avenue	40.0	6.7	3.4	0.0	0.0	60.0	30.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron, Facing 65th Street
6418 South Lawler Avenue		0.0	0.0	0.0	30.0	0.0		10.0	Replace 1 Sunken Sidewalk Square Just Inside PERSONAL PROPERTY - Has Buffalo Box
6751 South Lawndale Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Cracked, Broken Sidewalk Squares
6751 South Lawndale Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Cracked, Broken Sidewalk Squares
7158 South Lawndale Avenue/7159 South Ridgeway Avenue	40.0	6.7	0.0	0.0	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Lawndale Avenue/7201 South Ridgeway Avenue	40.0	6.7	3.4	0.0	0.0	60.0	30.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
5931 South Major Avenue		0.0	0.0	0.0	60.0	0.0			Replace 2 Sidewalk Squares
5936 South Major Avenue		0.0	0.0	0.0	30.0	0.0			Replace 1 Sidewalk Square
6000 South Major Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0		Replace Side Concrete Driveway Apron Facing 60th Street Side
6022 South Major Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6025 South Mason Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares , and 3 Carriage Walk Squares
6229 South Mason Avenue		0.0	0.0	45.0	0.0	0.0			Install New Carriage and Courtesy Walk
6001 South Massasoit Avenue	20.0	3.4	0.0	0.0	0.0	0.0	30.0		Replace Side Concrete Driveway Apron Facing 60th Street Side
6001 South Massasoit Avenue/6000 South Major Avenue	40.0	6.7	0.0	0.0	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
5914 South Mayfield Avenue	20.0	3.4	3.4	22.5	30.0	30.0		10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps At This Address
5915 South Mayfield Avenue	20.0	3.4	0.0	0.0	0.0	30.0	30.0	10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps At This Address
<b>SUB-TOTAL</b>	<b>240.0</b>	<b>40.4</b>	<b>10.2</b>	<b>135.0</b>	<b>1470.0</b>	<b>300.0</b>	<b>270.0</b>	<b>120.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	13

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
6039 South Mayfield Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6105 South Mayfield Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6110 South Mayfield Avenue	3.0	0.5	0.4	9.0	0.0	0.0			Replace 3 Feet of Curb, 3 Feet of Carriage Walk, and 1 Courtesy Walk Square
6204 South Mayfield Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6228 South Mayfield Avenue	10.0	1.7	1.4	15.0	0.0	0.0			Replace Curb In Front of House and 10 Feet of Courtesy Walk
6234 to 6238 South Mayfield Avenue	7.0	1.2	0.9	3.0	0.0	0.0			Replace 7 Feet of Broken Curb
6105 South McVicker Avenue	10.0	1.7	1.4	3.0	0.0	0.0			Replace Curb In Front of House
6235 South McVicker Avenue	10.0	1.7	1.4	3.0	0.0	0.0			Replace and Raise Curb
6136 South Meade Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares, 2 Courtesy Walk Squares, and 3 Carriage Walk Squares
5751 South Melvina Avenue		0.0	0.0	0.0	90.0	0.0			Replace 3 Sidewalk Squares Broken from Tree
6035 South Merrimac Avenue	10.0	1.7	1.4	3.0	0.0	0.0			Replace Damaged Curb
7159 South Millard Avenue		0.0	0.0	13.5	900.0	120.0			Replace 34 Front and Side Sidewalk Squares and 3 Side Courtesy Walk Squares
7158 South Millard Avenue/7159 South Lawndale Avenue	40.0	6.7	0.0	0.0	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Millard Avenue/7201 South Lawndale Avenue	40.0	6.7	3.4	0.0	0.0	60.0	30.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6040 South Monitor Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6028 South Moody Avenue	5.0	0.9	0.9	0.0	0.0	0.0			Raise Curb and Sewer Catch Basin
6241 South Moody Avenue		0.0	0.0	9.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
6109 South Nashville Avenue		0.0	0.0	0.0	0.0	0.0	25.0		Replace Concrete Behind House In Alley. Badly damaged and cracked from prior sewer cave-in
6156 to 6158 South Nashville Avenue		0.0	0.0	0.0	60.0	0.0			Replace Sidewalk That Is Collapsing and Is Causing a Serious Trip Hazard
5830 South New England Avenue		0.0	0.0	22.5	240.0	0.0			Replace 8 Sidewalk Squares and Entire Courtesy Walk
6019 South Parkside Avenue		0.0	0.0	22.5	0.0	0.0			Replace Service Walk/Courtesy Walk
6028 South Parkside Avenue		0.0	0.0	22.5	0.0	0.0			Replace Courtesy Walk
<b>SUB-TOTAL</b>	<b>135.0</b>	<b>22.8</b>	<b>11.2</b>	<b>238.5</b>	<b>2370.0</b>	<b>240.0</b>	<b>115.0</b>	<b>40.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	14

CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
6158 South Parkside Avenue	15.0	2.5	1.7	7.5	0.0	0.0			Replace 15 Feet of Broken Curb on 62nd Street Side of House
6725 South Pulask Road/3944 West 67th Place	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6825 South Pulask Road/3944 West 68th Place	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6735 South Pulask Road/3945 West 67th Place	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6835 South Pulask Road/3945 West 68th Place	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
5900 South Pulaski Road	40.0	6.7	0.0	0.0	120.0	0.0		10.0	Replace Cracked ADA ramp In Front of 7-Eleven - SouthWest Corner of 5900 South Pulaski Road
6735 South Pulaski Road/3944 West 68th Street	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6805 South Pulaski Road/3945 West 68th Street	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6750 South Pulaski Road/6759 South Komensky Avenue	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7115 South Ridgeway Avenue	20.0	3.4	0.0	0.0	120.0	0.0		10.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Next To This Address
7158 South Ridgeway Avenue/7159 South Hamlin Avenue	15.0	2.5	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Ridgeway Avenue/7201 South Hamlin Avenue	40.0	6.7	0.0	0.0	240.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
6230 South Rutherford Avenue	10.0	1.7	0.0	15.0	0.0	0.0			Replace Collapsed Curb and Courtesy Walk In Front of House
6234 South Rutherford Avenue	10.0	1.7	0.0	15.0	0.0	0.0			Replace Collapsed Curb and Courtesy Walk In Front of House
6238 South Rutherford Avenue	10.0	1.7	0.0	15.0	0.0	0.0			Replace Collapsed Curb and Courtesy Walk In Front of House
5858 South Sayre Avenue		0.0	0.0	22.5	1020.0	60.0			Replace 36 Front and Side Sidewalk Squares and Courtesy Walks
7225 South Springfield Avenue	8.0	1.4	0.0	12.0	0.0	0.0			Replace 8 Feet of Broken Curb and Missing Gutter In Front of House
7237 South Springfield Avenue		0.0	0.0	0.0	0.0	0.0	16.0		Repair 4 Foot by 4 Foot Concrete Alley Hole Directly In Front of Asphalt Speed Humps on 73rd Street/Alley Side of Home
6732 South Springfield Avenue/3900 West 68th Street	40.0	6.7	0.0	0.0	0.0	60.0	60.0	20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7158 South Springfield Avenue/7159 South Harding Avenue	40.0	6.7	6.7	0.0	60.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
7200 South Springfield Avenue/7201 South Harding Avenue	40.0	6.7	6.7	0.0	60.0	0.0		20.0	Repair Alley Return/Apron In its Entirety With Concrete and ADA Ramps Behind These Two Listed Addresses That Share This Alley Return/Apron
5724 South Tripp	60.0	10.0	9.5	4.5	0.0	0.0			Replace Broken Sidewalk Squares
<b>SUB-TOTAL</b>	<b>628.0</b>	<b>105.3</b>	<b>24.6</b>	<b>91.5</b>	<b>3540.0</b>	<b>120.0</b>	<b>76.0</b>	<b>260.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

<b>ROUTE</b>	<b>SECTION</b>	<b>COUNTY</b>	<b>TOTAL SHEETS</b>	<b>SHEET NUMBER</b>
VARIOUS	2012-042-I	COOK	20	15


CONTRACT: 60V31

LOCATION	COMB. CONC. C & G R&R (LF)	HMA SURF R&R VARIABLE DEPTH (SQYD)	SALT TOLERANT SODDING (SQYD)	SIDEWALK 5" R&R (SQFT) 18" CARRIAGE/ COURTESY	SIDEWALK 5" R&R (SQFT) 6' PARALLEL	SIDEWALK 8" R&R (SQFT) 6' PARALLEL	DRIVEWAY 8" R&R (SQFT)	DETECTABLE WARNINGS (ADA RAMPS) (SQFT)	REMARKS
5623 South Tripp Avenue		0.0	0.0	0.0	30.0	0.0			Replace 1 Sidewalk Square
5701 South Tripp Avenue		0.0	0.0	0.0	90.0	0.0			Replace 3 Sidewalk Squares
5741 South Tripp Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares
5742 South Tripp Avenue		0.0	0.0	9.0	180.0	0.0			Replace 6 Sidewalk Squares and 2 Courtesy Walk Squares
6019 South Tripp Avenue	3.0	0.5	0.5	0.0	0.0	0.0			Replace Cracked Curb In Front of Home
6034 South Tripp Avenue		0.0	0.0	30.0	0.0	0.0			Replace Busted Courtesy Walk and Carriage Walk
6112 South Tripp Avenue		0.0	0.0	22.5	180.0	0.0			Replace 6 Sidewalk Squares and Courtesy Walk
6157 South Tripp Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 Sidewalk Squares
6201 South Tripp Avenue		0.0	0.0	45.0	1020.0	60.0			Replace 36 Front and Side Sidewalk Squares and Courtesy Walks
6341 South Tripp Avenue		0.0	0.0	0.0	120.0	0.0			Replace Broken Sidewalk Squares
6437 South Tripp Avenue		0.0	0.0	0.0	180.0	0.0			Replace 6 or 7 Sidewalk Squares
6443 South Tripp Avenue		0.0	0.0	0.0	60.0	0.0		10.0	Replace 2 Sidewalk Squares
<b>SUB-TOTAL</b>	<b>3.0</b>	<b>0.5</b>	<b>0.5</b>	<b>106.5</b>	<b>2220.0</b>	<b>60.0</b>	<b>0.0</b>	<b>10.0</b>	
<b>TOTAL</b>	<b>2829.0</b>	<b>475.6</b>	<b>209.9</b>	<b>2241.0</b>	<b>37062.0</b>	<b>7722.0</b>	<b>1837.0</b>	<b>855.0</b>	

ILLINOIS DEPARTMENT OF TRANSPORTATION  
**SCHEDULE OF QUANTITIES**

ROUTE	SECTION	COUNTY	TOTAL SHEETS	SHEET NUMBER
VARIOUS	2012-042-I	COOK	20	16

CONTRACT NO.: 60V31

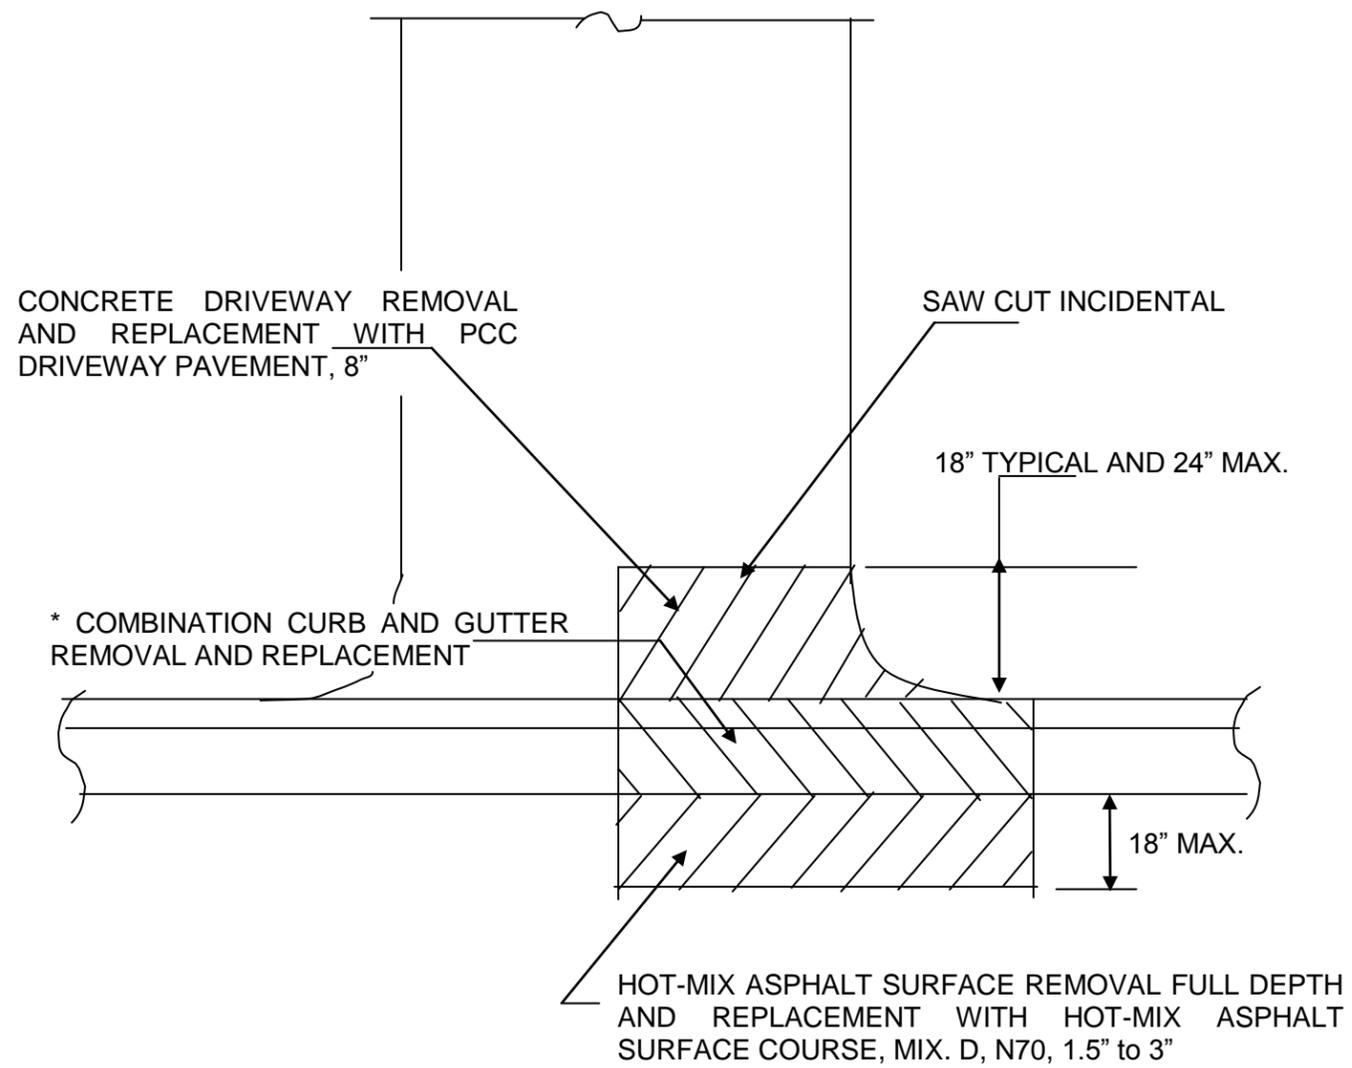


PLAN VIEW

\* PROPOSED DEPRESSED CURB AND EXACT LENGTH SHALL BE DETERMINED IN THE FIELD BY THE ENGINEER (TYPICAL)

ILLINOIS DEPARTMENT OF TRANSPORTATION

**DETAIL: CONCRETE DRIVEWAY**

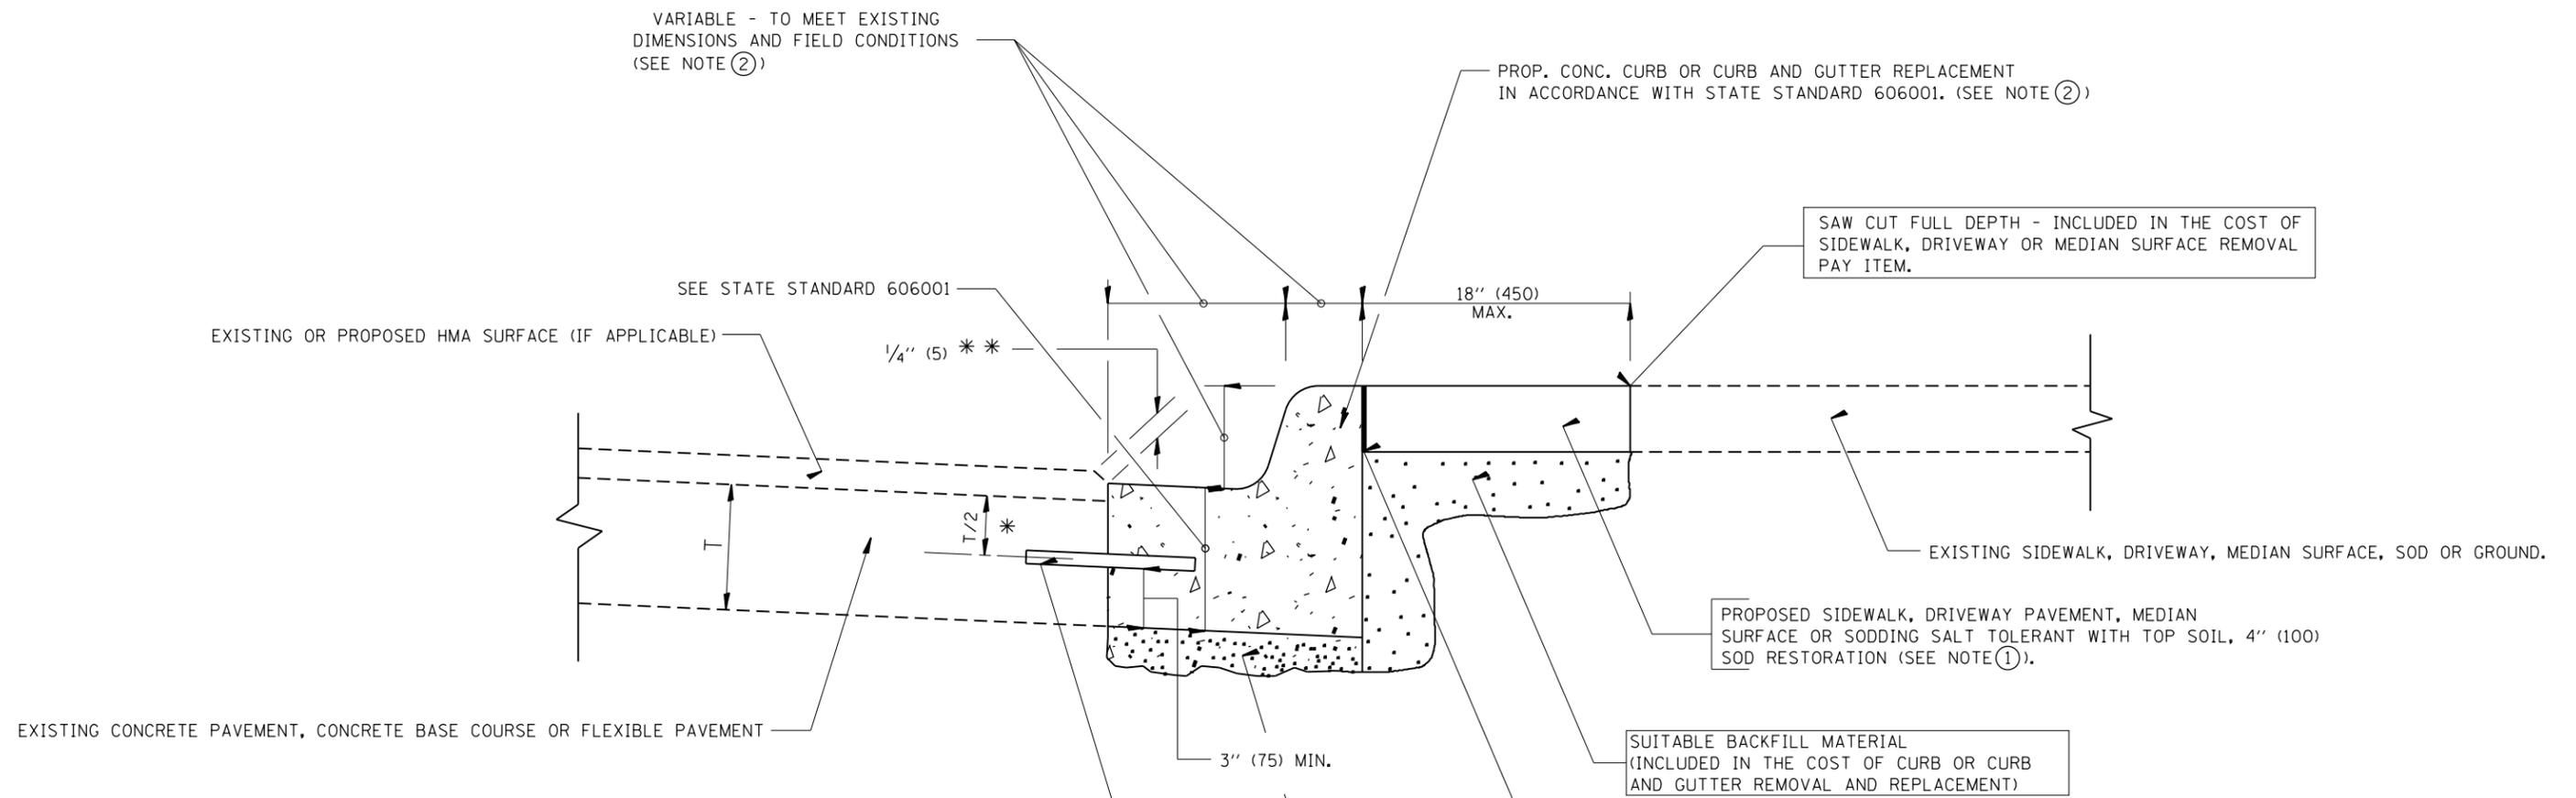

- \* 3" (75) MINIMUM FROM TOP AND BOTTOM OF THE CONCRETE PAVEMENT OR BASE COURSE.
  - \*\* IF THE FINAL SURFACE OF THE PAVEMENT IS CONCRETE, THE GUTTER IS TO BE FLUSH WITH THE PAVEMENT.
- NOTE: ① SIDEWALK, DRIVEWAY PAVEMENT OR MEDIAN SURFACE SHALL BE SIMILAR TO THE MATERIAL BEING REMOVED AND WILL BE PAID FOR SEPARATELY.
- SODDING, SALT TOLERANT AND TOP SOIL, FURNISH AND PLACE 4" WILL BE PAID FOR SEPARATELY.
- ② FERTILIZER FOR THE PLACEMENT OF THE SOD IS NOT REQUIRED
  - ③ CURB OR CURB AND GUTTER REPLACEMENT SHALL MATCH THE SHAPE OF THE EXISTING CURB OR CURB AND GUTTER UNLESS OTHERWISE SPECIFIED.
  - ④ FOR CURB OR CURB AND GUTTER REMOVAL AND REPLACEMENT ADJACENT TO FLEXIBLE PAVEMENT DELETE EPOXY COATED TIE BARS.
  - ⑤ LONGITUDINAL BARS, IF ENCOUNTERED IN THE EXISTING CURB OR CURB AND GUTTER, ARE NOT TO BE REPLACED. CUTTING AND REMOVING LONGITUDINAL BARS SHALL BE INCLUDED IN THE COST OF CURB OR CURB AND GUTTER REMOVAL AND REPLACEMENT.
  - ⑥ THE COST OF HMA SURFACE REMOVAL IN THE EXISTING GUTTER FLAG SHALL BE INCLUDED IN THE COST OF THE CURB AND GUTTER REMOVAL AND REPLACEMENT.
  - ⑦ THE REMOVAL AND REPLACEMENT OF THE EXISTING CURB OR CURB AND GUTTER SHALL BE DONE IN ACCORDANCE WITH THE APPLICABLE PORTIONS OF SECTION 440 AND 606 OF THE STANDARD SPECIFICATIONS.
  - ⑧ THE LOCATIONS OF REMOVAL AND REPLACEMENT OF EXISTING CURB OR CURB AND GUTTER SHALL BE DETERMINED BY THE RESIDENT ENGINEER AT THE TIME OF CONSTRUCTION.


- PROPOSED 3/4" (20) PREFORMED EXPANSION JOINT AT CONCRETE SIDEWALKS, DRIVEWAYS, AND MEDIANS. (INCLUDED IN THE COST OF CURB OR CURB AND GUTTER REMOVAL AND REPLACEMENT.)
- UNSUITABLE SUB-BASE MATERIAL TO BE REMOVED, IF DIRECTED BY THE ENGINEER, SHALL BE REPLACED WITH EITHER SUB-BASE GRANULAR MATERIAL, TYPE B OR ADDITIONAL THICKNESS OF CONCRETE.
- REMOVAL AND REPLACEMENT 4" (100) OR LESS IS INCLUDED IN THE COST OF CURB OR CURB AND GUTTER REMOVAL AND REPLACEMENT.
- REMOVAL AND REPLACEMENT IN EXCESS OF 4" (100) WILL BE PAID FOR IN ACCORDANCE WITH ARTICLE 109.04 OF THE STANDARD SPECIFICATIONS.
- PROPOSED #6 (20) EPOXY COATED TIE BARS 24" (600) LONG AT 24" (600) CENTERS WILL NOT BE PAID FOR SEPARATELY. DELETE EPOXY COATED TIE BARS IF EXISTING TIE BARS ARE USABLE AS DETERMINED BY THE ENGINEER. (SEE NOTE ③).

**BASIS OF PAYMENT:**  
 THIS WORK WILL BE PAID FOR AT THE CONTRACT UNIT PRICE PER FOOT (METER) FOR "CURB REMOVAL AND REPLACEMENT" OR "COMBINATION CONCRETE CURB AND GUTTER REMOVAL AND REPLACEMENT".

# CURB OR CURB AND GUTTER REMOVAL AND REPLACEMENT

ALL DIMENSIONS ARE IN INCHES (MILLIMETERS) UNLESS OTHERWISE SHOWN.


FILE NAME =	USER NAME = currywaw	DESIGNED - A. HOUSEH	REVISED - R. SHAH 10-03-96	<b>STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION</b>	<b>CURB OR CURB AND GUTTER REMOVAL AND REPLACEMENT</b>	F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.	
		DRAWN -	REVISED - A. ABBAS 03-21-97			VARIOUS	2012-042-1	COOK	20	17	
		PLOT SCALE = 5000.0000 ' / in.	CHECKED -			REVISED - M. GOMEZ 01-22-01	BD600-06 (BD-24)		CONTRACT NO. 60V31		
		PLOT DATE = 6/15/2012	DATE - 03-11-94			REVISED - R. BORO 12-15-09	SCALE: NONE	SHEET NO. 1 OF 1 SHEETS	STA.	TO STA.	
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT											

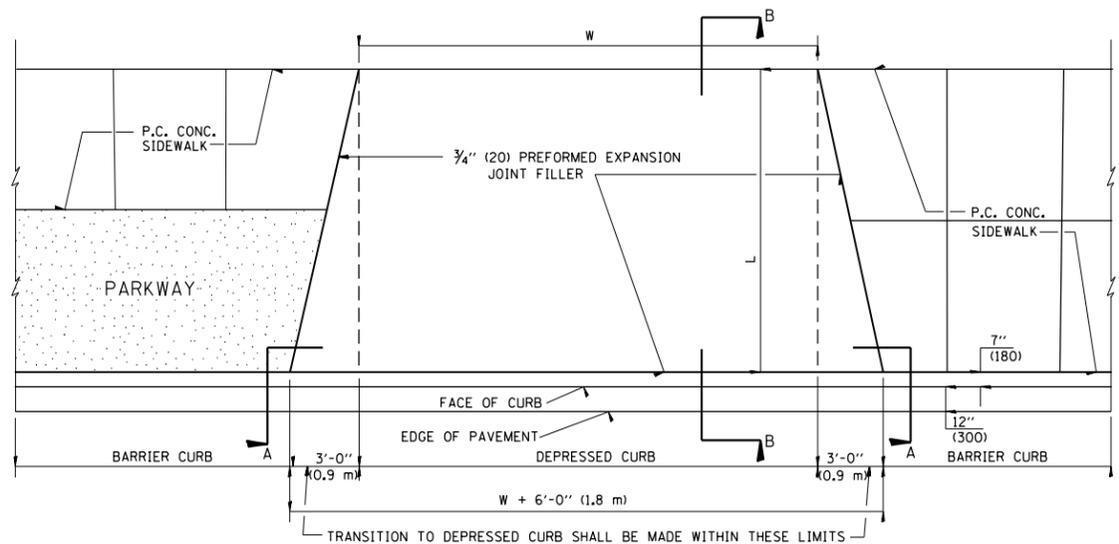


PLAN VIEW

NOTES:

1. EXPANSION JOINTS SHALL BE CONSTRUCTED AS SHOWN ON THE DETAILS FOR P.C.C. SIDEWALK.
2. THE CURB BETWEEN ADJACENT DRIVEWAYS SHALL BE FULL HEIGHT FOR A DISTANCE OF AT LEAST FOUR FEET (1.2 METERS)
3. P.C. CONCRETE DRIVEWAYS SHALL BE CONSTRUCTED AT LOCATIONS SHOWN ON THE PLANS OR AS DIRECTED BY THE ENGINEER.
4. 3/4" (20) PREFORMED EXPANSION JOINTS WILL NOT BE PAID FOR SEPARATELY BUT SHALL BE CONSIDERED INCIDENTAL TO P.C.C. DRIVEWAY PAVEMENT 8" (200).
5. COMBINATION CONC. CURB AND GUTTER SHALL BE MEASURED STRAIGHT ACROSS THE DRIVEWAY. NO ADDITIONAL COMPENSATION WILL BE ALLOWED FOR THE TRANSITION CURB AND GUTTER.

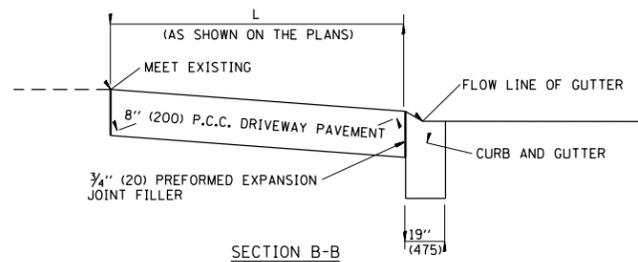


SECTION B-B

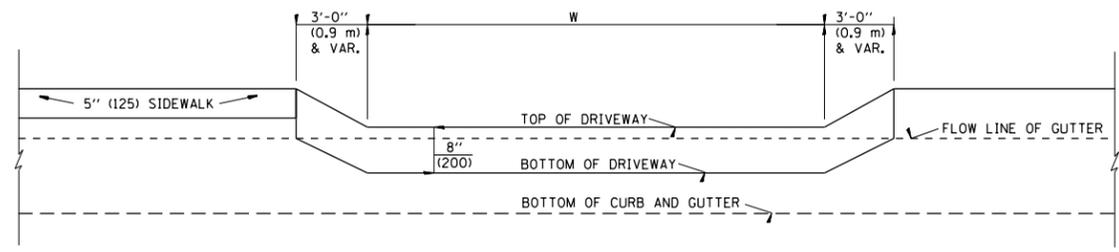


SECTION A-A

P.C.C. DRIVEWAY PAVEMENT DETAIL

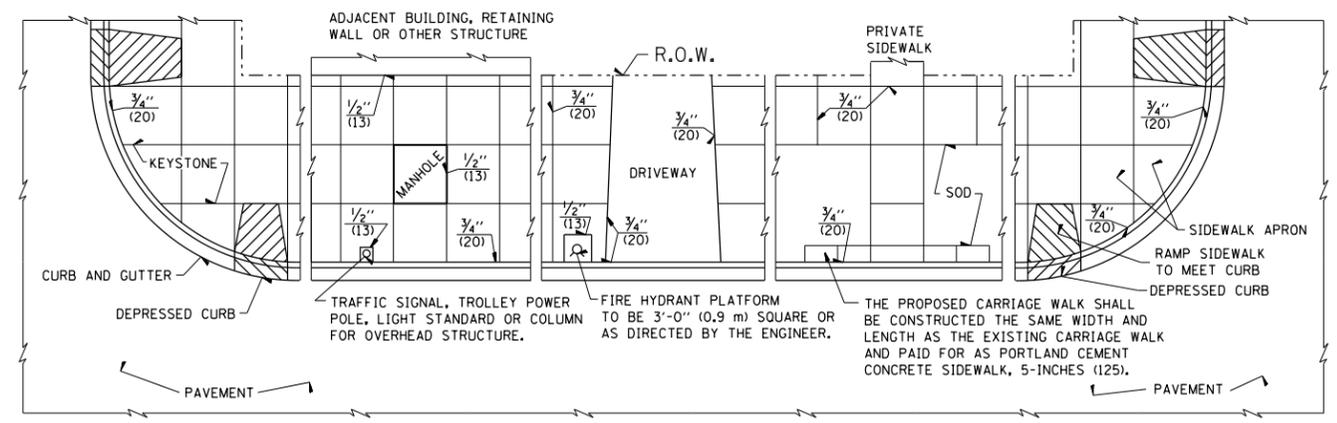

NOTES:



1. ONE-HALF INCH THICK EXPANSION JOINTS SHALL BE PLACED BETWEEN THE SIDEWALK AND ALL STRUCTURES SUCH AS LIGHT STANDARDS, TRAFFIC LIGHT STANDARDS, MANHOLES, WHICH EXTEND THROUGH THE SIDEWALK.
2. 3/4" (20) THICK EXPANSION JOINTS SHALL BE PLACED AT INTERVALS OF NOT MORE THAN 100 FEET (30 METERS) IN THE SIDEWALK, WHERE THE SIDEWALK IS CONSTRUCTED ADJACENT TO PAVEMENT OR CURB HAVING EXPANSION JOINTS, THE EXPANSION JOINTS IN THE SIDEWALK SHALL BE PLACED OPPOSITE THE EXISTING EXPANSION JOINTS AS NEARLY AS PRACTICABLE. EXPANSION JOINTS SHALL ALSO BE PLACED WHERE THE SIDEWALK ABUTS EXISTING SIDEWALKS, BETWEEN DRIVEWAY PAVEMENT AND SIDEWALK, AND BETWEEN SIDEWALK AND CURBS WHERE THE SIDEWALK ABUTS A CURB.

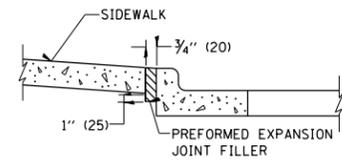

SLOPE FOR SIDEWALK  
1" (25) IN 3'-0" (0.9 m) IN CHICAGO

PORTLAND CEMENT CONCRETE SIDEWALK DETAILS

NOTES: NO EXTRA COMPENSATION SHALL BE ALLOWED FOR THE GUTTER FLARE

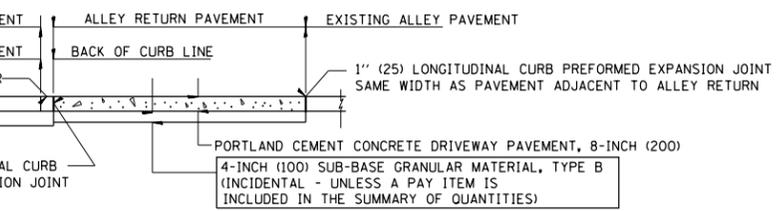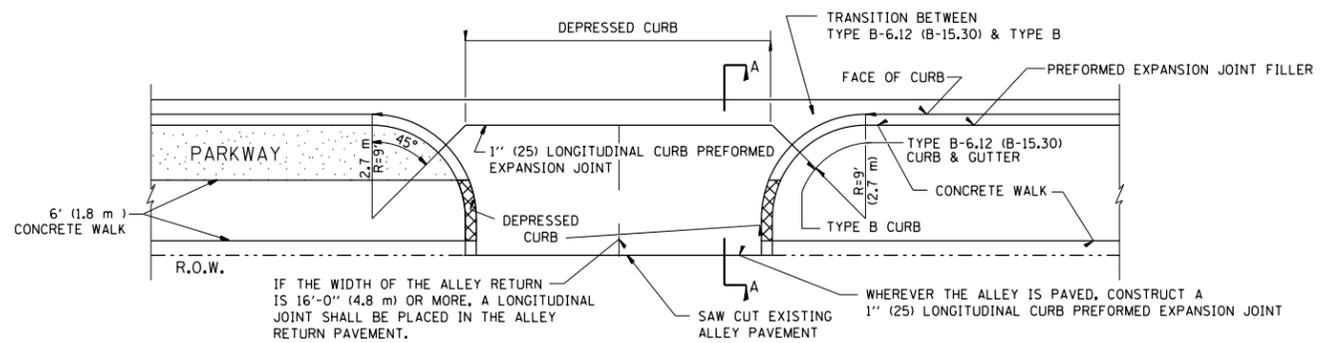

SECTION A-A

ALLEY RETURN DETAIL

ALL DIMENSIONS ARE IN INCHES (MILLIMETERS) UNLESS OTHERWISE SHOWN


FILE NAME =	USER NAME = curryaw	DESIGNED - M. DE YONG	REVISED -
et:\pw\work\p\id\curryaw\d0172364\PI69009-Design.dgn		DRAWN -	REVISED -
	PLOT SCALE = 5000.0000 / in.	CHECKED -	REVISED -
	PLOT DATE = 6/15/2012	DATE - 06-13-90	REVISED -

STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

CITY OF CHICAGO  
DETAILS FOR P.C. CONCRETE DRIVEWAY, ALLEY RETURN AND SIDEWALK

SCALE: NONE SHEET NO. 1 OF 1 SHEETS STA. TO STA.

F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
VARIOUS	2012-042-1	COOK	20	18
BD400-03	(BD-17)	CONTRACT NO.	60V31	
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT				

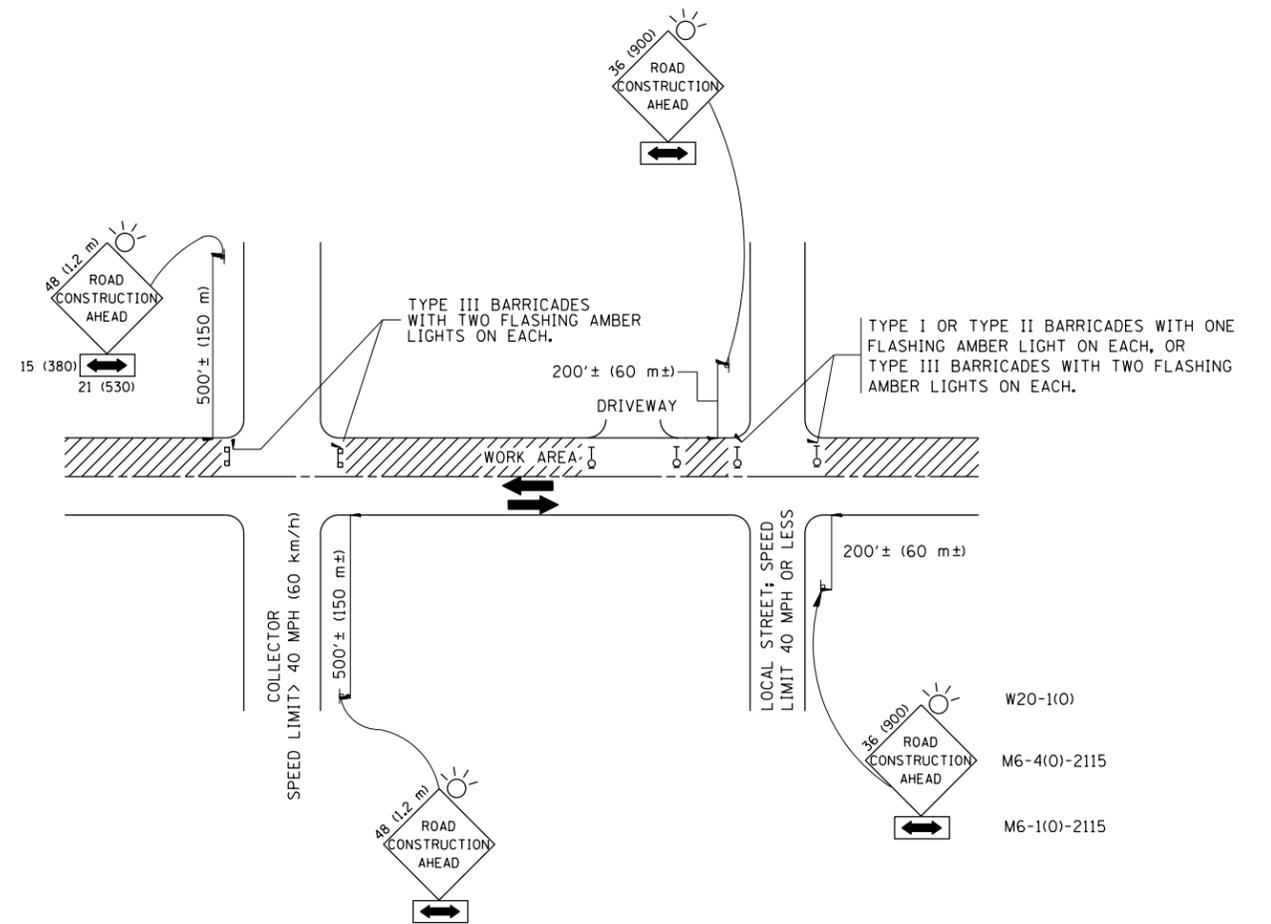

TRAFFIC CONTROL AND PROTECTION FOR SIDE ROADS, INTERSECTIONS, AND DRIVEWAYS

NOTES:

A. FOR NO LANE RESTRICTION ON THE SIDE ROAD OR DRIVEWAYS

1. SIDE ROAD WITH A SPEED LIMIT OF 40 MPH (60 km/h) OR LESS AS SHOWN ON THE DRAWING AND AS DIRECTED BY THE ENGINEER:
  - a) ONE ROAD CONSTRUCTION AHEAD SIGN 36 x 36 (900x900) WITH A FLASHER AND FLAG MOUNTED ON IT APPROXIMATELY 200' (60 m) IN ADVANCE OF THE MAIN ROUTE.
  - b) THE CLOSED PORTION OF THE MAIN ROUTE SHALL BE PROTECTED BY BLOCKING WITH TYPE I, TYPE II OR TYPE III BARRICADES, 1/3 OF THE CROSS SECTION OF THE CLOSED PORTION.
2. SIDE ROAD WITH A SPEED LIMIT GREATER THAN 40 MPH (60 km/h) AS SHOWN ON THE DRAWING AND AS DIRECTED BY THE ENGINEER:
  - a) ONE ROAD CONSTRUCTION AHEAD SIGN 48 x 48 (1.2 m x 1.2 m) WITH A FLASHER MOUNTED ON IT APPROXIMATELY 500' (150 m) IN ADVANCE OF THE MAIN ROUTE.
  - b) THE CLOSED PORTION OF THE MAIN ROUTE SHALL BE PROTECTED BY BLOCKING WITH TYPE III BARRICADES, 1/2 OF THE CROSS SECTION OF THE CLOSED PORTION.
3. WHEN THE SIDE ROAD LIES BETWEEN THE BEGINNING OF THE MAINLINE SIGNING AND THE WORK ZONE, A SINGLE HEADED ARROW (M6-1) SHALL BE USED IN LIEU OF THE DOUBLE HEADED ARROW (M6-4).

B. FOR A LANE CLOSURE ON A SIDE ROAD OR DRIVEWAY:

- USE APPLICABLE PORTIONS OF THE TYPICAL APPLICATION OF TRAFFIC CONTROL DEVICES (STD. 701501, STD. 701606 OR THE APPROPRIATE STANDARD). THE SPACING OF SIGNS AND BARRICADES SHALL BE ADJUSTED FOR FIELD CONDITIONS AS DIRECTED BY THE ENGINEER. THE DIRECTIONAL ARROW SHALL BE COVERED OR REMOVED WHEN NO LONGER CONSISTENT WITH THE SIDE ROAD LANE CLOSURE.
- C. ADVANCE WARNING SIGNS ARE TO BE OMITTED ON DRIVEWAY UNLESS OTHERWISE NOTED.
- D. THE TRAFFIC CONTROL AND PROTECTION FOR SIDE ROADS, INTERSECTIONS, AND DRIVEWAYS SHALL BE INCIDENTAL TO THE COST OF SPECIFIED TRAFFIC CONTROL STANDARDS OR ITEMS.

All dimensions are in millimeters (inches) unless otherwise shown.


FILE NAME =	USER NAME = curryw	DESIGNED - LHA	REVISED - J. OBERLE 10-18-95
et:\pwork\pwork\curryw\d0172364\PI69009-Design.dgn		DRAWN -	REVISED - A. HOUSEH 03-06-96
	PLOT SCALE = 5000.0000 ' / in.	CHECKED -	REVISED - A. HOUSEH 10-15-96
	PLOT DATE = 6/15/2012	DATE - 06-89	REVISED - T. RAMMACHER 01-06-00

STATE OF ILLINOIS  
DEPARTMENT OF TRANSPORTATION

TRAFFIC CONTROL AND PROTECTION FOR  
SIDE ROADS, INTERSECTIONS, AND DRIVEWAYS

SCALE: NONE SHEET NO. 1 OF 1 SHEETS STA. TO STA.

F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
VARIOUS	2012-042-1	COOK	20	19
TC-10		CONTRACT NO. 60V31		
FED. ROAD DIST. NO. 1 ILLINOIS FED. AID PROJECT				

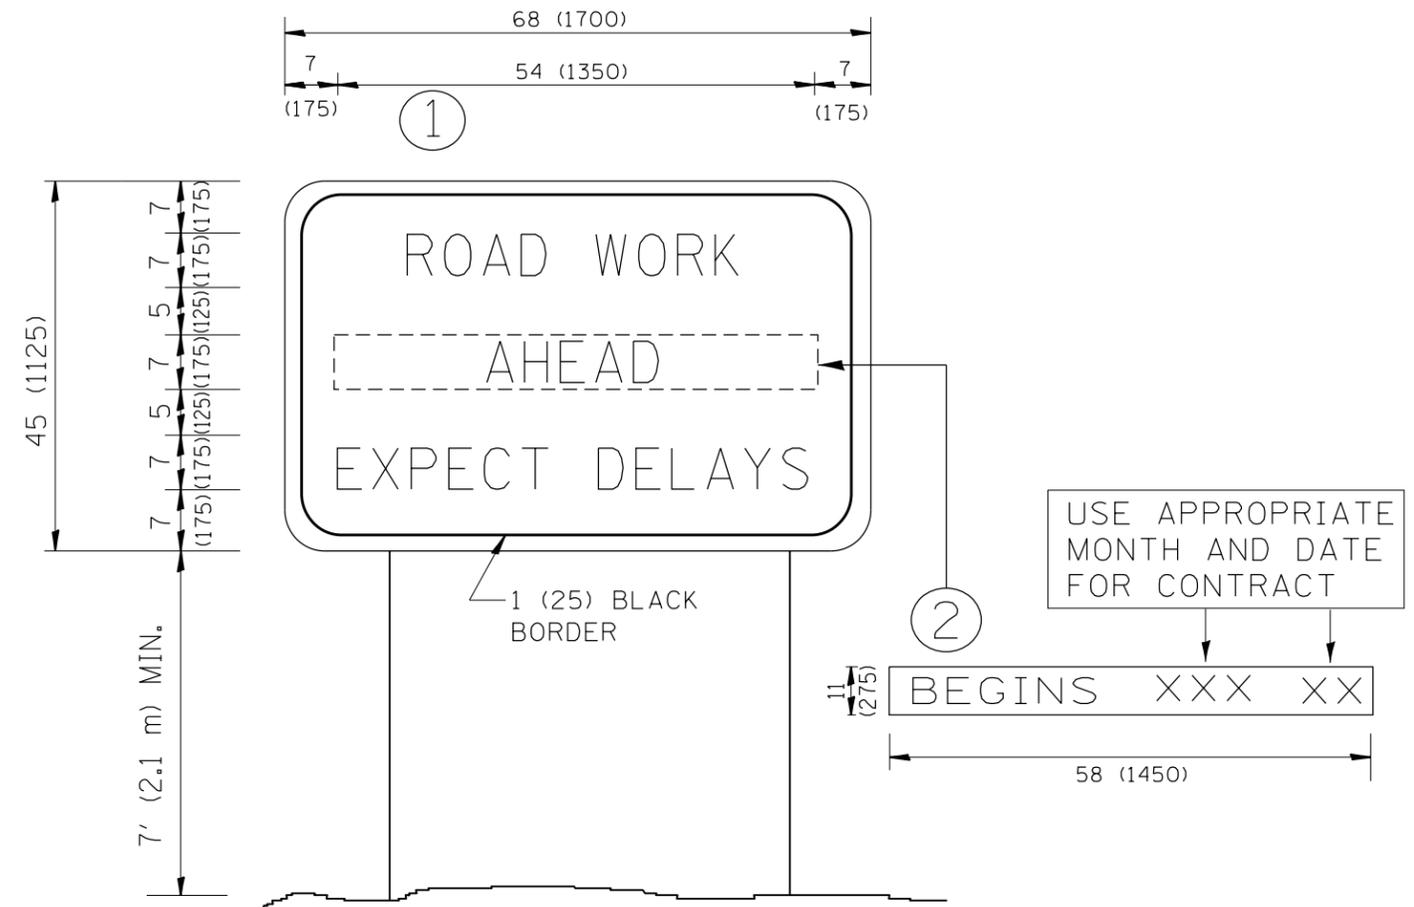

**NOTES:**

1. USE BLACK LETTERING ON ORANGE BACKGROUND.
2. ERECT SIGNS IN ADVANCE OF THE LOCATION FOR THE "ROAD CONSTRUCTION AHEAD" SIGN AT LOCATIONS AS DIRECTED BY THE ENGINEER.
3. ERECT SIGN ① WITH INSTALLED PANEL ② ONE WEEK PRIOR TO THE START OF CONSTRUCTION.
4. REMOVE PANEL ② SOON AFTER THE START OF CONSTRUCTION.
5. SEE SPECIAL PROVISION FOR "TEMPORARY INFORMATION SIGNING" FOR ADDITIONAL INFORMATION.
6. ONE SIGN ASSEMBLY EQUALS 25.70 SQ. FT. (2.3 SQ. M.)
7. SHALL BE PAID FOR AS TEMPORARY INFORMATION SIGNING.

ALL DIMENSIONS ARE IN INCHES (MILLIMETERS) UNLESS OTHERWISE SHOWN.

FILE NAME =	USER NAME = curryw	DESIGNED -	REVISED - R. MIRS 09-15-97	<b>STATE OF ILLINOIS DEPARTMENT OF TRANSPORTATION</b>	<b>ARTERIAL ROAD INFORMATION SIGN</b>	F.A. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
et:\pw\work\p1dot\curryw\d0172364\PI6909-Design.dgn	DRAWN -	REVISED - R. MIRS 12-11-97	VARIOUS			2012-042-1	COOK	20	20	
PLOT SCALE = 5000.0000 ' / in.	CHECKED -	REVISED - T. RAMMACHER 02-02-99	TC-22			CONTRACT NO. 60V31				
PLOT DATE = 6/15/2012	DATE -	REVISED - C. JUCIUS 01-31-07	SCALE: NONE			SHEET NO. 1 OF 1 SHEETS	STA.	TO STA.	FED. ROAD DIST. NO. 1   ILLINOIS   FED. AID PROJECT	