




CARDINAL HILL RD. (C.H. 37) STA 517+37.86 - STA 525+57.88 S.E.A. STA 517+37.86 — STA 518+07.86 S.E.A. STA 524+89.93 — STA 526+99.93 SEE INTERSECTION DETAIL, SHEET 36: STA 525+89.93 — STA 528+75.45

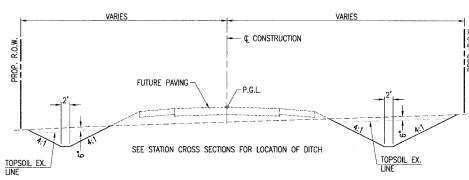


PROPOSED TYPICAL SECTION CARDINAL HILL RD. (C.H. 37) STA 528+75.45 - STA 538+75.70

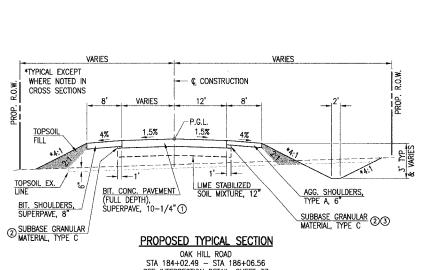

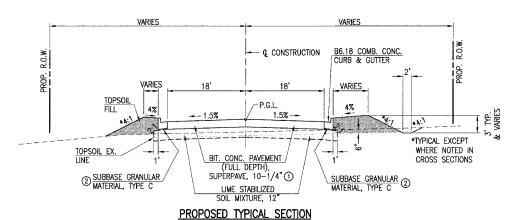

CARDINAL HILL RD. (C.H. 37)
STA 528+57.88 - STA 528+75.45
SEE INTERSECTION DETAIL, SHEET 36: STA 525+89.93 - STA 528+75.45

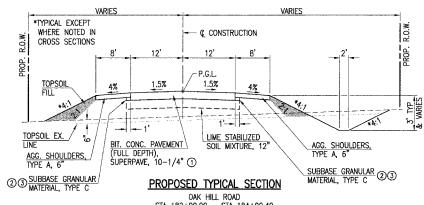


OAK HILL ROAD

STA 182+00.00 - STA 184+02.49

STA 186+06.56 - STA 194+33.00

EOP & SHLD TAPER: STA 182+00.00 - STA 183+00.00

SEE INTERSECTION DETAIL, SHEET 37: STA 184+02.49 - STA 186+06.56

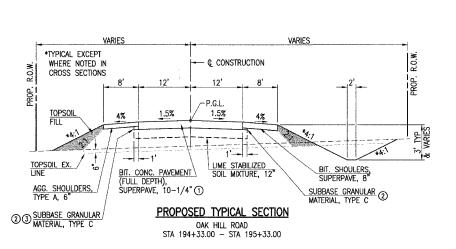

① 6-1/2" LOWER BINDER - 2 LIFTS 2-1/4" TOP LIFT BINDER (POLYMERIZED) 1-1/2" SURFACE LIFT (POLYMERIZED) [BITUMINOUS PRIME/RC 70 (FOG COAT) REQUIRED BETWEEN SUCESSIVE LIFTS]

2 COST INCLUDED WITH SOIL-LIME MIXTURE, 12"

(3) MATERIAL USED FOR AGGREGATE SHOULDERS, TYPE A CAN BE USED IN THIS LOCATION

TYPICAL SECTIONS SEC. 03-00167-04-FP CARDINAL HILL ROAD (C.H. 37) SANGAMON COUNTY

HANSON

SHEET 3 OF 5 03S2035B 6/21/06

OAK HILL ROAD STA 184+02.49 — STA 186+06.56 SEE INTERSECTION DETAIL, SHEET 37