



WEST FACE PIER 1




SOUTH FACE

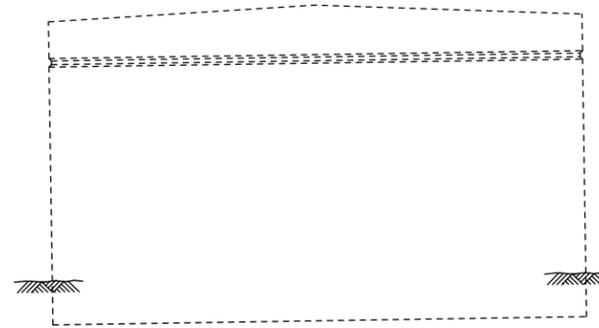

EAST FACE PIER 1




NORTH FACE

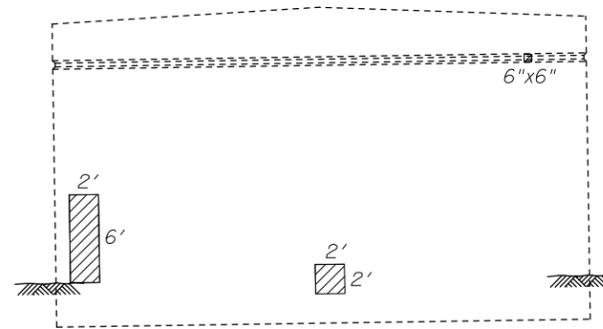


WEST FACE PIER 2



SOUTH FACE

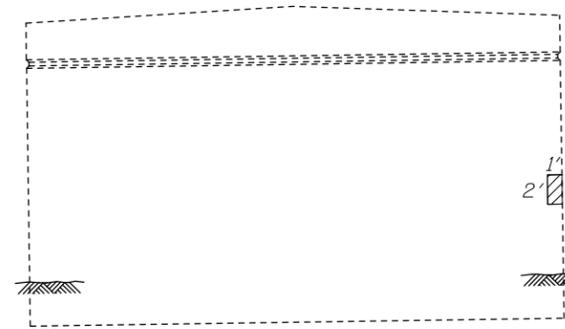

EAST FACE PIER 2



NORTH FACE

LEGEND

- Structural Repair of Concrete (Depth Equal To or Less Than 5")
- Structural Repair of Concrete (Depth Greater Than 5")

BILL OF MATERIAL

ITEM	UNIT	TOTAL
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	33
Structural Repair of Concrete (Depth Greater Than 5")	Sq. Ft.	4

BLANK, WESSELINK, COOK & ASSOCIATES ENGINEERS - CONSULTANTS DECATUR, ILLINOIS DESIGN FIRM NO. 184000894

FILE NAME =	USER NAME =	DESIGNED <i>PBB</i>	REVISED -
		CHECKED <i>RJC/SAL</i>	REVISED -
	PLOT SCALE =	DRAWN <i>MLO</i>	REVISED -
	PLOT DATE =	CHECKED <i>PBB</i>	REVISED -

**STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION**

**PIER CONCRETE REPAIR DETAILS
STRUCTURE NO. 023-0025**

SHEET NO. 10 OF 15 SHEETS

F.A.P. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
323	150BR-1	EDGAR	48	27
CONTRACT NO. 70609			ILLINOIS FED. AID PROJECT	