

STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

ROUTE NO.	SECTION	COUNTY	SHEETS	SHEET	SHEET NO. 16
FAS 899	BBR-2	SALINE	75	51	18 SHEETS
FED. ROAD DIST. NO. 4		ILLINOIS	FED. AID PROJECT		




78028


PIER
BILL OF MATERIAL

Item	Unit	Total
Epoxy Crack Injection	Foot	25
Structural Repair of Concrete (Depth Equal to or Less Than 5")	Sq. Ft.	17
Concrete Sealer	Sq. Ft.	15

REPAIR LEGEND

Inspection Date: 12/11/07

-  C-6' Crack to be epoxy injected
-  Delaminated or Spalled Area - Use Structural Repair of Concrete
-  Rust Spot

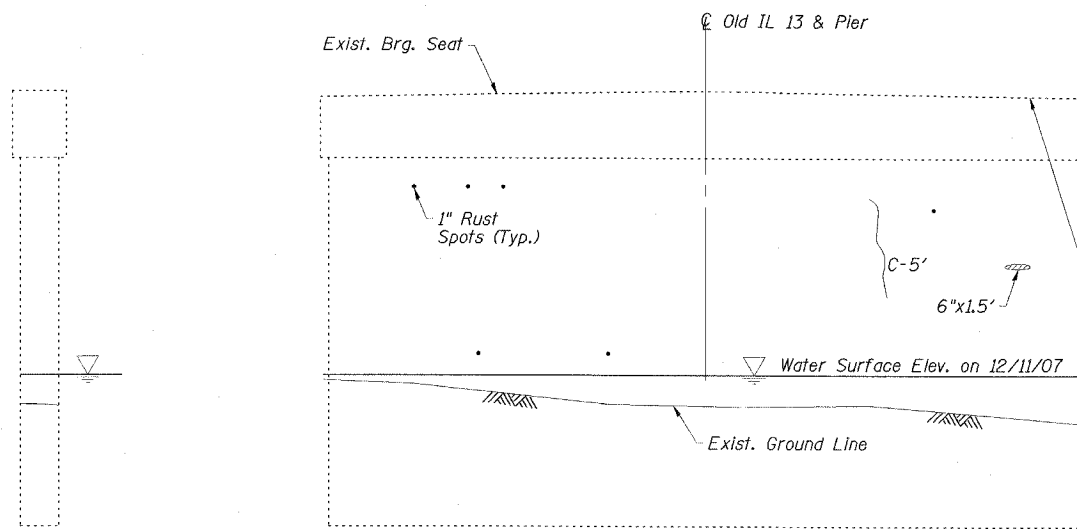


SOUTH END

EAST ELEVATION

EXISTING BEARING SEAT TO BE INSPECTED BY THE ENGINEER AFTER DECK BEAM REMOVAL. DETERIORATED CONCRETE AREAS SHALL BE REPAIRED (ESTIMATED 15 S.F. STRUCTURAL REPAIR OF CONCRETE DEPTH < 5") AND CRACKS SHALL BE SEALED (ESTIMATED 20' EPOXY CRACK INJECTION) IF FOUND. CONCRETE SEALER SHALL BE APPLIED TO CONCRETE REPAIR AREAS.

NOTE: PIER CRACK REPAIR LENGTHS AND STRUCTURAL REPAIR OF CONCRETE AREAS ARE ESTIMATED FROM 12-11-07 SURVEY WORK. ACTUAL LOCATIONS AND QUANTITIES OF REPAIRS SHALL BE SHOWN BY THE ENGINEER ON THE AS-BUILT PLANS FOR THIS SECTION.

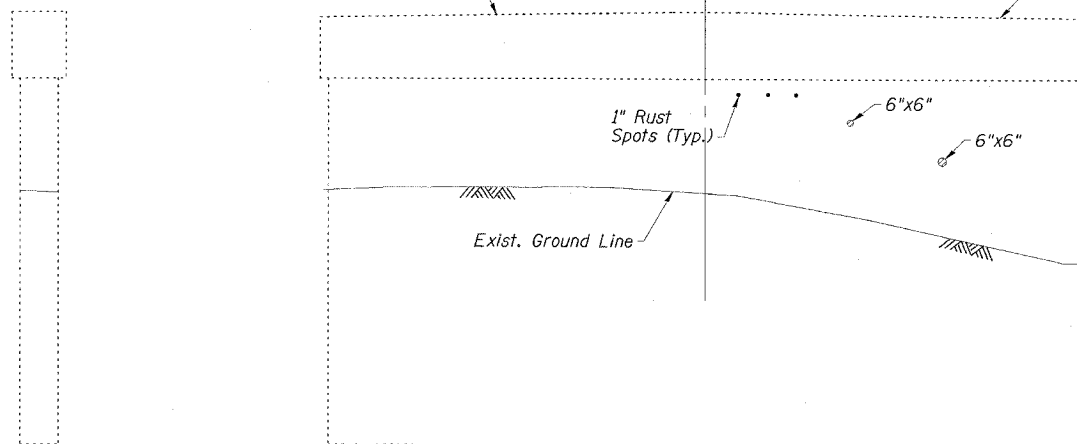

NORTH END

WEST ELEVATION

ESCA
CONSULTANTS, INC.

DESIGNED BY:	JMS	10/07
DRAWN BY:	CJ/HAS	10/07
CHECKED BY:	DAJ/ELH	01/08
APPROVED BY:	RDP	01/08

PIER
OLD IL 13 OVER BANKSTON FORK
FAS ROUTE 899 - SECTION 8BR-2
SALINE COUNTY
STATION 802+60.00
STRUCTURE NO. 083-0036