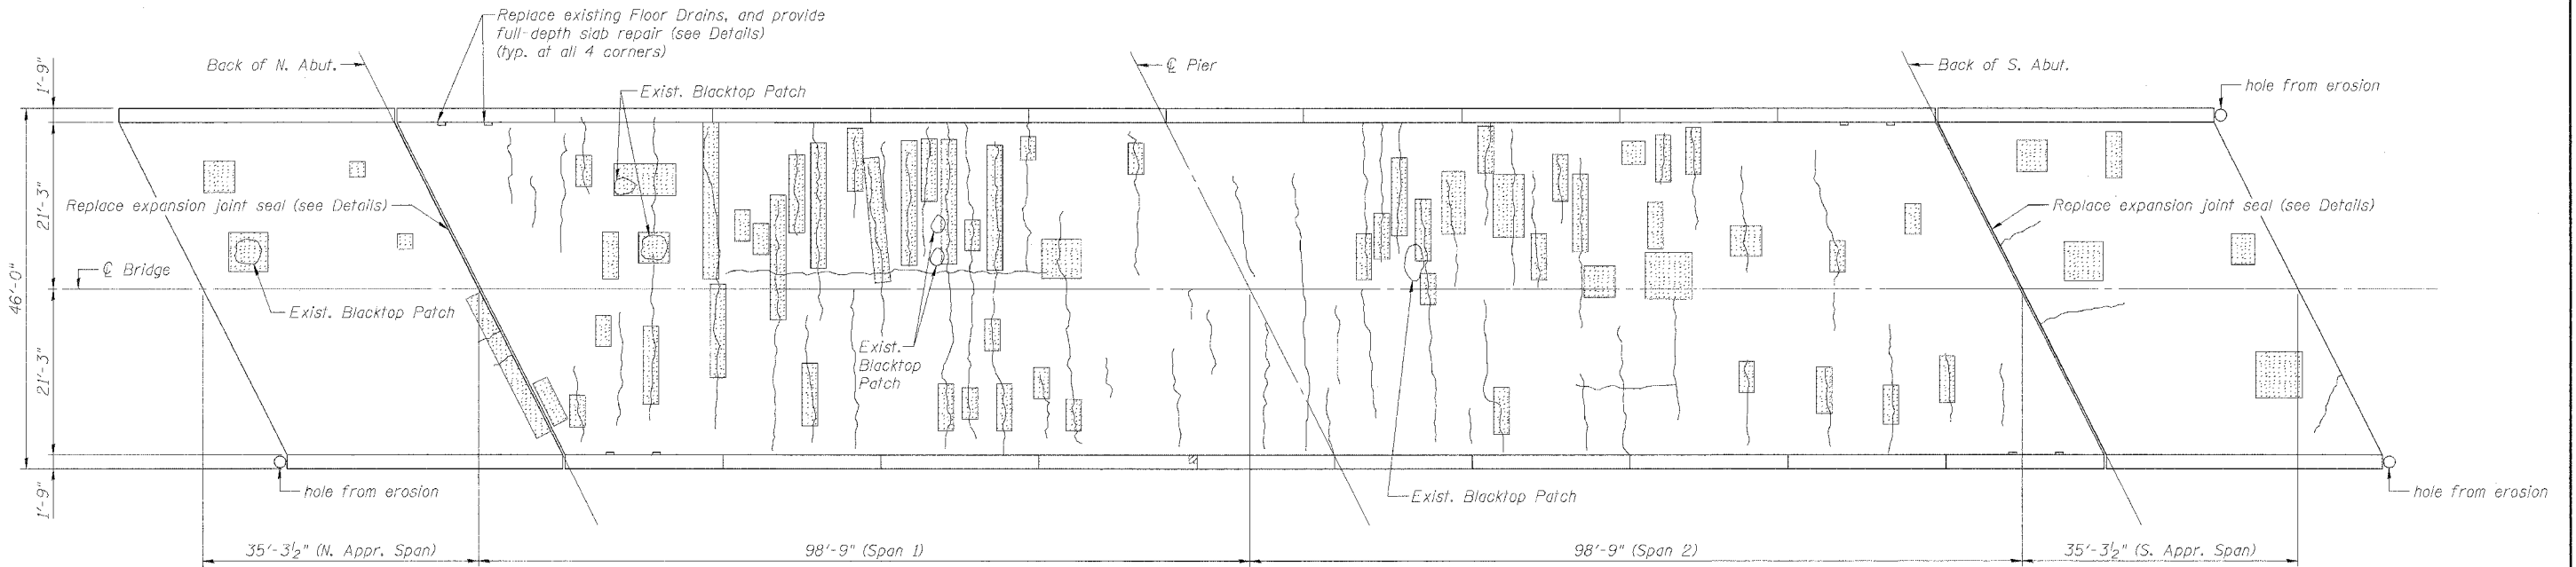


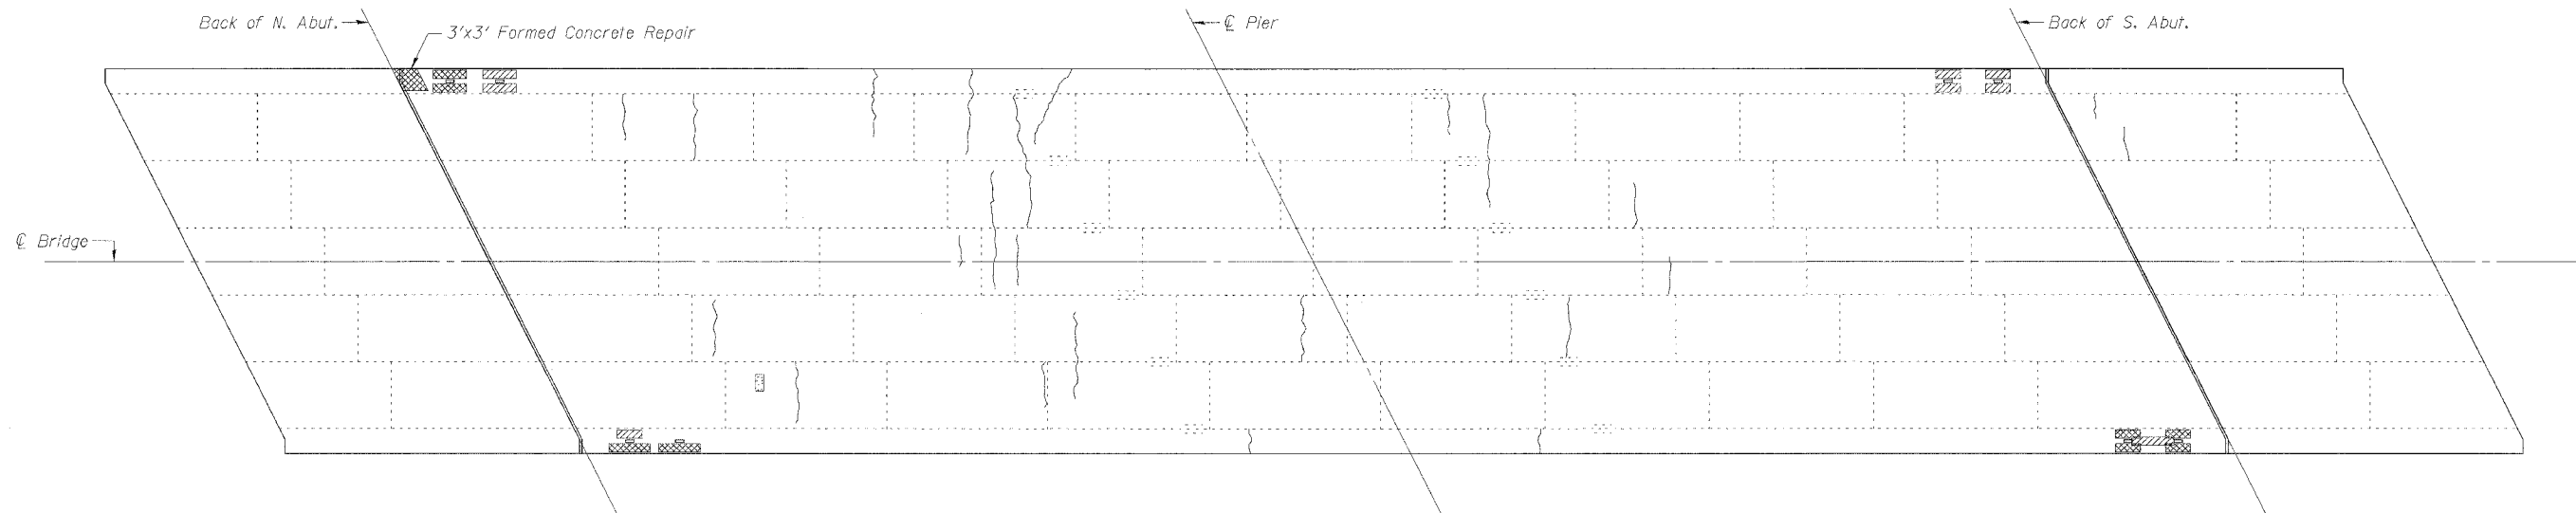
STATE OF ILLINOIS
DEPARTMENT OF TRANSPORTATION

SHEET 2
OF 8

F.A.I. RTE.	SECTION	COUNTY	TOTAL SHEETS	SHEET NO.
64	82-7RS-1, 82-7HB-1, 2I	ST. CLAIR	89	71
FED. ROAD DIST. NO.	ILLINOIS FED. AID PROJECT		CONTRACT NO. 76813	

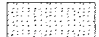





TOP PLAN



BOTTOM PLAN


LEGEND

-  Hollow or Unsound Concrete (1120 S.F.)
-  Spalled Concrete (29 S.F.)
-  Spalled Concrete with Exposed Rebar (39 S.F.)
-  Hairline Crack

NOTES:

Deck Condition Survey performed 9/02/2004.
The Engineer shall record actual locations of deck repair on the As-Built plans.

DECK PLAN
N. MAIN STREET (FAS 844) OVER
INTERSTATE 64
F.A.I. 64 SEC. 82-7RS-1, 82-7HB-1, 2I
ST. CLAIR COUNTY
STATION 883+53.16
STRUCTURE NO. 082-0182

 Johnson, Depp & Quisenberry CONSULTING ENGINEERS Springfield, Illinois	
DESIGNED: CDB	DRAWN: SJS
CHECKED: DCD	CHECKED: CDB/DCD

FILE: F:\110132_IL-DBVW\2 I-64 Bridge Repair\3-S\0182-main\1-02deck.dgn
USER: P. Roy
DATE: 03/28/2005 - 12:27:38